



099-1726

2000-01 Mazda MPV

Deteriorated Intake Manifold Gaskets May Be Causing Air Leakage

Certain 2000-01 MPV vehicles may experience MIL illumination with one or more of the following DTCs stored in the PCM memory:

^DTC P0300 – P0306 (engine misfire)

^DTC P0171 or P0174 (fuel system too lean)

^DTC P1170 or P1173 (O2 sensor no inversion)

The sealing of the intake manifold gasket may be deteriorated, causing air leakage. This leakage could be allowing un-metered air to enter the engine and triggering a false catalyst code.

**** Even if no leakage is found when initially inspecting the vehicle, this deterioration can still leave the intake manifold gasket in a weakened condition and subject to failure, triggering the false catalyst code.**

INTAKE MANIFOLD GASKETS MUST BE REPLACED PRIOR TO INSTALLING THIS CATALYTIC CONVERTER!