

# bosal



**096-1698**

**2004 model year Camry, Sienna, and Solara vehicles (3MZ-FE engine only) produced BEFORE the Production Change Effective VINs shown below.**

### **Affected Vehicles**

Model	Plant	Production Change Effective VIN
Camry	TMMK Line 1	4T1BA3#K*4U502118
	TMMK Line 2	4T1BA3#K*4U017745
Solara	TMMK	4T1CA3#P*4U017744

Model	Drivetrain	Production Change Effective VIN
Sienna	2WD	5TDZA2#C*4S112604
	AWD	5TDBA2#C*4S013366

## **Vacuum Leak in Intake Air Control Valve May Affect Fuel Trim**

Toyota Service Bulletin EG029-04 dated August 4, 2004 states that certain Toyota applications are prone to a vacuum leak that can cause a lean running condition.

This may or may not result in a MIL on condition displaying DTC P0171 or P0174, and may require replacement of the Intake Air Control Valve.

Failure to confirm this condition prior to replacement of the catalytic converter -- whether the above DTCs are present or not – can result in DTC P0420 / P0430 and ultimately premature catalytic converter failure.