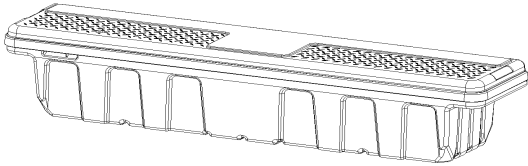
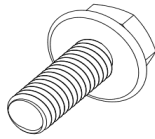

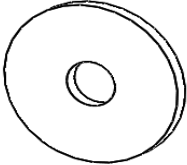

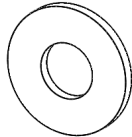
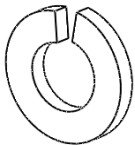
 
 
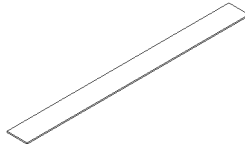



# Poly Tool Box Installation Instruction

|   |   |  |   |
|---|---|--|---|
| <b>A</b><br><br>TOOL BOX                 |   | <b>B</b><br><br>M6 BOLT<br>PN 822 X2     | <b>C</b><br><br>M6 NUT<br>PN 821 X2            |
| <b>D</b><br><br>1/4" WASHER<br>PN 265 X2 | <b>E</b><br><br>J-BOLT<br>PN 549 X2    | <b>F</b><br><br>3/8" WASHER<br>PN 113 X2 | <b>G</b><br><br>3/8" LOCK WASHER<br>PN 89 X2   |
| <b>H</b><br><br>3/8" NUT<br>PN 90 X2     | <b>I</b><br><br>VINYL CAP<br>PN 550 X2 | <b>J</b><br><br>GASKET<br>X1             | <b>K</b><br><br>MOUNTING BRACE<br>TB8370309 X2 |


**TOOLS REQUIRED**

10mm WRENCH/RATCHET  
 9/16" WRENCH/RATCHET



TAPE MEASURE

1/4" , 13/32" DRILL BIT


**Drill**



**1** Place the tool box in the bed of the truck and use the tape measure to center the box.

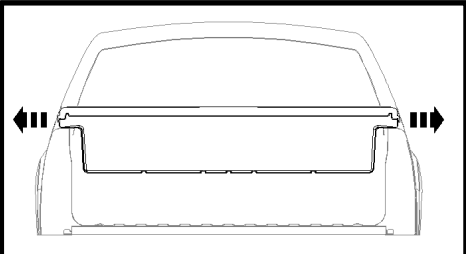
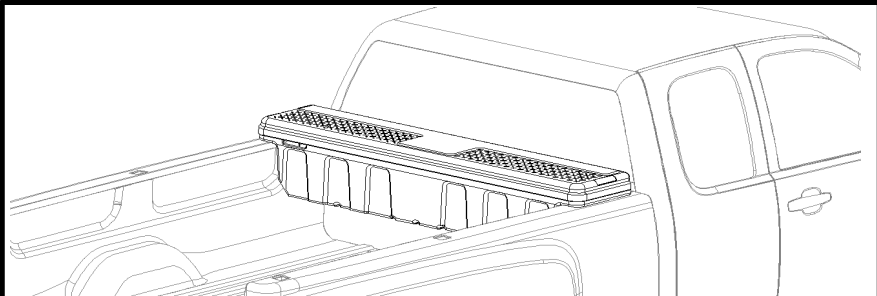



Place the mounting brace [K] on the truck bed, centered on the tool box, and against the tool box on the hinge side. Mark the hole locations in the brace.

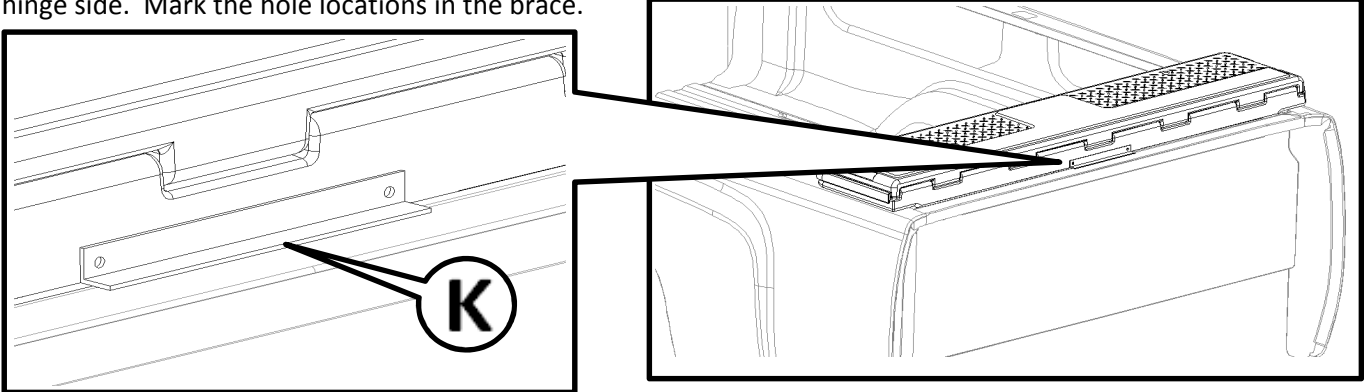



**2** Remove the tool box and drill the marked holes with a 1/4" bit.

Attach the mounting brace to the box using the M6 bolt [B], washer [D], and M6 nut [C].

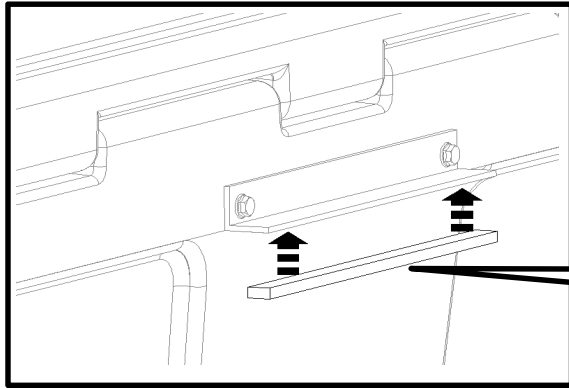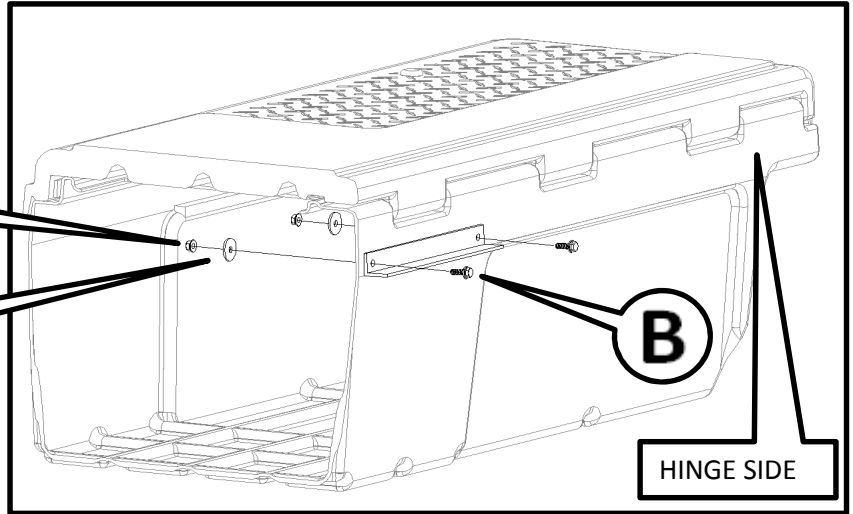


After attaching the mounting brace, apply the gasket [J] to the bottom side of the mounting brace.

**2** Place the tool box back in the truck bed and center the tool box.

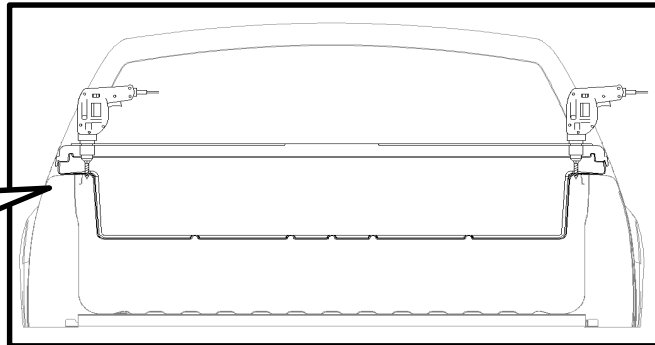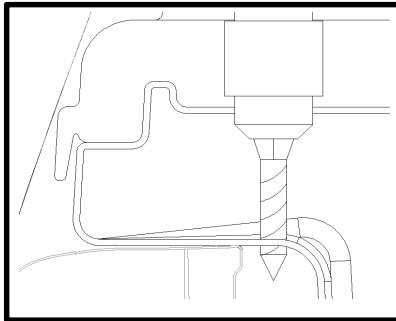

Drill a 13/32" hole at each end of the tool box between the edge of the tool box and the bed rail of the truck. Be sure that the bed rail is clear of the drill bit when drilling to avoid damage.

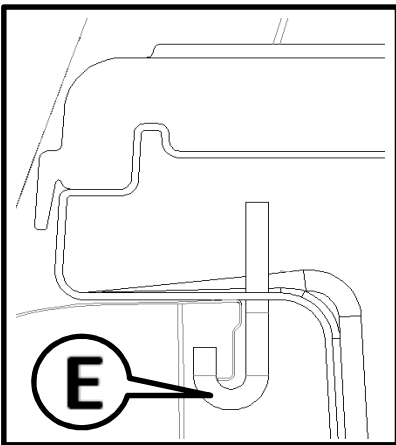

Bring the J-bolt [E] up through the drilled holes and hook over the bed rail. Attach using the washer [F], lock washer [G], nut [H]. Tighten until the tool box is secured and doesn't move. Do not over tighten. Once both J-bolts are installed. Cover the threads of the J-bolt with the vinyl cap [I].

