

Installation Instructions

Part Numbers:

Hyundai Elantra (Fascia trim required)

24795

Hyundai Accent 3-Door

60872

Kia Rio 5 (Fascia trim required)


77167

**Do Not Exceed Lower of Towing Vehicle
Manufacturer's Rating or**

2000 LB (908Kg) Max Gross Trailer Weight

200 LB (90.8 Kg) Max Tongue Weight

Wiring Access Location: PC3, PC4 (Rio 5 and Elantra)
PC1, PC2 (Accent)

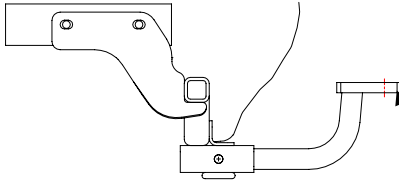

Hitch Shown In Proper Position

Drawbar must be used in the **RISE** position only.


Equipment Required:

Fastener Kit: 24795F

Wrenches: 17mm, 19mm, Small Philips

Tip Screwdriver

Drill Bits: None

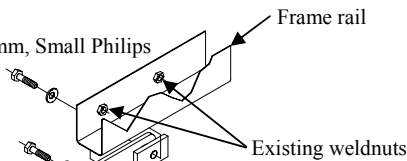

Note:

**Fasteners typical
both sides.**

Minor Fascia trim required.

**Obtain vehicle owner's
approval before cutting**

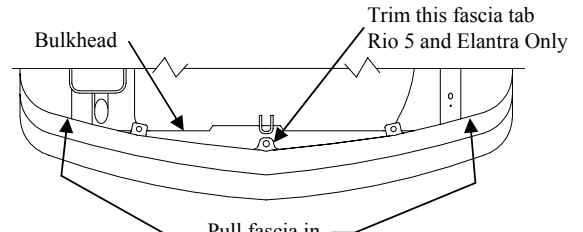


Figure 2


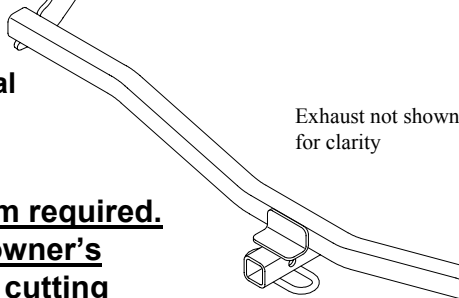


Figure 1

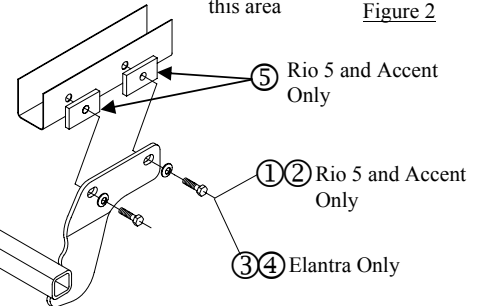

①	Qty. (4)	Bolt M12 x 1.25 x 40mm CL8.8	④	Qty. (4)	Conical Washer – 3/8"
②	Qty. (4)	Conical washer – 1/2"	⑤	Qty. (4)	Spacer – 3/8 x 1-1/2 x 3
③	Qty. (4)	Bolt M10 x 1.25 x 40mm CL8.8			

Note: Due to different configuration of the vehicle there will be extra hardware left over.

- Using a small Philips tip screwdriver, unscrew plastic screws while applying pressure to the opposite end (3) places. Both pieces of plastic need to be removed from support straps.
- Elantra and Rio 5 models:** Trim center fascia tab. Obtain vehicle owner's approval before cutting. See figure 2.
- Lower vehicle exhaust by removing rubber exhaust hanger.
- Lift hitch into position, passenger side first. Place crosstube over top of tail pipe, with the side bracket as far into space behind wheel well, rotate into position on the outside of the frame rail. It will be necessary to pull the fascia gently out of the way. See Figure 2.
- Raise the drivers side of the hitch into position on the outside of the frame rails and in front of bulkhead. Once again pull the fascia gently out of the way. See Figure 2.
- Install fasteners as shown in Figure 1. Hand tighten fasteners.
- Push hitch toward the rear of the vehicle and tighten all fasteners.
- Reattach rubber muffler hanger.
- Reattach fascia tabs.

Tighten all M10 CL 8.8 fasteners with torque wrench to 42 Lb.-Ft. (57 N*M)

Tighten all M12 CL 8.8 fasteners with torque wrench to 76 Lb.-Ft. (103 N*M)

Note: check hitch frequently, making sure all fasteners and ball are properly tightened. If hitch is removed, plug all holes in trunk pan or other body panels to prevent entry of water and exhaust fumes. A hitch or ball which has been damaged should be removed and replaced. Observe safety precautions when working beneath a vehicle and wear eye protection. Do not cut access or attachment holes with a torch.