PXAMG Bulletin

Problem: PXAMG Does not initialize with some Class II vehicles

The PXAMG is designed to work with vehicles that are programmed for a digital radio receiver (factory XM radio). Some vehicles do not come programmed and need to be taken to the GM dealer for this service.

Programming the Class 2 Databus Vehicle:

- Connect the OBD-2 adaptor to the vehicle.
- Configure TECH 2 to vehicle.
- Enter Radio Options in the menu.
- Scroll down to Digital Radio Receiver
- Highlight the option for XM radio (activate the option). If the option is currently highlighted, deactivate and re-activate the option.
- Do not change options for the CD changer function, regardless if the changer is present.
- Save all radio changes.

NOTES:

To have this function work, the PXAMG will need to be re-installed and re-initialized. Dis - connect the PXAMG and let it sit for a full 5 minutes before re-installing it.

The radio will not display XM Features without the PXAMG connected and initialized.







