

3"Side Bar

Part No. 1112190021/3

Fits: 2002-2009 2002-2009 Chevrolet Trailblazer 2002-2009 2002-2009 GMC Envoy











60-180 min

CUTTING NOT REQUIRED

DRILLING NOT REQUIRED



REMOVE CONTENTS FROM BOX. VERIFY ALL PARTS ARE PRESENT.



READ INSTRUCTIONS CAREFULLY BEFORE STARTING INSTALLATION.



DO NOT OVER TORQUE. STANDARD OPERATING LOAD FOR TIGHTEN BODY MOUNT NUTS & BOLTS VARIES FROM **45** TO **65** FOOT POUND.


PARTS LIST:				
Qty	Part Description	Qty	Part Description	
2	Side Tubes With Steps	16	M8 – 1.25 X 30mm Hex Head Bolt	
2	Front Mount Brackets	16	M8 Split Lock Washer	
2	Rear Mount Brackets	20	M8 Flat Washer	
4	Mount Braces	8	3/8" - 16 X 1.00" Button Head Cap Screw	
4	M8 – 1.25 Hex Nut	8	3/8" – Split Lock Washer	


INSTALLATION PROCEDURE

- 1. Begin installation by working on driver side of the vehicle (refer to Figures 1. 1- 1.3).
- 2. Install Mount Brackets to vehicle body posts using (2) M8 1.25 x 30mm hex head bolts, (2) M8 split lock washers, and (2) M8 flat washers, in that order. Hand tighten.
- 3. Fasten Mount Brace to inside rocker panel using (1) M8 1.25 x 30mm hex head bolt, (1) M8 split lock washer, and (1) M8 flat washer. Attach other end of Mount Brace to Mount Bracket using (1) M8 1.25 x 30mm hex head bolt, (2) M8 flat washers, (1) M8 split lock washer, and (1) M8 1.25 hex nut. Hand tighten.
- 4. Position Side Tube in place and fasten to Mount Brackets using (4) 3/8" 16 x 1.00" button head cap screws and (4) 3/8" split lock washers. Hand tighten.
- 5. Level and adjust Side Tube as desired and adjust Mount Brackets to ensure a solid fit. Torque 8mm hardware to 25 FT-LBS and 3/8" hardware to 30 FT-LBS.
- 6. Repeat process for passenger side of vehicle to complete installation.

Page **1** of **3** Rev 010115

Figure 1.1 - Front Driver-Side View

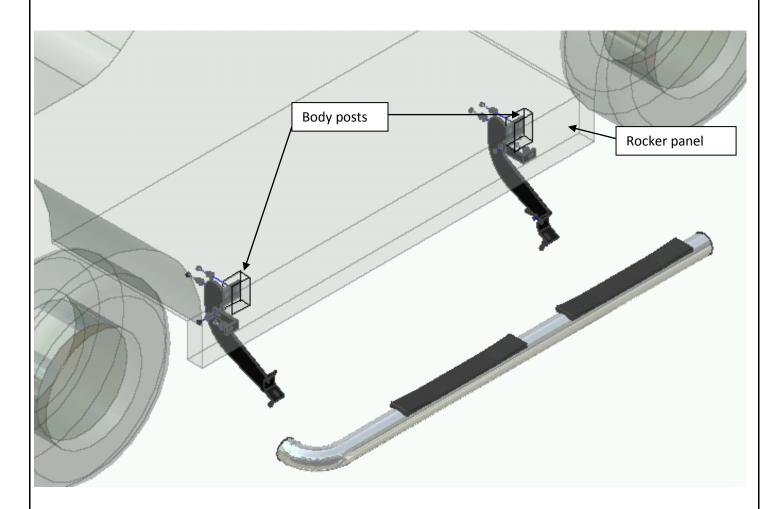

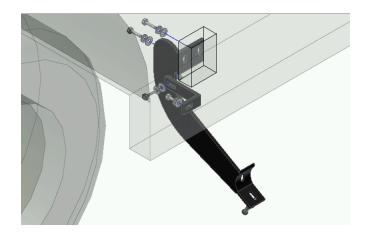

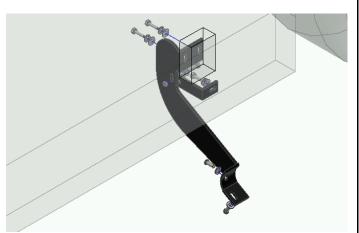


Figure 1.2 - Front Bracket

Figure 1.3 - Rear Bracket

Page **2** of **3** Rev 010115


PARTS IDENTIFICATION GUIDE

Driver Side tube packed using "Green" color foam sheet. Passenger Side tube packed using "White" color foam sheet

No.	Parts Identification		
1	Passenger / Right 'Rear' Bracket marked "PR"		
2	Driver / Left 'Rear' Bracket marked "DR"		
3	Passenger / Right 'Center' Bracket marked "PC"		
4	Driver / Left 'Center' Bracket marked "DC"		
5	Passenger / Right 'Front' Bracket marked "PF"		
6	Driver / Left 'Front' Bracket marked " DF "		

Note:

- This guide is to identify the parts and not a reference for part count.
- Product / Bracket image is for representative purpose only.
- Actual design may vary based on application.
- Refer Installation Instructions for Hardware Kit detail.

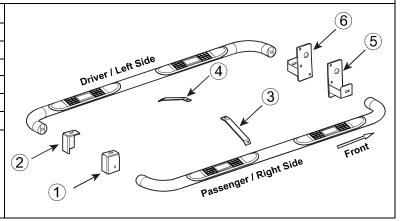

PRODUCT CARE

- Periodically check the product to ensure all fasteners are tight and components are intact.
- Regular waxing is recommended to protect the finish of the product.
- Use ONLY Non-Abrasive automotive wax. Use of any soap, polish or wax that contains an abrasive is detrimental and Can scratch the finish leading to corrosion.
- Aluminum polish may be used to polish small scratches and scuffs for Stainless Steel finish.
- Mild soap may be used to clean the product for both Stainless Steel and Black finish.

FAQ's

1. Hardware's are not of correct size.

In GMC / Chevrolet truck model 2006 & up, customer needs to reuse the factory body bolts to install the bracket. If your vehicle is not GMC / Chevrolet 2006 & up, please ensure that holes are not partially covered with any plastic grommet or rust? If it is, please remove the plastic grommet & rust from the thread holes & re-try the installation.

2. Mounting Bracket are not getting Installed properly.

In some cases Illustration images shown in Installation manual may not be the exactly same as per actual vehicle images, also if Driver / Passenger side mounting brackets are very identical in the design, suggest referring Parts Identification guide to avoid fitment issue.

3. Products are thumping / rattling after installation.

Please ensure that all required mounting brackets / hardware's are installed & tighten correctly. Suggest using white lithium / regular grease between the metal to metal contact surfaces.

4. Side Bar is not aligning with vehicle / Step Pads are not aligning with vehicle doors.

Side bar may be interchanged or mounting brackets are not installed at the correct position in the vehicle. Please refer Parts identification guide.

5. Missing / Excess Hardware.

Recheck hardware count as per the part list.

6. Product not installing properly.

Ensure make model year, cab length and bed size of your vehicle is listed in the application. All installation steps are followed correctly.

Page 3 of 3 Rev 010115