

Fits: 2007 - Current

# 3" Side Bar

# Part No. 1150530071 / 3



**Toyota Tundra Regular Cab** 









REMOVE CONTENTS FROM BOX. VERIFY ALL PARTS ARE PRESENT.



60-180 min



**Cutting Not** Required



**Drilling Not** Required




READ INSTRUCTIONS CAREFULLY BEFORE STARTING INSTALLATION.



DO NOT OVER TORQUE. STANDARD OPERATING LOAD FOR TIGHTEN BODY MOUNT NUTS & BOLTS VARIES FROM 45 TO 65 FOOT POUND.


PARTS LIST:				
Qty	Part Description	Qty	Part Description	
1	Driver/Left Front Mounting Bracket	16	8-1.25mm x 30mm Hex Head Bolts	
1	Passenger/Right Front Mounting Bracket	16	8mm Lock Washers	
1	Driver/Left Rear Mounting Bracket	16	8mm ID x 24mm OD x 2mm Flat Washers	
1	Passenger/Right Rear Mounting Bracket			

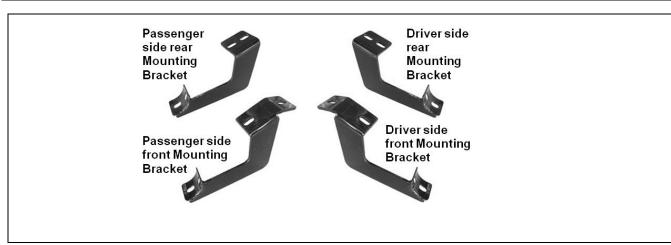


## **INSTALLATION PROCEDURE**

1. Starting on the driver side front of the vehicle, remove the (2) plastic plugs or factory hex bolts to uncover the threaded holes used to install the front Mounting Bracket. Partially attach the driver side front Mounting Bracket to the vehicle using the included (2) 8mm x 30mm Hex Head Bolts, (2) 8mm Lock Washers, and (2) 8mm Flat Washers, (Figure 2). Do not tighten hardware at this time.


Rev 010115 Page 1 of 3

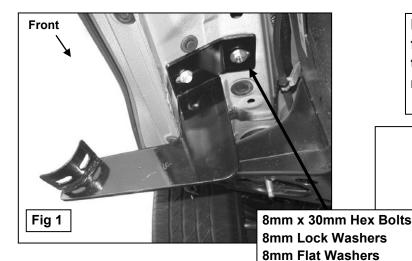


Remove the (2) plastic plugs or factory hex bolts to uncover the threaded holes in each mounting location.

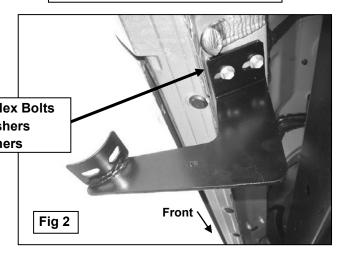

- 2. Repeat Step 2 to attach the rear Mounting Bracket to the vehicle.
- 3. Align the holes on the bottom of the Side Bar with the holes on the Mounting Brackets. Attach the Side Bar to the Mounting Brackets with the included (4) 8-1.25mm x 30mm Hex Head Bolts, (4) 8mm Flat Washers, and (4) 8mm Lock Washers, (Figure 4). Do not tighten at this time.

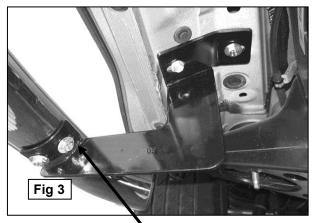

8mm x 30mm Hex Bolts 8mm Lock Washers 8mm Flat Washers

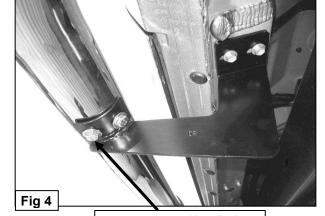

8mm x 30mm Hex Bolts 8mm Lock Washers 8mm Flat Washers

- 4. Level and adjust Side Bar properly and tighten all hardware.
- **5.** Repeat Steps 1-4 for passenger Sidebar installation.



Page **2** of **3** Rev 010115


#### PARTS IDENTIFICATION GUIDE

## Driver Side tube packed using "Green" color foam sheet. Passenger Side tube packed using "White" color foam sheet

No.	Parts Identification
1	Passenger / Right 'Rear' Bracket marked "PR"
2	Driver / Left 'Rear' Bracket marked "DR"
3	Passenger / Right 'Center' Bracket marked "PC"
4	Driver / Left 'Center' Bracket marked "DC"
5	Passenger / Right 'Front' Bracket marked "PF"
6	Driver / Left 'Front' Bracket marked " <b>DF</b> "

#### Note:

- > This guide is to identify the parts and not a reference for part count.
- For part count, refer Parts List.
- Product / Bracket image is representative and actual design may vary.

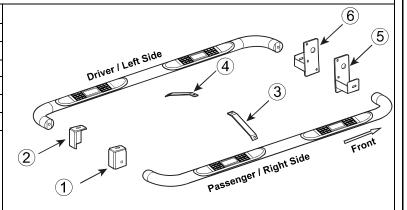

#### PRODUCT CARE

- Periodically check the product to ensure all fasteners are tight and components are intact.
- Regular waxing is recommended to protect the finish of the product.
- Use ONLY Non-Abrasive automotive wax. Use of any soap, polish or wax that contains an abrasive is detrimental and can scratch the finish leading to corrosion.
- Aluminum polish may be used to polish small scratches and scuffs for Stainless Steel finish.
- Mild soap may be used to clean the product for both Stainless Steel and Black finish.

#### FAQ's

#### 1. Hardware's are not of correct size.

In GMC / Chevrolet truck model 2006 & up, customer needs to reuse the factory body bolts to install the bracket. If your vehicle is not GMC / Chevrolet 2006 & up, ensure that holes are not partially covered with any plastic grommet or rust? If it is, remove the plastic grommet & rust from the thread holes & re-try the installation.

### 2. Mounting Bracket are not getting Installed properly.

In some cases Illustration images shown in Installation manual may not be the exactly same as per actual vehicle images ,also if Driver / Passenger side mounting brackets are very identical in the design, suggest referring Parts Identification guide to avoid fitment issue.

#### 3. Products are thumping / rattling after installation.

Ensure that all required mounting brackets / hardware's are installed & tighten correctly. Suggest using white lithium / regular grease between the metal to metal contact surfaces.

#### 4. Side Bar is not aligning with vehicle / Step Pads are not aligning with vehicle doors.

Side bar may be interchanged or mounting brackets are not installed at the correct position in the vehicle. Refer Parts identification guide.

# 5. Missing / Excess Hardware.

Recheck hardware count as per the part list.

#### 6. Product not installing properly.

Ensure make model year, cab length and bed size of your vehicle is listed in the application. All installation steps are followed correctly.

Page **3** of **3** Rev 010115