

CAN FIT IN DIESEL TRUCKS

6" Oval Nerf Bar

Part No. A8215S/B

Fits: 2005 - Current

Toyota Tacoma Double Cab

REMOVE CONTENTS FROM BOX. VERIFY ALL PARTS ARE PRESENT.


120-180 min



READ INSTRUCTIONS CAREFULLY BEFORE STARTING INSTALLATION.


DO NOT OVER TORQUE. STANDARD OPERATING LOAD FOR TIGHTEN BODY MOUNT NUTS & BOLTS VARIES FROM **45** TO **65** FOOT POUND.

PARTS LIST:				
Qty	Part Description	Qty	Part Description	
1	Driver Sidebar	1	Driver/Left Rear Mounting Bracket	
1	Passenger Sidebar	1	Passenger/Right Rear Mounting Bracket	
1	Driver/Left Front Mounting Bracket	24	8-1.25mm x 30mm Hex Bolts	
1	Passenger/Right Front Mounting Bracket	24	8mm x 24mm OD x 2mm Flat Washers	
1	Driver/Left Middle Mounting Bracket	24	8mm Lock Washers	
1	Passenger/Right Middle Mounting Bracket			

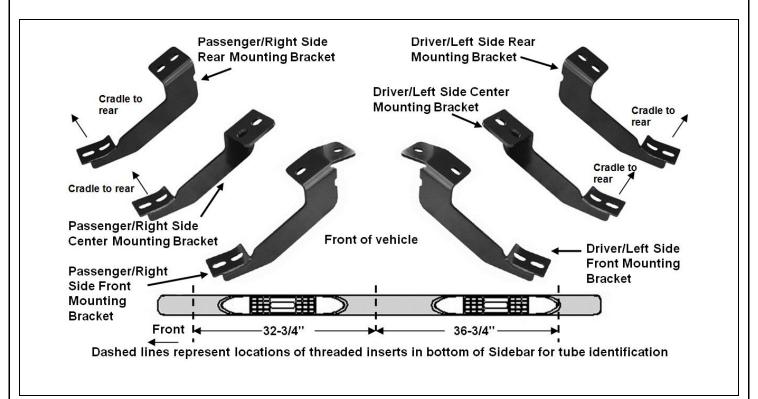


INSTALLATION PROCEDURE

1. Starting on the driver side front of the vehicle, use a flat screw driver to remove the plastic plugs covering the threaded holes in the body panel, (Figure 1). Select the driver side front Mounting Bracket and bolt it to the vehicle using the included (2) 8mm x 30mm Hex Bolts, (2) 8mm Lock Washers and (2) 8mm Flat Washers, (Figure 2). Do not tighten hardware at this time.

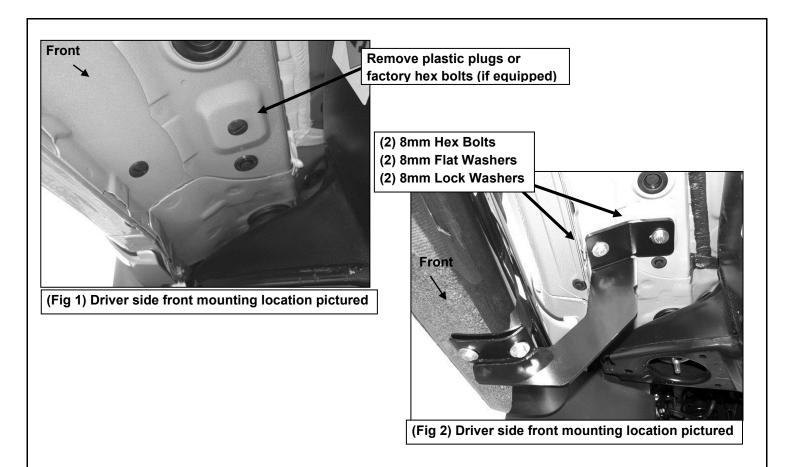

- 2. Repeat Step 1 for center and rear Mounting Bracket installation, (Figures 3 & 4).
- 3. **IMPORTANT**: Use the illustration on this page to identify the sidebars before continuing with the installation. Verify that the Brackets are in the correct locations as illustrated above. Carefully place the driver Sidebar onto the Brackets. Align the inserts in the bottom of the Sidebar with the slots on the Mounting Brackets. Attach the Sidebar to the Mounting Brackets with the included (6) 8mm x 30mm Hex Bolts, (6) 8mm Lock Washers and (6) 8mm Flat Washers, (**Figure 4**). Do not tighten hardware at this time.

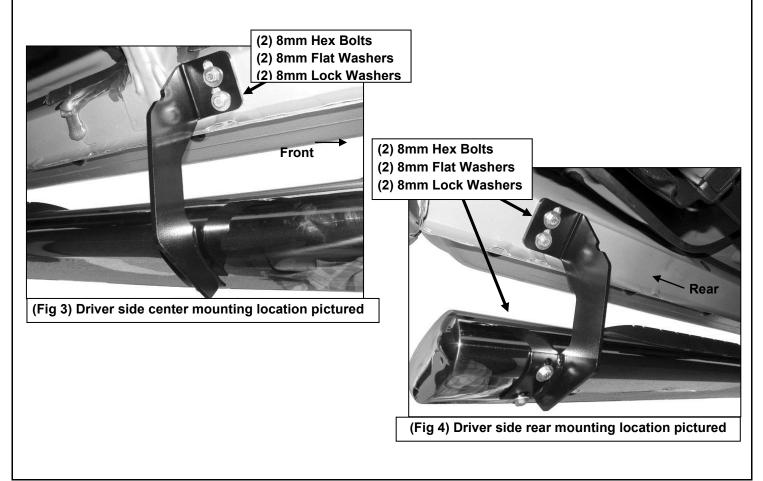

- 4. Level and adjust the Sidebar properly and tighten all hardware.
- 5. Repeat Steps 1 2 for passenger Sidebar installation.



PARTS IDENTIFICATION GUIDE

Driver Side tube packed using "Green" color foam sheet. Passenger Side tube packed using "White" color foam sheet

No.	Parts Identification	(6)
1	Passenger / Right 'Rear' Bracket marked "PR"	
2	Driver / Left 'Rear' Bracket marked "DR"	
3	Passenger / Right 'Center' Bracket marked "PC"	Driver / Left Side
4	Driver / Left 'Center' Bracket marked "DC"	
5	Passenger / Right 'Front' Bracket marked "PF"	
6	Driver / Left 'Front' Bracket marked "DF"	
> F	This guide is to identify the parts and not a reference for part count. For part count, refer Parts List. Product / Bracket image is representative and actual design may vary.	2 1 Passenger Right Side Passenger Right Side

PRODUCT CARE

- Periodically check the product to ensure all fasteners are tight and components are intact.
- Regular waxing is recommended to protect the finish of the product.
- Use ONLY Non-Abrasive automotive wax. Use of any soap, polish or wax that contains an abrasive is detrimental and can scratch the finish leading to corrosion.
- Aluminum polish may be used to polish small scratches and scuffs for Stainless Steel finish.
- Mild soap may be used to clean the product for both Stainless Steel and Black finish.

FAQ's

1. Hardware's are not of correct size.

In GMC / Chevrolet truck model 2006 & up, customer needs to reuse the factory body bolts to install the bracket. If your vehicle is not GMC / Chevrolet 2006 & up, ensure that holes are not partially covered with any plastic grommet or rust? If it is, remove the plastic grommet & rust from the thread holes & re-try the installation.

2. Mounting Bracket are not getting Installed properly.

In some cases Illustration images shown in Installation manual may not be the exactly same as per actual vehicle images ,also if Driver / Passenger side mounting brackets are very identical in the design, suggest referring Parts Identification guide to avoid fitment issue.

3. Products are thumping / rattling after installation.

Ensure that all required mounting brackets / hardware's are installed & tighten correctly. Suggest using white lithium / regular grease between the metal to metal contact surfaces.

4. Side Bar is not aligning with vehicle / Step Pads are not aligning with vehicle doors.

Side bar may be interchanged or mounting brackets are not installed at the correct position in the vehicle. Refer Parts identification guide.

5. Missing / Excess Hardware.

Recheck hardware count as per the part list.

6. Product not installing properly.

Ensure make model year, cab length and bed size of your vehicle is listed in the application. All installation steps are followed correctly.