


INSTALLATION INSTRUCTIONS

PRO TRAXX 4 OVAL STEP BAR


APPLICATION: 2020 Ford Explorer PART NUMBER: 21-24170, 21-24175

ITEM 1		CONTENT				
1	QUANTITY	DESCRIPTION	TOOLS NEEDED			
	1	DRIVER STEP BAR	13MM SOCKET			
2	1	PASSENGER STEP BAR	RATCHET			
3	3	DRIVER SIDE BRACKETS	TORQUE WRENCH			
4	3	PASSENGER SIDE BRACKETS	15MM SOCKET			
5	6	M10 HEX HEAD BOLT (YELLOW ZINC)				
6	6	M10 SPLIT LOCK WASHER (YELLOW ZINC)				
7	6	M10 FLAT WASHER (YELLOW ZINC)				
8	6	M10 SERRATED FLANGE NUT (YELLOW ZINC)				
9	6	M8 HEX HEAD BOLT (YELLOW ZINC)				
10	6	M8 SPLIT LOCK WASHER (YELLOW ZINC)				
11	6	M8 FLAT WASHER (YELLOW ZINC)				
12	12	M6 HEX HEAD BOLT (YELLOW ZINC)				
13	24	M6 FLAT WASHER (YELLOW ZINC)				
14	12	M6 NYLOCK NUT (YELLOW ZINC)				
15	12	M10 BUTTON HEAD BOLT (BLACK ZINC)				
16	12	M10 TOOTH LOCK WASHER (BLACK ZINC)				
17	12	M10 FLAT WASHER (BLACK ZINC)				
18	6	M8 U-CLIP				
19	6	BRACKET COVER				
NTI-SEIZE LUE	BRICANT MUST E	BE USED ON ALL STAINLESS STEEL FASTENERS TO PREVENT THREA	D DAMAGE AND GALLIN			
TEM 1						

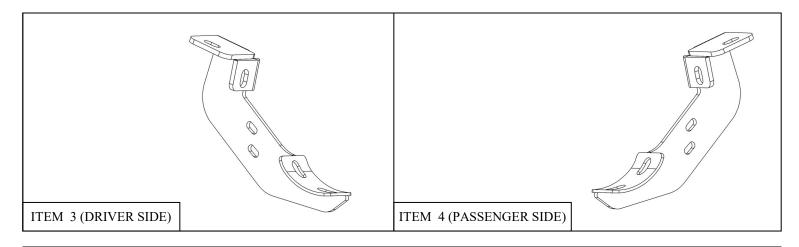


PROCEDURE

- Remove contents from box, verify if all parts listed are present and free from damage. Carefully read and understand all instructions before attempting installation.
 Failure to identify damage before installation could lead to a rejection of any claim.
- 2. Locate the rocker panel underneath the diver side of the vehicle. At each bracket location, install a M8 U-clip on the top side, and a M10 Serrated flange nut on the front side of the rocker panel (farthest hole back). *Note: The nut will squeeze in between two pieces of sheet metal. See Figure 1*.

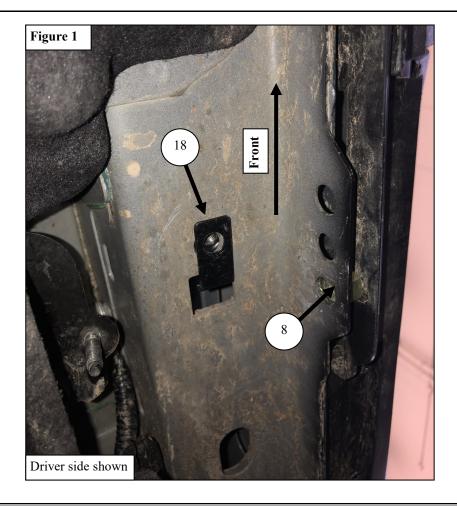

WESTIN

3. Locate 3 Driver Side Mounting Brackets (item 3). At each location, using M8 and M10 hardware, loosely assemble the brackets to the rocker panel. See Figures 2 and 3.

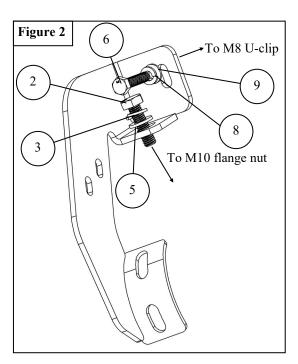





4. Ensure the brackets are mounted as shown in Figure 4.

Figure 4		
	0	0
	Front	
Driver Side Shown		



- 5. Use the supplied M6 Hardware to attach the Bracket Covers to the Mounting Brackets. See Figure 5.
- 6. Use the supplied Black M10 Hardware to attach the Step Bars to the Mounting Brackets. See Figure 6.
- 7. Repeat Steps 2-6 on the passenger side of the vehicle using the Passenger Side Mounting Brackets (item 4).
- 8. Tighten all hardware as specified: M6 to 7 ft-lbs, M10 to 38 ft-lbs.

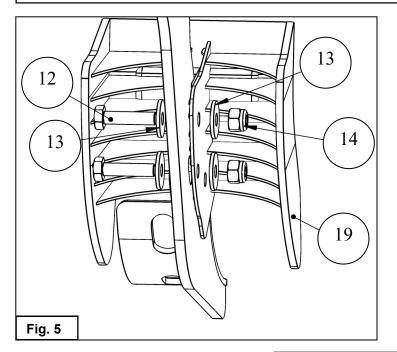

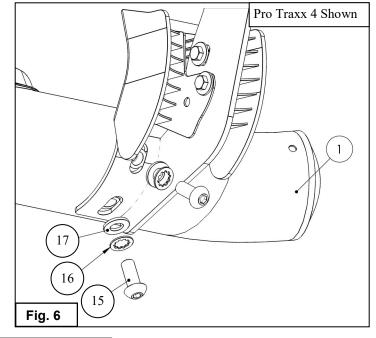

INSTALLATION COMPLETE



CARE INSTRUCTIONS

- REGULAR WAXING IS RECOMMENDED. DO NOT USE ANY TYPE OF POLISH OR WAX THAT MAY CONTAIN ABRASIVES.
- STAINLESS STEEL PRODUCTS CAN BE CLEANED WITH MILD SOAP AND WATER. STAINLESS STEEL POLISH SHOULD BE USED TO POLISH SMALL SCRATCHES.
- GLOSS BLACK FINISHES SHOULD BE CLEANED WITH MILD SOAP AND WATER.

WESTIN







Failure to follow these instructions could lead to death, personal injury, and / or property damage.

Failure to follow these instructions could lead to death, personal injury, and / or property damage.

FASTENERS:

All Westin supplied fasteners must be utilized and installed in accordance with the installation instructions and apply torque to the specifications as defined. DOUBLE CHECK ALL FASTENERS BEFORE INITIAL USE, AND PERIODICALLY IN THE FUTURE TO ENSURE PROPER FUNCTION AND SAFETY.

DRILLING:

Most Westin products do not require drilling for installation. If drilling is defined as required, use caution when drilling a vehicle. FAILURE TO REVIEW AN AREA TO BE DRILLED MAY RESULT IN PERSONAL INJURY AND/OR INJURY TO OTHERS AS WELL AS VEHICLE DAMAGE.

EYE PROTECTION:

ALWAYS WEAR SAFETY GLASSES OR GOGGLES DURING THE INSTALLATION PROCESS TO AVOID PERSONAL INJURY.

MAXIMUM TOWING/CARRYING CAPACITY: (if applicable)

The Westin Receiver Hitches will have a visible tow rating label affixed directly on the product. User should never exceed the vehicle manufacturers maximum tow and weight rating regardless of the capacity of the hitch. FAILURE TO FOLLOW THESE GUIDELINES WILL VOID THE WESTIN WARRANTY AND MAY RESULT IN PERSONAL INJURY AND/OR INJURY TO OTHERS AS WELL AS VEHICLE DAMAGE.

FOR CALIFORNIA RESIDENTS ONLY-PROP 65 WARNING:

Some products may contain chemicals such as DEHP, which can cause cancer, birth defects or other reproductive harm.

