



## Have you experienced an issue with the blower motor speed selection on a Cadillac Escalade?

Have you experienced an issue with the blower motor speed selection on a Cadillac Escalade (1999–2006)?

The most likely problem is the blower motor resistor has failed and will require replacement. Another common problem is the electrical connector to the blower motor resistor may have a short causing the socket connection to melt.



**gpd has the answer!**

The 1711755 is a replacement electrical connector that comes with the same color coding as the OE wiring harness and includes heat shrink over the butt connectors. All you need to do is cut the old electrical connector out, match the wire colors together, then crimp the connectors. Finally, using a heat source, shrink the tubing over the connectors to provide a waterproof seal.




#1711755


### Resistors that fit this Cadillac:




1711711 (with center console)

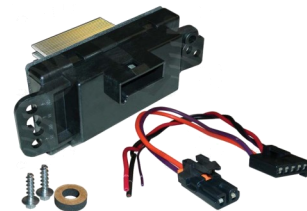

1711975 (Automatic A/C)

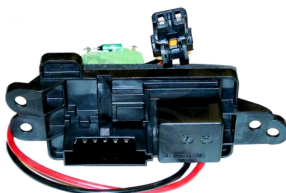

1711976 (Automatic A/C, 4 hole mount)

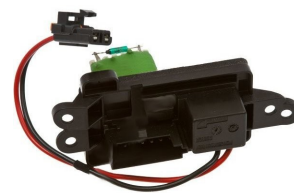

1711735 (without center console)

Manufacturer names, logos and part numbers are for reference only. All prices, taxes and availability are subject to change without notice. This document and any files transmitted with it are confidential and intended solely for the use of the individual or entity to which they are addressed. If you have received this document in error, please delete it immediately. Note that any views or opinions presented in this document are solely those of the author. Any unauthorized review, use, disclosure or distribution is prohibited. GPD accepts no liability for any damage caused by any virus or other means transmitted by this document.