


3" Side Bar

Part No. A0009S/B

Fits: 2005 - Current Toyota Tacoma Access Cab







REMOVE CONTENTS FROM BOX. VERIFY ALL PARTS ARE PRESENT.







Cutting Not Required



Drilling Not Required



READ INSTRUCTIONS CAREFULLY BEFORE STARTING INSTALLATION.



DO NOT OVER TORQUE. STANDARD OPERATING LOAD FOR TIGHTEN BODY MOUNT NUTS & BOLTS VARIES FROM **45** TO **65** FOOT POUND.

PARTS LIST:					
Qty	Part Description	Qty	Part Description		
1 Set	Side Bar	16	M8-1.25mm x 30mm Hex Bolts		
1 Set	Front Bracket	16	M8 Lock Washers		
1 Set	Rear Bracket	16	8mm ID x 24mm OD x 2mm Flat Washers		


DRIVER (LEFT)FRONT	DRIVER (LEFT)REAR	PASSENGER(RIGHT) REAR	PASSENGER (RIGHT)FRONT
	The Chi		

INSTALLATION PROCEDURE

- 1. Starting on the driver side front of the vehicle, use a flat screw driver to remove the plastic plugs, (Figure 1). Partially attach drivers side front Mounting Bracket to vehicle using the included (2) 8mm x 30mm Hex Bolts, (2) 8mm Lock Washers and (2) 8mm Flat Washers, (Figure 2). Repeat this step for installing the driver's side rear Mounting Bracket, (Figure 3)
- 2. Align the threaded inserts on the Side Bar with the slots on the Mounting Brackets. Attach Sidebar to Mounting Brackets with the included (4) 8mm x 30mm Hex Bolts, (4) 8mm Flat Washers and (4) 8mm Lock Washers, (Figure 3). Do not tighten hardware at this time.
- 3. Level and adjust the Sidebar properly and tighten all hardware.
- 4. Repeat Steps 2-4 for installing passenger Sidebar.

Page 1 of 3 Rev 010115

Driver Side Installation Pictured

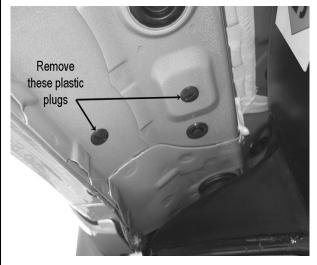


(Fig 1) Driver side front mounting location



M8 x 30mm Hex Bolts
M8 Lock Washers
M8 Flat Washers

(Fig 3) Driver side rear Bracket pictured

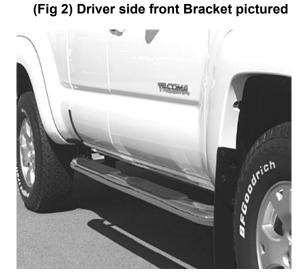

COMPLETE INSTALLATION

Page **2** of **3** Rev 010115


PARTS IDENTIFICATION GUIDE

Driver Side tube taped in "Red" Color. Passenger Side tube taped in "Blue" Color.

No.	Parts Identification		
1	Passenger / Right 'Rear' Bracket marked "RR"		
2	Driver / Left 'Rear' Bracket marked "RL"		
3	Passenger / Right 'Center' Bracket marked "CR"		
4	Driver / Left 'Center' Bracket marked "CL"		
5	Passenger / Right 'Front' Bracket marked "FR"		
6	Driver / Left 'Front' Bracket marked "FL"		
7	'Left' marked "L"		
8	'Right' marked "R"		

Note:

- > This guide is to identify the parts and not a reference for part count.
- > Product / Bracket image is for representative purpose only.
- > Actual design may vary based on application.
- Refer Parts List for Hardware.

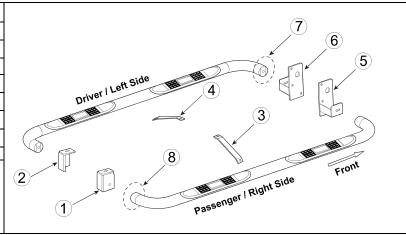

PRODUCT CARE

- Periodically check the product to ensure all fasteners are tight and components are intact.
- Regular waxing is recommended to protect the finish of the product.
- Use ONLY Non-Abrasive automotive wax. Use of any soap, polish or wax that contains an abrasive is detrimental and can scratch the finish leading to corrosion.
- · Aluminum polish may be used to polish small scratches and scuffs for Stainless Steel finish.
- Mild soap may be used to clean the product for both Stainless Steel and Black finish.

FAQ's

1. Hardware's are not of correct size.

In GMC / Chevrolet truck model 2006 & up, customer needs to reuse the factory body bolts to install the bracket. If your vehicle is not GMC / Chevrolet 2006 & up, ensure that holes are not partially covered with any plastic grommet or rust? If it is, remove the plastic grommet & rust from the thread holes & re-try the installation.

2. Mounting Bracket are not getting Installed properly.

In some cases Illustration images shown in Installation manual may not be the exactly same as per actual vehicle images ,also if Driver / Passenger side mounting brackets are very identical in the design, suggest referring Parts Identification guide to avoid fitment issue.

3. Products are thumping / rattling after installation.

Ensure that all required mounting brackets / hardware's are installed & tighten correctly. Suggest using white lithium / regular grease between the metal to metal contact surfaces.

4. Side Bar is not aligning with vehicle / Step Pads are not aligning with vehicle doors.

Side bar may be interchanged or mounting brackets are not installed at the correct position in the vehicle. Refer Parts identification guide.

5. Missing / Excess Hardware.

Recheck hardware count as per the part list.

6. Product not installing properly.

Ensure make model year, cab length and bed size of your vehicle is listed in the application. All installation steps are followed correctly.

Page **3** of **3** Rev 010115