




NISSENS' TECHNICAL TIPS AC Compressors

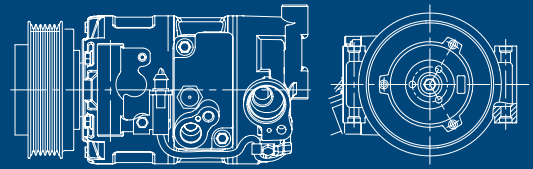

PRODUCT SUBJECT CLUTCH PROBLEMS

MANUFACTURER VOLVO

MODEL SERIES 850

MODEL ALL MODELS

YEAR 1993-1999

Most Volvo 850 models have problems with the clutch after a certain timeframe. The shims that ensure the distance between the hub and the pulley start to create problems. The distance increases over time, and the magnet will at the end not be able to engage the hub properly.

When the clutch is cold, there will be no problems. But once the pulley gets warm (after 2-5 minutes), the hub will disengage due to the increased distance.



Nissens[®]
DELIVERING THE DIFFERENCE

Learn more about replacement air conditioning & heating parts we offer on our website.