


INSTALLATION INSTRUCTIONS

Failure to follow these instructions can severely shorten the life of this part and may void the part's warranty.

Installation Process

NOTICE

- 1) Inspect face of old sensor for score marks or other signs of damage created by excessive camshaft endplay. .005"-.013" allowable endplay. More than .013" may cause sensor damage or intermittent sensor output.
- 2) If within allowable specifications, tap camshaft into head with soft faced mallet prior to installing sensor. Failure to do so may prevent sensor gasket from sealing and cause oil seepage.
- 3) Ensure OE harness terminals are clean and that ground and 8 VDC are present at appropriate terminals.

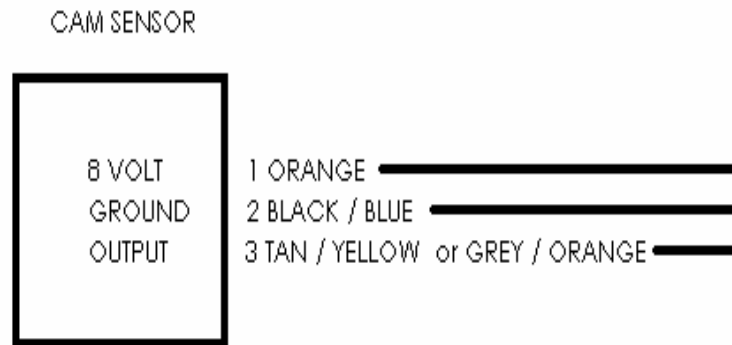

Models Covered:

96079
96108