

# SCHRADER TIRE PRESSURE MONITORING SYSTEMS

▶▶ APRIL 2016 SENSOR & SERVICE PACK APPLICATION CATALOG

**OE  
REPLACEMENT**



**SERVICE  
PACKS**



**EZ-sensor®**



**Sensata**  
Technologies

*The World Depends on Sensors and Controls*



# Table of Contents

<u>TPMS Tools and Accessories</u> .....	1-7
OEM Interchanges.....	8-9
TPMS Sensors/Transmitters & Service Packs - Alphabetical Listing.....	10-131
TPMS Sensors/Transmitters Numerical Listing.....	132-155
TPMS Service Packs - Numerical Listing.....	156-181
NHTSA TREAD Act.....	Inside Back Cover



### ▶ Nut Torque Tool with Sockets – 20138

Torque wrench for valve nuts on TPMS installations. Kit includes 12mm and 11mm sockets for the two nut sizes used today, plus screwdriver handle for easy use. Torque range from 4.25 N.m. to 7.5 N.m. Accuracy plus or minus 4 percent. Includes plastic storage case. (One per carton)



### ▶ Nut Torque Wrench Kit – 20139

Torque tool and precision quality torque wrench for installing TPMS sensor nuts. Includes 12 mm and 11 mm sockets. Torque range from 2 N.m. to 10 N.m. Accuracy plus or minus 2 percent. Includes plastic storage tray. (One per carton)



### ▶ T-10 Torque Tool – 20140

Installs replacement snap-in valves to Schrader® OE sensors. T-10 Torx head installs screws to recommended torque for proper sealing and secure installation. Order individually. (One per box)



### ▶ Valve Core Torque Tool – 20141

Tighten valve cores to OE specifications. Helps guard against over or under-torquing. Meets Tire and Rim Association (TRA) recommended torque values of 3" to 5" lbs. on TRC1 valve cores. Serves as both a core remover and installer. Order individually. (One per box)



▶ **Universal Nut Torque Tool – 20142**

Serves as a torque wrench for valve nuts on TPMS installations. Kit includes 11mm and 12mm sockets and T-handle torque wrench with ergonomic design. Torque range from 30 to 90 in/lbs. (One per plastic storage case)



▶ **Replacement 11mm Socket – 21310**

Order Individually.

▶ **Replacement 12mm Socket – 21315**

Order Individually.

▶ **Grommet Removal Tool – 20144**

This hand tool is designed to safely remove the rubber grommet from the aluminum stem of a TPMS sensor. Receiving hole can be used to install a new grommet. (10 per carton)



▶ **T-20 Torque Tool – 20145**

A pre-set torque tool specially designed for use with TPMS sensors that use a T-20 screw to attach the aluminum valve stem to the sensor body. The T-20 Torx head installs screws to recommended torque for proper sealing and secure installation.



▶ **Schrader TPMS Training DVD (English) – 21355**

Order Individually.

▶ **Schrader TPMS Training DVD (French) – 21356**

Order Individually.

▶ **Schrader TPMS Training DVD (Spanish) – 21357**

Order Individually.



## Chrome Caps and Sleeves

Make your TPMS valve stems look as good as the rest of your ride with dress-up sleeves. Chrome finish dress up kits are available for rubber snap-in sensors. Each kit includes a fully plated sleeve and sealing cap to resist galvanic corrosion of TPMS sensors.

### ▶ Chrome caps and sleeves for rubber snap-in sensor

22005 Order in multiples of 50.  
Bulk Packaged (50 caps and 50 sleeves per carton)



### ▶ Complete snap-in valve service pack with chrome caps and sleeves

22008 Individual bags. (50 bags per carton)  
Each bag contains one sleeve, one cap and one TT valve. Order in multiples of 50.



## Banded TPMS Replacement Parts

All of the components required to repair banded TPMS systems. These parts to be used with sensor part numbers 28385, 28390 and 28395.

### ▶ Replacement Clip

22100 Order individually.  
Bulk Packaged. (25 per box)



### ▶ Replacement Cradle

22101 Order individually. (10 per carton)










### ▶ Universal band

Fits rims 14-26"  
22102 Order individually. (One per bag)



## ▶ Accessory and loose part items

- 20055 nickel-plated valve cores – 100/box 
- 20395 plastic sealing valve caps – 100/box 
- 20595 long black sealing valve caps for Schrader snap-in sensors  
Fits EZ-sensors 33000, 33100 & 33200, replacement sensors 20153,  
20398, 28203, 28206, 28308, 28362, 28434, 28461 & 28505,  
and Service Pack 20008 & 20018 valves – 100/box 
- 20695 long green (Nitrogen) sealing valve caps for snap-in sensors – 100/box 
- 20795 green (Nitrogen) sealing valve caps – 100/box 
- 20895 replacement T-10 screw – 25/bag 
- 20995 long black sealing valve caps for Ford snap-in sensors  
Fits EZ-sensors 33000, 33100 & 33200, replacement sensor 20315  
and Service Pack 20008 & 20018 valves – 100/box 

## ▶ TPMS Retrofit Kits

Schrader® TPMS Retrofit Kits install on vehicles not equipped with original equipment systems. The stand-alone kits include a dash-mounted receiver display, four wheel-mounted transmitters that fit most wheel applications and installation instructions.

### TPMS retrofit kits:

- Continually monitor tire pressure in all four tires
- Monitor tire temperature
- Signal audible warning at under-inflation of 25 percent or more
- Capable of monitoring spare tire (Fifth sensor sold separately as part no. 20154)

TPMS systems monitor proper tire pressure to maintain vehicle performance and support safety.

### Properly inflated tires:

- Improve vehicle handling
- Reduce braking distances
- Lower the risk of hydroplaning
- Decrease tire wear
- Improve fuel efficiency



Schrader offers two kits:

- SCH-WRK-4PC - hard wired display
- SCH-BRK-4PC - battery operated display (two AA batteries included)
- 20154 – 433 MHz sensor (Fits both kits)

GM® is a registered trademark of General Motors Corporation  
Subaru® is a registered trademark of Fuji Heavy Industries Ltd.  
Ford® is a registered trademark of Ford Motor Company

# EZ-SENSOR TOOL COMPATIBILITY

▶▶ CONTACT YOUR TOOL SUPPLIER FOR SOFTWARE UPGRADES

\* Not updateable to program 33500

\*\* Ask your tool supplier for 33500 programming capability



<b>ATEQ</b>	<b>ATEQ</b>	<b>Bartec</b>	<b>Bartec</b>	<b>Bartec</b>	<b>Bartec</b>	<b>Bartec</b>	<b>Bartec</b>	<b>Bartec</b>
**VT-55	VT-56	Tech200	Tech300SD	Tech300Pro	Tech400 Plus *Tech400	Tech400SD	Tech400Pro	Tech500



<b>Bartec</b>	<b>Corghi</b>	<b>MAC</b>	<b>Matco</b>	<b>NAPA</b>	<b>OTC</b>	<b>Schrader</b>	<b>Schrader</b>	<b>Snap-on</b>	<b>Snap-on</b>
TPMS Pad	** TPM-02	* ET3824	*TPR3834	92-1525	*3834	21230	EZ-programmer	*TPMS2	TPMS3

## ▶ 21230 Accessories

The Schrader® 21225 OBD adapter kit enables current owners of the 21220 learn tool to upgrade their tool to a 21230 learn tool and enjoy all of the benefits listed above.



NOTE: Parts can be ordered separately.

- OBD Connector - Part Number 21225-OBDD1
- OBD Cable - Part Number 21225-OBDD2
- OBD Tool Only - Part Number 21230-R

### 21230 Components

- 21230 DBL+ learn and test tool
- Hard plastic case - Part Number 21222
- One USB cable - Part Number 21219
- Magnet (necessary to activate some sensors) - Part Number 20143
- Protective rubber boot - Part Number 21221
- Rechargeable 9-volt battery
- Charger - Part Number 21218
- OBD connector and cable
- User guide



## Learn Tools - Continued

### ▶ 21250 TPMS Toyota® Reset Tool

If a Toyota sensor has been broken or a new one installed (without being programmed to the car) AND THE RESET BUTTON WAS PUSHED, the vehicle can get caught in a "loop" and therefore cannot be repaired. There is only one way to fix this issue. The initialization process must be reset before new sensors can be registered to the vehicle. The Solution: The Toyota Reset Tool from Schrader. Simply plug the 21250 (Toyota Reset Tool) into the OBD and push and hold the button for 30 seconds. The system will reset and you can now repair and relearn the vehicle.



### ▶ EZ-sensor Programming Fixture – 35300

This fixture positions the 21230 scan/programming tool and EZ-sensor programmable sensor in the optimum orientation for programming.



### ▶ EZ-sensor Programming Fixture – 35400

This fixture positions the Bartec Tech400 and Tech400SD scan/programming tools and EZ-sensor programmable sensor in the optimum orientation for programming.



### ▶ Aluminum clamp-in style valve – 34000

Aluminum stem service pack to rebuild the Schrader rubber valve snap-in sensor with an aluminum clamp-in style valve stem to match or upgrade existing look.

Fits Schrader OE replacement sensor part numbers: 20153, 20315, 20398, 28203, 28206, 28308, 28434, 28461, 28362, 28505

Fits Schrader EZ-sensor part numbers: 33000, 33100, 33200, 33500






## ► Service Pack Assortment - 20598

Schrader® offers a Service Pack Assortment that contains the most popular vehicle-specific service packs in a handy plastic box.

20598 assortment with 8 each of twelve service packs.

Contents:	Qty.
20002	8
20003	8
20004	8
20008	8
20013	8
20014	8
20020	8
20021	8
20023	8
20030	8
20032	8
20036	8

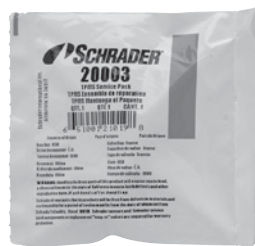

**CAUTION:** Always use new grommets, nuts, valve caps and valve cores when performing any tire service. Use nickel-plated electroless valve cores with aluminum valve stems and use rubber snap-in replacement stems when servicing snap-in sensors. Refer to manufacturer's specifications for proper torque requirements when replacing nuts and valve cores.

# OEM INTERCHANGES

OEM Part Number	Schrader Number	OEM Part Number	Schrader Number	OEM Part Number	Schrader Number
0009054100	..... 28214	22853741	..... 20153	40700-JK00B	..... 28210
0009057200	..... 28214	22854866	..... 28206	42508875	..... 28129
0025406817	..... 20094	22959744	..... 28206	4250A030	..... 28129
0025406917	..... 20095	24437708	..... 28078	4250A225	..... 28096
0025407917	..... 20094	25758220	..... 20076	4250B875	..... 28129
0025408017	..... 20095	25773946	..... 20117	4250B877	..... 20034
0025408617	..... 28214	25774006	..... 20116	4250B8975	..... 28096
0025409017	..... 28214	25799331	..... 20153	4260702010	..... 28365
0035400217	..... 28214	25920615	..... 20153	4260704010	..... 28380
0045421518	..... 28214	28103AG00A	..... 20081	4260706011	..... 28360
06421S3VA02	..... 28981	28103AG01A	..... 28203	4260706020	..... 28360
06421S3VA03	..... 28981	28103AG01B	..... 28203	4260706020	..... 28360
06421S3VA04	..... 28981	28103AG01C	..... 28203	4260708010	..... 28670
06421S9VA01	..... 28982	28103SA001	..... 28203	426070C010	..... 28300
06421S9VA03	..... 28982	28103SA002	..... 28203	426070C020	..... 28305
10394110	..... 20158	28103SG000	..... 28203	426070C030	..... 28670
10438853	..... 28006	28103SG010	..... 28203	426070C050	..... 28670
12768826	..... 28206	307489910	..... 20156	426070E011	..... 28370
13172567	..... 28078	31200923	..... 20156	4260724010	..... 28310
13172567	..... 28078	31200923	..... 28362	4260724020	..... 28315
13227143	..... 20159	312009230	..... 20156	4260724030	..... 28320
13581558	..... 28206	312802970	..... 20097	4260724040	..... 28325
13581559	..... 20228	313020960	..... 20097	4260730030	..... 28335
13581560	..... 20223	36106790054	..... 28081	4260733011	..... 28360
13586335	..... 20153	36106798872	..... 28126	4260733011	..... 28365
13589597	..... 20283	36106856227	..... 28081	4260733021	..... 28370
15114379	..... 20107	36118378682	..... 20080	4260733022	..... 28370
15122618	..... 20131	36146752128	..... 28082	4260735010	..... 28345
15136883	..... 20115	36236781847	..... 20083	4260775010	..... 28345
15254101	..... 20153	36236798726	..... 28081	42607AD020	..... 28355
15268606	..... 20158	40700-1A00D	..... 28342	42753SHJA53	..... 28981
15825475	..... 20158	40700-1AA0B	..... 28204	42753SHJA54	..... 28981
15921013	..... 20158	40700-1AA0D	..... 28204	42753SHJA82	..... 28983
15922396	..... 20153	40700-1PA0A	..... 28342	42753SNAA82	..... 20100
185189	..... 20077	40700-CD001	..... 20064	42753SNAA83	..... 28720
1K0907253D	..... 20088	40700-CK001	..... 20161	42753SNAA84	..... 28720
20922900	..... 28206	40700-CK002	..... 20069	42753STKA01	..... 20098
20923680	..... 20153	40700-JA00C	..... 28204	42753STKA02	..... 20098
20925924	..... 20158	40700-JA01A	..... 28167	42753STKA03	..... 20098
20964159	..... 28423	40700-JA01B	..... 28204	42753STKA04	..... 20098
224549	..... 20077	40700-JA01C	..... 28204	42753SWA306	..... 20099
224551	..... 20084	40700-JA02B	..... 28204	42753SWA316	..... 20099

# OEM INTERCHANGES

OEM Part Number	Schrader Number	OEM Part Number	Schrader Number	OEM Part Number	Schrader Number
42753TK4A01	20720	529332V000	28505	8973271890	20028
42753TL2A51	20098	529333X200	20086	8C2Z1A189A	28395
42753TL2A52	20098	529334D200	20085	8C2Z1A189A	28395
42753TP6A82	20100	52933A5000	20092	95536105300	20077
42753TR0A81	28720	52933A5000	28849	95836166100	20103
42753TR3A81	28720	56029319AA	28461	99760602120	28087
42753TX4A51	28128	56029319AB	28461	9L3Z1A189A	20315
4313054J20	20087	56029359AA	28434	BBM237140B	20093
4313054J21	20087	56029359AB	28434	BBM2-37-140B	20093
4313054J22	20087	56029398AA	20398	C2C25519	20090
4313078J10	20158	56029398AB	20398	C2C40476	20090
4313085Z00	20153	56029400AB	28291	C2C40725	20091
4313086Z20	20082	56029400AC	28291	C2S40710	20091
4321182Z10	28204	56029400AD	28291	C2Z15016	20091
4815132	28004	56029465AB	28308	C2Z15017	20090
4815132AB	28004	56029465AC	28308	CM5T 1A180 AA	20315
4D0907275	20077	56029479AA	28308	CM5T-1A180-AA	20315
4D0907275C	20077	56029479AB	28308	DE8T-1A180-A	20315
4D0907275D	20079	56029481AB	28434	DE8T-1A180-AA	20315
4F0907275B	20078	56053030AB	28308	GN3A37140B	20093
4F0907275D	20103	56053036AA	28308	GS1D37140	20093
4F0907275D	20103	5L1Z 1A150 AA	20135	LR010532	20091
4F0907275H	20077	68001696AA	28308	LR010533	20090
4L2Z 1A150 BA	20096	68001696AA	28434	LR018860	20090
5096808AA	20028	68001696AB	28308	LR018861	20091
5127335AB	20335	68001698AA	28434	LR021936	20090
5142340AA	28308	68001698AB	28434	LR0500461	20090
52088990AC	20028	68006771AA	20089	MN103033	20028
52088990AD	20028	68038945AA	20089	MN103081	20034
529331FA00	28983	68078861AA	28308	RQH500471	20091
529331FA00	28983	68193586AA	28586	XR855949	20091
529332F000	28849	68193586AB	28586	XR855950	20090
529332F000	28849	6F2Z1A189A	28385	YBD000060	28082
529332F001	28849	6F2Z1A189A	28385	YBD000061	28082
529332G200	20086	7L1Z1A189A	28390	ZZC137140	28385
529332G201	20086	7P0907275	20103	ZZDA37140	20315
529332M00	20092	7P0907275	20103	ZZDA-37-140	28385
529332M000	20092	7P0907275A	20077		
529332M000	20092	7PP907275F	20103		
529332M001	20092	8257740060	20116		
529332M001	20092	86517000	20156		
529332M550	20092	88974915	28360		

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Acura</b>				<b>Acura (cont'd)</b>			
<b>CSX</b>				<b>ZDX</b>			
<b>2008-2011</b>				<b>2010-2013</b>			
OE Sensor: Honda - 42753SNAA83				OE Sensor: Honda - 42753TK4A01			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Sensor.....	20720	35	4
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack.....	20019	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>Alfa Romeo</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>8C</b>			
Sensor.....	28720	35	4	<b>2007-2009</b>			
Service Pack.....	20019	35	4	EZ-Sensor.....			
<b>2012</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3				
<b>MDX, RDX</b>				<b>Audi</b>			
<b>2004-2006</b>				<b>A3, A4, A5 &amp; Quattro</b>			
OE Sensor: Honda - 06421S3VA02				<b>2002-2007</b>			
Sensor.....	28981	35	4	OE Sensor: Volkswagen - 4F0907275B			
Service Pack; Includes Valve.....	20036	35	4	Sensor; Includes Transmitter Only.....			
<b>2007-2013</b>				Service Pack; Does Not Include Valve.....			
OE Sensor: Honda - 42753STKA01, 42753STKA02, 42753STKA04				Service Pack; W/43mm Silver Insert.....			
Sensor.....	20098	35	4	Service Pack; W/48mm Green Insert.....			
<b>2013-2015</b>				Service Pack; W/49mm Black Insert.....			
OE Sensor: Honda - 42753TX4A51				Service Pack; W/51mm Orange Insert.....			
Sensor.....	28128	71	8	<b>2008</b>			
<b>RL</b>				OE Sensor: Volkswagen - 1K0907253D, 4F0907275B			
<b>2005-2012</b>				Sensor.....			
OE Sensor: Honda - 06421S3VA02, 06421S3VA03, 06421S3VA04, 42753SHJA53				Sensor; Includes Transmitter Only.....			
Sensor.....	28981	35	4	Service Pack.....			
Service Pack; Includes Valve.....	20036	35	4	Service Pack; Does Not Include Valve.....			
<b>RLX</b>				Service Pack; W/43mm Silver Insert.....			
<b>2016</b>				Service Pack; W/48mm Green Insert.....			
OE Sensor: Honda - 42753-TX4A51				Service Pack; W/49mm Black Insert.....			
Sensor.....	28128	71	8	Service Pack; W/51mm Orange Insert.....			
<b>TL</b>				<b>2009-2012</b>			
<b>2005-2008</b>				OE Sensor: Volkswagen - 1K0907253D			
OE Sensor: Honda - 06421S3VA02, 06421S3VA04				Sensor.....			
Sensor.....	28981	35	4	Service Pack.....			
Service Pack; Includes Valve.....	20036	35	4	<b>2013-2016</b>			
<b>2009-2013</b>				Sensor.....			
OE Sensor: Honda - 42753TK4A01				INDIRECT <sup>D</sup>			
Sensor.....	20720	35	4	<b>A4 allroad</b>			
Service Pack.....	20019	35	4	<b>2013-2016</b>			
<b>TSX</b>				Sensor.....			
<b>2007-2014</b>				INDIRECT <sup>D</sup>			
OE Sensor: Honda - 42753STKA02, 42753TL2A51, 42753TL2A52							
Sensor.....	20098	35	4				

A-Programming Tool Required    C-20018 and 20008 are interchangeable.    D-Indirect TPMS system. No sensor in wheel    DB-Replaces 33000, 33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Audi (cont'd)</b>				<b>Audi (cont'd)</b>			
<b>A6</b>				<b>A6 Quattro (cont'd)</b>			
<b>2002-2004</b>				<b>2010</b>			
OE Sensor: Volkswagen - 4D0907275D				OE Sensor: Volkswagen - 4F0907275D			
EZ-Sensor	33000 <sup>A</sup>	11.5	1.3	Sensor; Includes Transmitter Only	20103	35	4
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack; Does Not Include Valve	20023	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/43mm Silver Insert	20037	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3	Service Pack; W/48mm Green Insert	20038	35	4
Sensor; Includes Transmitter Only	20079	35	4	Service Pack; W/49mm Black Insert	20039	35	4
Service Pack; Does Not Include Valve	20023	35	4	Service Pack; W/51mm Orange Insert	20040	35	4
Service Pack; W/43mm Silver Insert	20037	35	4				
Service Pack; W/48mm Green Insert	20038	35	4	<b>2011</b>			
Service Pack; W/49mm Black Insert	20039	35	4	OE Sensor: Volkswagen - 4F0907275H			
Service Pack; W/51mm Orange Insert	20040	35	4	Sensor; Includes Transmitter Only	20077	35	4
				Service Pack; Does Not Include Valve	20023	35	4
<b>2006-2008</b>				Service Pack; W/43mm Silver Insert	20037	35	4
OE Sensor: Volkswagen - 4F0907275B				Service Pack; W/48mm Green Insert	20038	35	4
Sensor; Includes Transmitter Only	20078	35	4	Service Pack; W/49mm Black Insert	20039	35	4
Service Pack; Does Not Include Valve	20023	35	4	Service Pack; W/51mm Orange Insert	20040	35	4
Service Pack; W/43mm Silver Insert	20037	35	4				
Service Pack; W/48mm Green Insert	20038	35	4	<b>A7 Quattro</b>			
Service Pack; W/49mm Black Insert	20039	35	4	<b>2013-2014</b>			
Service Pack; W/51mm Orange Insert	20040	35	4	Sensor	INDIRECT <sup>D</sup>		
<b>2009</b>							
OE Sensor: Volkswagen - 4F0907275D				<b>A8</b>			
Sensor; Includes Transmitter Only; Quattro	20103	35	4	<b>2000</b>			
Service Pack; Does Not Include Valve	20023	35	4	OE Sensor: Volkswagen - 4D0907275A			
Service Pack; W/43mm Silver Insert	20037	35	4	EZ-Sensor	33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; W/48mm Green Insert	20038	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; W/49mm Black Insert	20039	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3
Service Pack; W/51mm Orange Insert	20040	35	4	Sensor	20079	35	4 N.m
<b>2010</b>							
OE Sensor: Volkswagen - 4F0907275D				Service Pack; Does Not Include Valve	20023	35	4
Sensor; Includes Transmitter Only	20103	35	4	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack; Does Not Include Valve	20023	35	4	Service Pack; W/48mm Green Insert	20038	35	4
Service Pack; W/43mm Silver Insert	20037	35	4	Service Pack; W/49mm Black Insert	20039	35	4
Service Pack; W/48mm Green Insert	20038	35	4	Service Pack; W/51mm Orange Insert	20040	35	4
Service Pack; W/49mm Black Insert	20039	35	4	<b>2001-2003</b>			
Service Pack; W/51mm Orange Insert	20040	35	4	OE Sensor: Volkswagen - 4D0907275A			
<b>2011</b>				EZ-Sensor	33500 <sup>A, DB</sup>	11.5	1.3
OE Sensor: Volkswagen - 4F0907275H				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor; Includes Transmitter Only	20077	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3
Service Pack; Does Not Include Valve	20023	35	4	Sensor	20079	35	4 N.m
Service Pack; W/43mm Silver Insert	20037	35	4				
Service Pack; W/48mm Green Insert	20038	35	4	Service Pack; Does Not Include Valve	20023	35	4
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; W/48mm Green Insert	20038	35	4
<b>2013-2016</b>				Service Pack; W/49mm Black Insert	20039	35	4
Sensor	INDIRECT <sup>D</sup>			Service Pack; W/51mm Orange Insert	20040	35	4
				<b>2006-2011</b>			
<b>A6 Quattro</b>				OE Sensor: Volkswagen - 44D0907275			
<b>2006-2008</b>				EZ-Sensor	33500 <sup>A, DB</sup>	11.5	1.3
OE Sensor: Volkswagen - 4F0907275B				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor; Includes Transmitter Only	20078	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3
Service Pack; Does Not Include Valve	20023	35	4	Sensor	20077	35	4 N.m
Service Pack; W/43mm Silver Insert	20037	35	4				
Service Pack; W/48mm Green Insert	20038	35	4	Service Pack; Does Not Include Valve	20023	35	4
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; W/48mm Green Insert	20038	35	4
				Service Pack; W/49mm Black Insert	20039	35	4
				Service Pack; W/51mm Orange Insert	20040	35	4
				<b>2013-2016</b>			
				Sensor	INDIRECT <sup>D</sup>		

A-Programming Tool Required    C-20018 and 20008 are interchangeable.    D-Indirect TPMS system. No sensor in wheel    DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Audi (cont'd)</b>				<b>Audi (cont'd)</b>			
<b>A8 Quattro</b>				<b>Allroad Quattro</b>			
<b>2000-2002</b>				<b>2001-2005</b>			
OE Sensor: Volkswagen - 4D0907275D				OE Sensor: Volkswagen - 4D0907275D			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor; Includes Transmitter Only.....	20079	35	4	Sensor; Includes Transmitter Only.....	20079	35	4
Service Pack; Does Not Include Valve.....	20023	35	4	Service Pack; Does Not Include Valve.....	20023	35	4
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/51mm Orange Insert.....	20040	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
<b>2003</b>				<b>Q5</b>			
OE Sensor: Volkswagen - 4D0907275, 4D0907275D				2009-2012			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Volkswagen - 1K0907253D			
	33100 A	11.5	1.3	Sensor.....	20088	71	8
	33200 A	11.5	1.3	Service Pack.....	20017	71	8
	33500 A, DB	11.5	1.3	<b>2013-2016</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	INDIRECT D			
Sensor; Includes Transmitter Only; Chassis No. 4D3004999 & Before.....	20079	35	4	<b>Q7</b>			
Sensor; Includes Transmitter Only; Chassis No. 4E3000001 & After.....	20077	35	4	2007-2009			
Service Pack; Does Not Include Valve.....	20023	35	4	OE Sensor: Volkswagen - 4F0907275B			
Service Pack; W/43mm Silver Insert.....	20037	35	4	Sensor; Includes Transmitter Only.....	20078	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; Does Not Include Valve.....	20023	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; W/51mm Orange Insert.....	20040	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
<b>2004-2011</b>				Service Pack; W/49mm Black Insert.....	20039	35	4
OE Sensor: Volkswagen - 4D0907275C				Service Pack; W/51mm Orange Insert.....	20040	35	4
EZ-Sensor.....	33100 A	11.5	1.3	<b>2010</b>			
	33200 A	11.5	1.3	OE Sensor: Volkswagen - 4F0907275D			
	33500 A, DB	11.5	1.3	Sensor; Includes Transmitter Only.....	20103	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Does Not Include Valve.....	20023	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4
Sensor; Includes Transmitter Only.....	20077	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; Does Not Include Valve.....	20023	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	<b>2011</b>			
Service Pack; W/49mm Black Insert.....	20039	35	4	OE Sensor: Volkswagen - 4F0907275H			
Service Pack; W/51mm Orange Insert.....	20040	35	4	Sensor; Includes Transmitter Only.....	20077	35	4
<b>Allroad</b>				Service Pack; Does Not Include Valve.....	20023	35	4
<b>2001-2005</b>				Service Pack; W/43mm Silver Insert.....	20037	35	4
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/49mm Black Insert.....	20039	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; W/51mm Orange Insert.....	20040	35	4
				<b>2012</b>			
				OE Sensor: Volkswagen - 4F0907275D			
				Sensor; Includes Transmitter Only.....	20103	35	4
				Service Pack; Does Not Include Valve.....	20023	35	4
				Service Pack; W/43mm Silver Insert.....	20037	35	4
				Service Pack; W/48mm Green Insert.....	20038	35	4
				Service Pack; W/49mm Black Insert.....	20039	35	4
				Service Pack; W/51mm Orange Insert.....	20040	35	4
				<b>2013-2016</b>			
				Sensor.....			
				INDIRECT D			

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Audi (cont'd)</b>				<b>Audi (cont'd)</b>			
<b>R8</b>				<b>RS6</b>			
<b>2008-2009</b>				<b>2003</b>			
OE Sensor: Volkswagen - 4F0907275B				OE Sensor: Volkswagen - 4F0907275H			
Sensor; Includes Transmitter Only. . . . .	20078	35	4	EZ-Sensor. . . . .	33100 A	11.5	1.3
Service Pack; Does Not Include Valve. . . . .	20023	35	4		33200 A	11.5	1.3
Service Pack; W/43mm Silver Insert. . . . .	20037	35	4		33500 A, DB	11.5	1.3
Service Pack; W/48mm Green Insert. . . . .	20038	35	4	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
Service Pack; W/49mm Black Insert. . . . .	20039	35	4	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
Service Pack; W/51mm Orange Insert. . . . .	20040	35	4	Sensor; Includes Transmitter Only. . . . .	20077	35	4
<b>2010</b>				Service Pack; Does Not Include Valve. . . . .	20023	35	4
OE Sensor: Volkswagen - 4F0907275D				Service Pack; W/43mm Silver Insert. . . . .	20037	35	4
Sensor; Includes Transmitter Only. . . . .	20103	35	4	Service Pack; W/48mm Green Insert. . . . .	20038	35	4
Service Pack; Does Not Include Valve. . . . .	20023	35	4	Service Pack; W/49mm Black Insert. . . . .	20039	35	4
Service Pack; W/43mm Silver Insert. . . . .	20037	35	4	Service Pack; W/51mm Orange Insert. . . . .	20040	35	4
Service Pack; W/48mm Green Insert. . . . .	20038	35	4	<b>RS7</b>			
Service Pack; W/49mm Black Insert. . . . .	20039	35	4	<b>2014-2016</b>			
Service Pack; W/51mm Orange Insert. . . . .	20040	35	4	OE Sensor: Volkswagen - 7PP-907-275F			
<b>2011</b>				Sensor. . . . .	20103	35	4
OE Sensor: Volkswagen - 4F0907275D				Service Pack; Does Not Include Valve. . . . .	20023	35	4
Sensor. . . . .	20103	35	4	Service Pack; W/43mm Silver Insert. . . . .	20037	35	4
Service Pack; Does Not Include Valve. . . . .	20023	35	4	Service Pack; W/48mm Green Insert. . . . .	20038	35	4
Service Pack; W/43mm Silver Insert. . . . .	20037	35	4	Service Pack; W/49mm Black Insert. . . . .	20039	35	4
Service Pack; W/48mm Green Insert. . . . .	20038	35	4	Service Pack; W/51mm Orange Insert. . . . .	20040	35	4
Service Pack; W/49mm Black Insert. . . . .	20039	35	4	<b>S4</b>			
Service Pack; W/51mm Orange Insert. . . . .	20040	35	4	<b>2002</b>			
<b>2012</b>				OE Sensor: Volkswagen - 4D0907275D			
OE Sensor: Volkswagen - 4F0907275D				EZ-Sensor. . . . .	33000 A	11.5	1.3
Sensor; Includes Transmitter Only. . . . .	20103	35	4		33500 A, DB	11.5	1.3
Service Pack; Does Not Include Valve. . . . .	20023	35	4	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
Service Pack; W/43mm Silver Insert. . . . .	20037	35	4	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
Service Pack; W/48mm Green Insert. . . . .	20038	35	4	Sensor; Includes Transmitter Only. . . . .	20079	35	4
Service Pack; W/49mm Black Insert. . . . .	20039	35	4	Service Pack; Does Not Include Valve. . . . .	20023	35	4
Service Pack; W/51mm Orange Insert. . . . .	20040	35	4	Service Pack; W/43mm Silver Insert. . . . .	20037	35	4
<b>2014-2015</b>				Service Pack; W/48mm Green Insert. . . . .	20038	35	4
OE Sensor: Volkswagen - 4F0907275D				Service Pack; W/49mm Black Insert. . . . .	20039	35	4
Sensor; Includes Transmitter Only. . . . .	20103	35	4	Service Pack; W/51mm Orange Insert. . . . .	20040	35	4
Service Pack; Does Not Include Valve. . . . .	20023	35	4	<b>2003</b>			
Service Pack; W/43mm Silver Insert. . . . .	20037	35	4	EZ-Sensor. . . . .	33000 A	11.5	1.3
Service Pack; W/48mm Green Insert. . . . .	20038	35	4		33500 A, DB	11.5	1.3
Service Pack; W/49mm Black Insert. . . . .	20039	35	4	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
Service Pack; W/51mm Orange Insert. . . . .	20040	35	4	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
<b>RS4</b>				Sensor; Includes Transmitter Only. . . . .	20079	35	4
<b>2007-2008</b>				Service Pack; Does Not Include Valve. . . . .	20023	35	4
OE Sensor: Volkswagen - 4F0907275B				<b>2004-2009</b>			
Sensor; Includes Transmitter Only. . . . .	20078	35	4	OE Sensor: Volkswagen - 4F0907275B			
Service Pack; Does Not Include Valve. . . . .	20023	35	4	Sensor; Includes Transmitter Only. . . . .	20078	35	4
Service Pack; W/43mm Silver Insert. . . . .	20037	35	4	Service Pack; Does Not Include Valve. . . . .	20023	35	4
Service Pack; W/48mm Green Insert. . . . .	20038	35	4	Service Pack; W/43mm Silver Insert. . . . .	20037	35	4
Service Pack; W/49mm Black Insert. . . . .	20039	35	4	Service Pack; W/48mm Green Insert. . . . .	20038	35	4
Service Pack; W/51mm Orange Insert. . . . .	20040	35	4	Service Pack; W/49mm Black Insert. . . . .	20039	35	4
<b>RS5</b>				Service Pack; W/51mm Orange Insert. . . . .	20040	35	4
<b>2013-2015</b>				<b>2010-2011</b>			
Sensor. . . . .	INDIRECT <sup>D</sup>			OE Sensor: Volkswagen - 1K0907253D			
				Sensor. . . . .	20088	71	8
				Service Pack. . . . .	20017	71	8

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Audi (cont'd)</b>				<b>Audi (cont'd)</b>			
<b>S4 (cont'd)</b>				<b>S8 (cont'd)</b>			
2013-2014				2001-2002			
Sensor.....	INDIRECT <sup>D</sup>			OE Sensor: Volkswagen - 4D0907275D			
<b>S5</b>				EZ-Sensor.....			
2008-2012					33000 <sup>A</sup>	11.5	1.3
OE Sensor: Volkswagen - 1K0907253D					33500 <sup>A, DB</sup>	11.5	1.3
Sensor.....	20088	71	8	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack.....	20017	71	8	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
2013-2015				Sensor; Includes Transmitter Only.....			
Sensor.....	INDIRECT <sup>D</sup>			Service Pack; Does Not Include Valve.....	20079	35	4
<b>S6</b>				2003			
2007-2009				OE Sensor: Volkswagen - 4D0907275, 4D0907275D			
OE Sensor: Volkswagen - 4F0907275B				EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
Sensor; Includes Transmitter Only.....	20078	35	4		33100 <sup>A</sup>	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	35	4		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; W/43mm Silver Insert.....	20037	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/48mm Green Insert.....	20038	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	35	4	Sensor; Includes Transmitter Only; Chassis No.			
Service Pack; W/51mm Orange Insert.....	20040	35	4	4D3004999 & Before.....	20079	35	4
2010				Sensor; Includes Transmitter Only; Chassis No.			
OE Sensor: Volkswagen - 4F0907275D				4E3000001 & After.....	20077	35	4
Sensor; Includes Transmitter Only.....	20103	35	4	Service Pack; Does Not Include Valve.....	20023	35	4
Service Pack; Does Not Include Valve.....	20023	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
Service Pack; W/51mm Orange Insert.....	20040	35	4	2004-2006			
2011				OE Sensor: Volkswagen - 4D0907275			
OE Sensor: Volkswagen - 4F0907275H				EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
Sensor; Includes Transmitter Only.....	20077	35	4		33100 <sup>A</sup>	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	35	4		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; W/43mm Silver Insert.....	20037	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/48mm Green Insert.....	20038	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	35	4	Sensor; Includes Transmitter Only; Chassis No.			
Service Pack; W/51mm Orange Insert.....	20040	35	4	4E3000001 & After.....	20077	35	4
2013-2015				Service Pack; Does Not Include Valve.....			
Sensor.....	INDIRECT <sup>D</sup>			Service Pack; W/43mm Silver Insert.....	20037	35	4
<b>S7</b>				Service Pack; W/48mm Green Insert.....			
2013-2015				Service Pack; W/49mm Black Insert.....			
Sensor.....	INDIRECT <sup>D</sup>			Service Pack; W/51mm Orange Insert.....	20039	35	4
<b>S8</b>				Service Pack; W/51mm Orange Insert.....			
2000				2007-2008			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	OE Sensor: Volkswagen - 4D0907275C			
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33100 <sup>A</sup>	11.5	1.3
Sensor; Includes Transmitter Only.....	20079	35	4		33500 <sup>A, DB</sup>	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
				Sensor; Includes Transmitter Only.....	20077	35	4
				Service Pack; Does Not Include Valve.....	20023	35	4
				Service Pack; W/43mm Silver Insert.....	20037	35	4
				Service Pack; W/48mm Green Insert.....	20038	35	4
				Service Pack; W/49mm Black Insert.....	20039	35	4
				Service Pack; W/51mm Orange Insert.....	20040	35	4

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Audi (cont'd)</b>				<b>Bentley</b>			
<b>S8 (cont'd)</b>				<b>Arnage</b>			
<b>2009</b>				<b>2008</b>			
OE Sensor: Volkswagen - 4D0907275				OE Sensor: Original Equipment Manufacturer - 4F0 907 275			
EZ-Sensor	33200 A	11.5	1.3	Sensor	20078		
	33500 A, DB	11.5	1.3	<b>Azure</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>2007-2009</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	OE Sensor: Original Equipment Manufacturer - 4F0907275D;			
Sensor; Includes Transmitter Only; Chassis No.				Volkswagen - 4F0907275D			
4E3000001 & After	20077	35	4	Sensor; Includes Transmitter Only	20103	35	4
Service Pack; Does Not Include Valve	20023	35	4	Service Pack; Does Not Include Valve	20023	35	4
Service Pack; W/43mm Silver Insert	20037	35	4	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack; W/48mm Green Insert	20038	35	4	Service Pack; W/48mm Green Insert	20038	35	4
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; W/49mm Black Insert	20039	35	4
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; W/51mm Orange Insert	20040	35	4
<b>2013-2014</b>				<b>Brooklands</b>			
Sensor	INDIRECT D			<b>2008</b>			
<b>2015</b>				OE Sensor: Original Equipment Manufacturer - 4F0 907 275			
OE Sensor: Volkswagen - 4D0907275				Sensor	20078		
EZ-Sensor	33200 A	11.5	1.3	<b>Continental</b>			
	33500 A, DB	11.5	1.3	<b>2003-2005</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: Volkswagen - 4D0907275C			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor; Includes Transmitter Only	20077	35	4
Sensor	INDIRECT D			Service Pack; Does Not Include Valve	20023	35	4
Sensor; Includes Transmitter Only; Chassis No.				Service Pack; W/43mm Silver Insert	20037	35	4
4E3000001 & After	20077	35	4	Service Pack; W/48mm Green Insert	20038	35	4
Service Pack; Does Not Include Valve	20023	35	4	Service Pack; W/49mm Black Insert	20039	35	4
Service Pack; W/43mm Silver Insert	20037	35	4	Service Pack; W/51mm Orange Insert	20040	35	4
Service Pack; W/48mm Green Insert	20038	35	4	<b>2006-2010</b>			
Service Pack; W/49mm Black Insert	20039	35	4	OE Sensor: Volkswagen - 4F0907275B			
Service Pack; W/51mm Orange Insert	20040	35	4	Sensor; Includes Transmitter Only	20078	35	4
<b>SQ5</b>				Service Pack; Does Not Include Valve	20023	35	4
<b>2013-2014</b>				Service Pack; W/43mm Silver Insert	20037	35	4
Sensor	INDIRECT D			Service Pack; W/48mm Green Insert	20038	35	4
<b>2015</b>				Service Pack; W/49mm Black Insert	20039	35	4
EZ-Sensor	33500 A, DB	11.5	1.3	Service Pack; W/51mm Orange Insert	20040	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>2012-2014</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	OE Sensor: Original Equipment Manufacturer - 7PP907275F;			
<b>TT</b>				Volkswagen - 4F0907275D			
<b>2008-2009</b>				Sensor; Includes Transmitter Only	20103	35	4
OE Sensor: Volkswagen - 1K0907253D				Service Pack; Does Not Include Valve	20023	35	4
Sensor	20088	71	8	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack	20017	71	8	Service Pack; W/48mm Green Insert	20038	35	4
<b>2013-2015</b>				Service Pack; W/49mm Black Insert	20039	35	4
Sensor	INDIRECT D			Service Pack; W/51mm Orange Insert	20040	35	4
<b>TT Quattro</b>				<b>2015</b>			
<b>2008-2009</b>				OE Sensor: Original Equipment Manufacturer - 7PP907275F			
OE Sensor: Volkswagen - 1K0907253D				Sensor; Includes Transmitter Only	20103	35	4
Sensor	20088	71	8	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack	20017	71	8	Service Pack; W/48mm Green Insert	20038	35	4
				Service Pack; W/49mm Black Insert	20039	35	4
				Service Pack; W/51mm Orange Insert	20040	35	4
				<b>Mulsanne</b>			
				<b>2009</b>			
				OE Sensor: Original Equipment Manufacturer - 4F0 907 275			
				Sensor	20078		

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Bentley (cont'd)</b>				<b>BMW (cont'd)</b>			
<b>Mulsanne (cont'd)</b>				<b>320i (cont'd)</b>			
<b>2011-2015</b>				<b>2001-2002</b>			
OE Sensor: Original Equipment Manufacturer - 7PP907275F; Volkswagen - 4F0907275D				OE Sensor: BMW - 36118378682			
Sensor; Includes Transmitter Only	20103	35	4	EZ-Sensor	33000 <sup>A</sup>	11.5	1.3
Service Pack; Does Not Include Valve	20023	35	4		33100 <sup>A</sup>	11.5	1.3
Service Pack; W/43mm Silver Insert	20037	35	4		33200 <sup>A</sup>	11.5	1.3
Service Pack; W/48mm Green Insert	20038	35	4		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; W/49mm Black Insert	20039	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; W/51mm Orange Insert	20040	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3
<b>BMW</b>				Sensor; Includes Transmitter Only; W/433 MHz			
<b>1 Series</b>				Sensor			
<b>2008-2011</b>				Sensor			
OE Sensor: BMW - 36236781847				Service Pack; Does Not Include Valve			
Sensor; Includes Transmitter Only	20083	31	3.5	Service Pack; W/43mm Silver Insert	20037	31	3.5
Service Pack; Does Not Include Valve	20023	31	3.5	Service Pack; W/48mm Green Insert	20038	31	3.5
Service Pack; W/43mm Silver Insert	20037	31	3.5	Service Pack; W/49mm Black Insert	20039	31	3.5
Service Pack; W/48mm Green Insert	20038	31	3.5	Service Pack; W/51mm Orange Insert	20040	31	3.5
Service Pack; W/49mm Black Insert	20039	31	3.5	<b>2003-2005</b>			
Service Pack; W/51mm Orange Insert	20040	31	3.5	OE Sensor: BMW - 36118378682			
<b>2012-2013</b>				EZ-Sensor			
OE Sensor: BMW - 36 10 6 790 054							
Sensor; Includes Transmitter Only	28081	40	4.5		33200 <sup>A</sup>	11.5	1.3
Service Pack; Does Not Include Valve	20023	31	3.5		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; W/43mm Silver Insert	20037	31	3.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; W/48mm Green Insert	20038	31	3.5	EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3
Service Pack; W/49mm Black Insert	20039	31	3.5	Sensor; Includes Transmitter Only	20080	31	3.5
Service Pack; W/51mm Orange Insert	20040	31	3.5	Service Pack; Does Not Include Valve	20023	31	3.5
<b>228i</b>				Service Pack; W/43mm Silver Insert			
<b>2014</b>				Service Pack; W/48mm Green Insert			
OE Sensor: BMW - 36 10 6 798 872				Service Pack; W/49mm Black Insert			
EZ-Sensor	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack; W/51mm Orange Insert	20040	31	3.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>2014</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3	OE Sensor: BMW - 36 10 6 798 872			
Sensor	28126	40	4.5	EZ-Sensor	33500 <sup>A, DB</sup>	11.5	1.3
Service Pack	20037	31	3.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	20038	31	3.5	EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3
	20039	31	3.5	Sensor	28126	40	4.5
	20040	31	3.5	Service Pack	20037	31	3.5
<b>2015</b>							
OE Sensor: BMW - 36 10 6 798 872							
Sensor	28126	40	4.5	<b>320i xDrive</b>			
Service Pack	20023	31	3.5	<b>2014</b>			
	20037	31	3.5	OE Sensor: BMW - 36 10 6 798 872			
	20038	31	3.5	EZ-Sensor	33500 <sup>A, DB</sup>	11.5	1.3
	20039	31	3.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	20040	31	3.5	EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3
<b>320i</b>				Sensor			
<b>2000</b>				Service Pack			
EZ-Sensor	33500 <sup>A, DB</sup>	11.5	1.3		20037	31	3.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		20038	31	3.5
EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3		20039	31	3.5
					20040	31	3.5

A-Programming Tool Required    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>BMW (cont'd)</b>				<b>BMW (cont'd)</b>			
<b>323Ci</b>				<b>325</b>			
<b>2000</b>				<b>2001-2002</b>			
OE Sensor: BMW - 36118378682				OE Sensor: BMW - 36118378682			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33200 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; Includes Transmitter Only.....	20080	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	31	3.5	Sensor; Includes Transmitter Only; W/433 MHz			
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Sensor.....	20080	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
				Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
<b>323i</b>				<b>2003-2006</b>			
<b>2000</b>				<b>2003-2006</b>			
OE Sensor: BMW - 36118378682				OE Sensor: BMW - 36118378682			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33100 A	11.5	1.3
	33500 A, DB	11.5	1.3		33200 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; Includes Transmitter Only.....	20080	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	31	3.5	Sensor; Includes Transmitter Only.....	20080	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
<b>2001-2005</b>				<b>2014</b>			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
<b>2006</b>				<b>328Ci</b>			
<b>2006</b>				<b>2000</b>			
OE Sensor: BMW - 36236781847				OE Sensor: BMW - 36118378682			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; Includes Transmitter Only; Jun. & Newer..	20083	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Does Not Include Valve; Jun. & Newer.....	20023	31	3.5	Sensor; Includes Transmitter Only.....	20080	31	3.5
Service Pack; W/43mm Silver Insert; Jun. & Newer.....	20037	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/48mm Green Insert; Jun. & Newer.....	20038	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/49mm Black Insert; Jun. & Newer.....	20039	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/51mm Orange Insert; Jun. & Newer.....	20040	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
<b>2007-2010</b>				<b>328d</b>			
<b>2007-2010</b>				<b>2014</b>			
OE Sensor: BMW - 36236781847				OE Sensor: BMW - 36 10 6 798 872			
Sensor; Includes Transmitter Only.....	20083	31	3.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Sensor.....	28126	40	4.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack.....	20037	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5		20038	31	3.5
					20039	31	3.5
					20040	31	3.5
<b>2014</b>							
EZ-Sensor.....	33500 A, DB	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>BMW (cont'd)</b>				<b>BMW (cont'd)</b>			
<b>328d xDrive</b>				<b>328i (cont'd)</b>			
<b>2014</b>				<b>2015</b>			
OE Sensor: BMW - 36 10 6 798 872				OE Sensor: BMW - 36 10 6 798 872			
EZ-Sensor.....	33500 A, DB	11.5	1.3	Sensor; Includes Transmitter Only.....	28126	40	4.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Does Not Include Valve.....	20023	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Sensor.....	28126	40	4.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack.....	20037	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
	20038	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
	20039	31	3.5				
	20040	31	3.5				
<b>328i</b>				<b>328i GT xDrive</b>			
<b>2000</b>				<b>2014</b>			
OE Sensor: BMW - 36118378682				OE Sensor: BMW - 36 10 6 798 872			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor; Includes Transmitter Only.....	28126	40	4.5
Sensor; Includes Transmitter Only; W/433 MHz				Service Pack.....	20038	31	3.5
Sensor.....	20080	31	3.5		20039	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5		20040	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5				
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	<b>2015</b>			
<b>2007-2009</b>				OE Sensor: BMW - 36 10 6 798 872			
OE Sensor: BMW - 36236781847				Sensor; Includes Transmitter Only.....			
Sensor; Includes Transmitter Only.....	20083	31	3.5		28126	40	4.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
<b>2010-2013</b>				<b>328i xDrive</b>			
OE Sensor: BMW - 36 10 6 790 054				<b>2009</b>			
Sensor; Includes Transmitter Only.....	28081	40	4.5	OE Sensor: BMW - 36236781847			
Service Pack; Does Not Include Valve.....	20023	31	3.5	Sensor; Includes Transmitter Only.....			
Service Pack; W/43mm Silver Insert.....	20037	31	3.5				
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; Does Not Include Valve.....			
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/43mm Silver Insert.....			
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/48mm Green Insert.....			
<b>2014</b>				Service Pack; W/49mm Black Insert.....			
OE Sensor: BMW - 36 10 6 798 872				Service Pack; W/51mm Orange Insert.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3	20083			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	20023			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	20037			
Sensor; Includes Transmitter Only.....	28126	40	4.5	20038			
Service Pack; Does Not Include Valve.....	20023	31	3.5	20039			
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	20040			
Service Pack; W/48mm Green Insert.....	20038	31	3.5				
Service Pack; W/49mm Black Insert.....	20039	31	3.5	<b>2010-2013</b>			
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	OE Sensor: BMW - 36 10 6 790 054			
<b>2014</b>				Sensor; Includes Transmitter Only.....			
OE Sensor: BMW - 36 10 6 798 872				28081			
EZ-Sensor.....	33500 A, DB	11.5	1.3	40			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	4.5			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	31			
Sensor; Includes Transmitter Only.....	28126	40	4.5	3.5			
Service Pack.....	20037	31	3.5	3.5			
Service Pack; Does Not Include Valve.....	20023	31	3.5	3.5			
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	3.5			
Service Pack; W/48mm Green Insert.....	20038	31	3.5	3.5			
Service Pack; W/49mm Black Insert.....	20039	31	3.5	3.5			
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	3.5			
<b>2014</b>				OE Sensor: BMW - 36 10 6 798 872			
OE Sensor: BMW - 36 10 6 798 872				EZ-Sensor.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3	33500 A, DB			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	11.5			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	1.3			
Sensor; Includes Transmitter Only.....	28126	40	4.5	4.5			
Service Pack.....	20037	31	3.5	3.5			
Service Pack; Does Not Include Valve.....	20023	31	3.5	3.5			
Service Pack; W/48mm Green Insert.....	20038	31	3.5	3.5			
Service Pack; W/49mm Black Insert.....	20039	31	3.5	3.5			
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	3.5			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>BMW (cont'd)</b>				<b>BMW (cont'd)</b>			
<b>328i xDrive (cont'd)</b>				<b>335d (cont'd)</b>			
<b>2015</b>				<b>2010-2011</b>			
OE Sensor: BMW - 36 10 6 798 872				OE Sensor: BMW - 36 10 6 790 054			
Sensor; Includes Transmitter Only. ....	28126	40	4.5	Sensor; Includes Transmitter Only. ....	28081	40	4.5
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/49mm Black Insert. ....	20039	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
<b>328xi</b>				<b>335i</b>			
<b>2007-2008</b>				<b>2007-2009</b>			
OE Sensor: BMW - 36236781847				OE Sensor: BMW - 36236781847			
Sensor; Includes Transmitter Only. ....	20083	31	3.5	Sensor; Includes Transmitter Only. ....	20083	31	3.5
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/49mm Black Insert. ....	20039	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
<b>330</b>				<b>2010-2013</b>			
<b>2001-2002</b>				OE Sensor: BMW - 36 10 6 790 054			
OE Sensor: BMW - 36118378682				Sensor; Includes Transmitter Only. ....			
EZ-Sensor. ....	33000 A	11.5	1.3	Sensor; Includes Transmitter Only. ....	28081	40	4.5
	33200 A	11.5	1.3	Service Pack; Does Not Include Valve. ....	20023	31	3.5
	33500 A, DB	11.5	1.3	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
EZ-Sensor Service Pack; Aluminium Valve. ....	34000	62	7	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
EZ-Sensor Service Pack; Rubber Valve. ....	20018 C	11.5	1.3	Service Pack; W/49mm Black Insert. ....	20039	31	3.5
Sensor; Includes Transmitter Only; W/433 MHz				Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
Sensor. ....	20080	31	3.5	<b>2014</b>			
Service Pack; Does Not Include Valve. ....	20023	31	3.5	OE Sensor: BMW - 36 10 6 798 872			
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	EZ-Sensor. ....			
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	EZ-Sensor Service Pack; Aluminium Valve. ....			
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	EZ-Sensor Service Pack; Rubber Valve. ....			
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Sensor; Includes Transmitter Only. ....			
<b>2003-2006</b>				Sensor. ....			
OE Sensor: BMW - 36118378682				Service Pack. ....			
EZ-Sensor. ....	33100 A	11.5	1.3	Service Pack; Does Not Include Valve. ....			
	33200 A	11.5	1.3	Service Pack; W/43mm Silver Insert. ....			
	33500 A, DB	11.5	1.3	Service Pack; W/48mm Green Insert. ....			
EZ-Sensor Service Pack; Aluminium Valve. ....	34000	62	7	Service Pack; W/49mm Black Insert. ....			
EZ-Sensor Service Pack; Rubber Valve. ....	20018 C	11.5	1.3	Service Pack; W/51mm Orange Insert. ....			
Sensor; Includes Transmitter Only. ....	20080	31	3.5	<b>335i GT xDrive</b>			
Service Pack; Does Not Include Valve. ....	20023	31	3.5	<b>2014</b>			
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	OE Sensor: BMW - 36 10 6 798 872			
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	EZ-Sensor. ....			
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	EZ-Sensor Service Pack; Aluminium Valve. ....			
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	EZ-Sensor Service Pack; Rubber Valve. ....			
<b>335d</b>				Sensor; Includes Transmitter Only. ....			
<b>2009</b>				Sensor. ....			
OE Sensor: BMW - 36236781847				Service Pack. ....			
Sensor; Includes Transmitter Only. ....	20083	31	3.5	Service Pack; Does Not Include Valve. ....			
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Service Pack; W/43mm Silver Insert. ....			
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; W/48mm Green Insert. ....			
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/49mm Black Insert. ....			
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/51mm Orange Insert. ....			
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>BMW (cont'd)</b>				<b>BMW (cont'd)</b>			
<b>335i GT xDrive (cont'd)</b>				<b>335xi</b>			
<b>2015</b>				<b>2007-2008</b>			
OE Sensor: BMW - 36 10 6 798 872				OE Sensor: BMW - 36236781847			
Sensor; Includes Transmitter Only. . . . .	28126	40	4.5	Sensor; Includes Transmitter Only. . . . .	20083	31	3.5
Service Pack; Does Not Include Valve. . . . .	20023	31	3.5	Service Pack; Does Not Include Valve. . . . .	20023	31	3.5
Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5	Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5
Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5	Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5
Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5	Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5
Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5	Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5
<b>335i xDrive</b>				<b>428i</b>			
<b>2009</b>				<b>2014</b>			
OE Sensor: BMW - 36236781847				OE Sensor: BMW - 36 10 6 798 872			
Sensor; Includes Transmitter Only. . . . .	20083	31	3.5	Sensor; Includes Transmitter Only. . . . .	28126	40	4.5
Service Pack; Does Not Include Valve. . . . .	20023	31	3.5	Service Pack; Does Not Include Valve. . . . .	20023	31	3.5
Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5	Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5
Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5	Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5
Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5	Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5
Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5	Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5
<b>2010-2013</b>				<b>2015</b>			
OE Sensor: BMW - 36 10 6 790 054				OE Sensor: BMW - 36 10 6 798 872			
Sensor; Includes Transmitter Only. . . . .	28081	40	4.5	EZ-Sensor; Programmable sensor. Programming tool required. . . . .	33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; Does Not Include Valve. . . . .	20023	31	3.5	EZ-Sensor Service Pack; Aluminum valve. . . . .	34000	62	7
Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 <sup>C</sup>	11.5	1.3
Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5	Sensor. . . . .	28126	35	4
Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5	Service Pack; Does Not Include Valve. . . . .	20023	31	3.5
Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5	<b>2016</b>			
<b>2014</b>				OE Sensor: BMW - 36 10 6 798 872			
OE Sensor: BMW - 36 10 6 798 872				EZ-Sensor. . . . .	33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor. . . . .	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminum valve. . . . .	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 <sup>C</sup>	11.5	1.3	Sensor. . . . .	28126	35	4
Sensor; Includes Transmitter Only. . . . .	28126	40	4.5	<b>428i xDrive</b>			
Service Pack; Does Not Include Valve. . . . .	20023	31	3.5	<b>2014</b>			
Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5	OE Sensor: BMW - 36 10 6 798 872			
Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5	Sensor. . . . .			
Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5	Sensor. . . . .			
Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5	Sensor. . . . .			
<b>2015</b>				Service Pack; Does Not Include Valve. . . . .			
OE Sensor: BMW - 36 10 6 798 872				Service Pack; W/43mm Silver Insert. . . . .			
Sensor; Includes Transmitter Only. . . . .	28126	40	4.5	Service Pack; W/48mm Green Insert. . . . .			
Service Pack; Does Not Include Valve. . . . .	20023	31	3.5	Service Pack; W/49mm Black Insert. . . . .			
Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5	Service Pack; W/51mm Orange Insert. . . . .			
Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5	<b>2015</b>			
Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5	OE Sensor: BMW - 36 10 6 798 872			
Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5	EZ-Sensor; Programmable sensor. Programming tool required. . . . .			
<b>335is</b>				EZ-Sensor Service Pack; Aluminum valve. . . . .			
<b>2012-2013</b>				EZ-Sensor Service Pack; Rubber Valve. . . . .			
OE Sensor: BMW - 36 10 6 790 054				Sensor. . . . .			
Sensor; Includes Transmitter Only. . . . .	28081	40	4.5	Service Pack; Does Not Include Valve. . . . .			
Service Pack; Does Not Include Valve. . . . .	20023	31	3.5	Service Pack; W/43mm Silver Insert. . . . .			
Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5	Service Pack; W/48mm Green Insert. . . . .			
Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5	Service Pack; W/49mm Black Insert. . . . .			
Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5	Service Pack; W/51mm Orange Insert. . . . .			
Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>BMW (cont'd)</b>				<b>BMW (cont'd)</b>			
<b>428i xDrive (cont'd)</b>				<b>435i xDrive (cont'd)</b>			
<b>2016</b>				<b>2015</b>			
EZ-Sensor; Programmable sensor. Programming tool required.....	33500 A, DB	11.5	1.3	OE Sensor: BMW - 36 10 6 798 872			
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor; Programmable sensor. Programming tool required.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
<b>435i</b>				EZ-Sensor Service Pack; Rubber Valve.....			
<b>2014</b>				Sensor.....			
OE Sensor: BMW - 36 10 6 798 872				Service Pack; Does Not Include Valve.....	20023	31	3.5
Sensor.....	28126	40	4.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	<b>2016</b>			
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	OE Sensor: BMW - 36 10 6 798 872			
<b>2015</b>				EZ-Sensor; Programmable sensor. Programming tool required.....			
OE Sensor: BMW - 36 10 6 798 872				33500 A, DB	11.5	1.3	
EZ-Sensor; Programmable sensor. Programming tool required.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	28126	35	4
Sensor.....	28126	35	4	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	<b>2002</b>			
<b>2016</b>				OE Sensor: BMW - 36118378682			
OE Sensor: BMW - 36 10 6 798 872				EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor; Programmable sensor. Programming tool required.....	33500 A, DB	11.5	1.3		33100 A	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7		33200 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.....	28126	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Does Not Include Valve.....	20023	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Sensor; Includes Transmitter Only; W/433 MHz			
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Sensor.....	20080	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
<b>435i xDrive</b>				Service Pack; W/48mm Green Insert.....			
<b>2014</b>				Service Pack; W/49mm Black Insert.....			
OE Sensor: BMW - 36 10 6 856 227				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Sensor.....	28126	40	4.5	<b>2003-2005</b>			
Service Pack; Does Not Include Valve.....	20023	31	3.5	OE Sensor: BMW - 36118378682			
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	EZ-Sensor.....			
Service Pack; W/48mm Green Insert.....	20038	31	3.5		33100 A	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	31	3.5		33200 A	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	31	3.5		33500 A, DB	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....			
				EZ-Sensor Service Pack; Rubber Valve.....			
				Sensor; Includes Transmitter Only.....			
				Service Pack; Does Not Include Valve.....			
				Service Pack; W/43mm Silver Insert.....			
				Service Pack; W/48mm Green Insert.....			
				Service Pack; W/49mm Black Insert.....			
				Service Pack; W/51mm Orange Insert.....			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>BMW (cont'd)</b>				<b>BMW (cont'd)</b>			
<b>525i (cont'd)</b>				<b>528 (cont'd)</b>			
<b>2006-2007</b>				<b>2015-2016</b>			
OE Sensor: BMW - 36236781847				OE Sensor: BMW - 36 10 6 856 872			
Sensor; Includes Transmitter Only. ....	20083	31	3.5	Sensor. ....	28126	40	4.5
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/49mm Black Insert. ....	20039	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
<b>525xi</b>				<b>528xi</b>			
<b>2006-2007</b>				<b>2008</b>			
OE Sensor: BMW - 36236781847				OE Sensor: BMW - 36236781847			
Sensor; Includes Transmitter Only. ....	20083	31	3.5	Sensor; Includes Transmitter Only. ....	20083	31	3.5
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/49mm Black Insert. ....	20039	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
<b>528</b>				<b>530</b>			
<b>1997-1999</b>				<b>2001</b>			
Service Pack; Does Not Include Valve. ....				Service Pack; Does Not Include Valve. ....			
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/49mm Black Insert. ....	20039	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
<b>2000</b>				<b>2002</b>			
EZ-Sensor. ....				OE Sensor: BMW - 36118378682			
	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor. ....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33100 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve. ....	34000	62	7		33200 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. ....	20018 <sup>C</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; Does Not Include Valve. ....	20023	31	3.5	EZ-Sensor Service Pack; Aluminium Valve. ....	34000	62	7
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	EZ-Sensor Service Pack; Rubber Valve. ....	20018 <sup>C</sup>	11.5	1.3
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Sensor; Includes Transmitter Only; W/433 MHz			
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Sensor. ....	20080	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
<b>2008-2011</b>				<b>2003-2005</b>			
OE Sensor: BMW - 36236781847				OE Sensor: BMW - 36118378682			
Sensor; Includes Transmitter Only. ....	20083	31	3.5	EZ-Sensor. ....	33200 <sup>A</sup>	11.5	1.3
Service Pack; Does Not Include Valve. ....	20023	31	3.5		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	EZ-Sensor Service Pack; Aluminium Valve. ....	34000	62	7
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	EZ-Sensor Service Pack; Rubber Valve. ....	20018 <sup>C</sup>	11.5	1.3
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Sensor; Includes Transmitter Only. ....	20080	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
<b>2012-2014</b>				<b>2003-2005</b>			
OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227				OE Sensor: BMW - 36118378682			
Sensor; Includes Transmitter Only. ....	28081	40	4.5	EZ-Sensor. ....	33200 <sup>A</sup>	11.5	1.3
Service Pack; Does Not Include Valve. ....	20023	31	3.5		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	EZ-Sensor Service Pack; Aluminium Valve. ....	34000	62	7
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	EZ-Sensor Service Pack; Rubber Valve. ....	20018 <sup>C</sup>	11.5	1.3
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Sensor; Includes Transmitter Only. ....	20080	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
				Service Pack; W/43mm Silver Insert. ....			
				Service Pack; W/48mm Green Insert. ....			
				Service Pack; W/49mm Black Insert. ....			
				Service Pack; W/51mm Orange Insert. ....			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>BMW (cont'd)</b>				<b>BMW (cont'd)</b>			
<b>530 (cont'd)</b>				<b>535d xDrive</b>			
<b>2006-2007</b>				<b>2014</b>			
OE Sensor: BMW - 36236781847				OE Sensor: BMW - 36 10 6 856 227			
Sensor; Includes Transmitter Only. ....	20083	31	3.5	Sensor; Includes Transmitter Only. ....	28081	40	4.5
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/49mm Black Insert. ....	20039	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
<b>535</b>				<b>2015-2016</b>			
<b>2008-2011</b>				OE Sensor: BMW - 36 10 6 856 872			
OE Sensor: BMW - 36236781847				Sensor. ....			
Sensor; Includes Transmitter Only. ....	20083	31	3.5	Sensor. ....	28126	40	4.5
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/49mm Black Insert. ....	20039	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
<b>2012-2014</b>				<b>535xi</b>			
OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227				<b>2008</b>			
Sensor; Includes Transmitter Only. ....				OE Sensor: BMW - 36236781847			
Sensor; Includes Transmitter Only. ....	28081	40	4.5	Sensor; Includes Transmitter Only. ....	20083	31	3.5
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/49mm Black Insert. ....	20039	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
<b>2015-2016</b>				<b>540i</b>			
OE Sensor: BMW - 36 10 6 856 872				<b>1997-1999</b>			
Sensor. ....				Service Pack; Does Not Include Valve. ....			
Sensor. ....	28126	40	4.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/49mm Black Insert. ....	20039	31	3.5
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	<b>2000</b>			
<b>535d</b>				EZ-Sensor. ....			
<b>2014</b>				EZ-Sensor. ....			
OE Sensor: BMW - 36 10 6 856 227				33000 A			
Sensor; Includes Transmitter Only. ....	28081	40	4.5	33500 A, DB	11.5	1.3	
Service Pack; Does Not Include Valve. ....	20023	31	3.5	EZ-Sensor Service Pack; Aluminium Valve. ....	34000	62	7
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	EZ-Sensor Service Pack; Rubber Valve. ....	20018 C	11.5	1.3
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
<b>2015-2016</b>				Service Pack; W/49mm Black Insert. ....			
OE Sensor: BMW - 36 10 6 856 872				20039			
Sensor. ....				20039			
Sensor. ....	28126	40	4.5	Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
Service Pack; Does Not Include Valve. ....	20023	31	3.5	<b>2001</b>			
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; Does Not Include Valve. ....			
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	20023			
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/43mm Silver Insert. ....			
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	20037			
				Service Pack; W/48mm Green Insert. ....			
				20038			
				Service Pack; W/49mm Black Insert. ....			
				20039			
				Service Pack; W/51mm Orange Insert. ....			
				20040			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>BMW (cont'd)</b>				<b>BMW (cont'd)</b>			
<b>540i (cont'd)</b>				<b>550 (cont'd)</b>			
<b>2002</b>				<b>2015-2016</b>			
OE Sensor: BMW - 36118378682				OE Sensor: BMW - 36 10 6 856 872			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Sensor.....	28126	40	4.5
	33200 <sup>A</sup>	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/48mm Green Insert.....	20038	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Sensor; Includes Transmitter Only; W/433 MHz				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Sensor.....	20080	31	3.5				
Service Pack; Does Not Include Valve.....	20023	31	3.5				
Service Pack; W/43mm Silver Insert.....	20037	31	3.5				
Service Pack; W/48mm Green Insert.....	20038	31	3.5				
Service Pack; W/49mm Black Insert.....	20039	31	3.5				
Service Pack; W/51mm Orange Insert.....	20040	31	3.5				
<b>2003</b>				<b>640</b>			
OE Sensor: BMW - 36118378682				<b>2012-2015</b>			
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
	33500 <sup>A, DB</sup>	11.5	1.3	Sensor; Includes Transmitter Only.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Does Not Include Valve.....	20023	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Sensor; Includes Transmitter Only.....	20080	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5				
Service Pack; W/49mm Black Insert.....	20039	31	3.5				
Service Pack; W/51mm Orange Insert.....	20040	31	3.5				
<b>545i</b>				<b>2016</b>			
<b>2004-2005</b>				OE Sensor: BMW - 36 10 6 798 872			
OE Sensor: BMW - 36118378682				Sensor.....			
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	Service Pack.....	20023		
	33500 <sup>A, DB</sup>	11.5	1.3		20023	31	3.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		20037	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3		20037	31	3.5
Sensor; Includes Transmitter Only.....	20080	31	3.5		20037		
Service Pack; Does Not Include Valve.....	20023	31	3.5		20038	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5		20039		
Service Pack; W/48mm Green Insert.....	20038	31	3.5		20039	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5		20040	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5		20040		
<b>550</b>				<b>645Ci</b>			
<b>2006-2011</b>				<b>2004-2005</b>			
OE Sensor: BMW - 36236781847				OE Sensor: BMW - 36118378682			
Sensor; Includes Transmitter Only.....	20083	31	3.5	Sensor; Includes Transmitter Only.....			
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
<b>2012-2014</b>				<b>650</b>			
OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227				<b>2006-2010</b>			
Sensor; Includes Transmitter Only.....				OE Sensor: BMW - 36236781847			
Service Pack; Does Not Include Valve.....	20023	31	3.5	Sensor; Includes Transmitter Only.....			
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>BMW (cont'd)</b>				<b>BMW (cont'd)</b>			
<b>650 (cont'd)</b>				<b>740i (cont'd)</b>			
<b>2012-2015</b>				<b>2012-2015</b>			
OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227				OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
Sensor; Includes Transmitter Only. ....	28081	40	4.5	Sensor; Includes Transmitter Only. ....	28081	40	4.5
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/49mm Black Insert. ....	20039	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
<b>2016</b>				<b>740iL</b>			
OE Sensor: BMW - 36 10 6 798 872				<b>1997-1999</b>			
Sensor. ....	28126	40	4.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack. ....	20023			Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
	20037			Service Pack; W/48mm Green Insert. ....	20038	31	3.5
	20038			Service Pack; W/49mm Black Insert. ....	20039	31	3.5
	20039			Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
	20040			<b>2000</b>			
<b>650i Gran Coupe xDrive</b>				EZ-Sensor. ....			
<b>2016</b>				33000 A 11.5 1.3			
OE Sensor: BMW - 36 10 6 798 872				33500 A, DB 11.5 1.3			
Sensor. ....	28126	40	4.5	EZ-Sensor Service Pack; Aluminium Valve. ....	34000	62	7
Service Pack. ....	20023			EZ-Sensor Service Pack; Rubber Valve. ....	20018 C	11.5	1.3
	20037			Service Pack; Does Not Include Valve. ....	20023	31	3.5
	20038			Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
	20039			Service Pack; W/48mm Green Insert. ....	20038	31	3.5
	20040			Service Pack; W/49mm Black Insert. ....	20039	31	3.5
				Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
<b>740i</b>				<b>2001</b>			
<b>1997-1999</b>				EZ-Sensor. ....			
Service Pack; Does Not Include Valve. ....	20023	31	3.5	33500 A, DB 11.5 1.3			
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	EZ-Sensor Service Pack; Aluminium Valve. ....	34000	62	7
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	EZ-Sensor Service Pack; Rubber Valve. ....	20018 C	11.5	1.3
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
<b>2000-2001</b>				Service Pack; W/48mm Green Insert. ....			
EZ-Sensor. ....	33000 A	11.5	1.3	20038 31 3.5			
	33500 A, DB	11.5	1.3	Service Pack; W/49mm Black Insert. ....			
EZ-Sensor Service Pack; Aluminium Valve. ....	34000	62	7	20039 31 3.5			
EZ-Sensor Service Pack; Rubber Valve. ....	20018 C	11.5	1.3	Service Pack; W/51mm Orange Insert. ....			
Service Pack; Does Not Include Valve. ....	20023	31	3.5	20040 31 3.5			
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	<b>2002-2003</b>			
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	EZ-Sensor. ....			
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	33500 A, DB 11.5 1.3			
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	EZ-Sensor Service Pack; Aluminium Valve. ....			
<b>2002-2003</b>				34000 62 7			
EZ-Sensor. ....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve. ....			
EZ-Sensor Service Pack; Aluminium Valve. ....	34000	62	7	20018 C 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve. ....	20018 C	11.5	1.3	Service Pack; Does Not Include Valve. ....			
<b>2011</b>				20023 31 3.5			
OE Sensor: BMW - 36236781847				Service Pack; W/43mm Silver Insert. ....			
Sensor; Includes Transmitter Only. ....	20083	31	3.5	20037 31 3.5			
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Service Pack; W/48mm Green Insert. ....			
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	20038 31 3.5			
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/49mm Black Insert. ....			
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	20039 31 3.5			
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/51mm Orange Insert. ....			
	20040	31	3.5	20040 31 3.5			
<b>740Li</b>				<b>2012-2015</b>			
<b>2011</b>				OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
OE Sensor: BMW - 36236781847				Sensor; Includes Transmitter Only. ....			
Sensor; Includes Transmitter Only. ....	20083	31	3.5	28081 40 4.5			
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Service Pack; Does Not Include Valve. ....			
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	20023 31 3.5			
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/43mm Silver Insert. ....			
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	20037 31 3.5			
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/48mm Green Insert. ....			
	20040	31	3.5	20038 31 3.5			
				Service Pack; W/49mm Black Insert. ....			
				20039 31 3.5			
				Service Pack; W/51mm Orange Insert. ....			
				20040 31 3.5			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>BMW (cont'd)</b>				<b>BMW (cont'd)</b>			
<b>740Li xDrive</b>				<b>750 (cont'd)</b>			
<b>2013-2015</b>				<b>2012-2015</b>			
OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227				OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
Sensor; Includes Transmitter Only. . . . .	28081	40	4.5	Sensor; Includes Transmitter Only. . . . .	28081	40	4.5
Service Pack; Does Not Include Valve. . . . .	20023	31	3.5	Service Pack; Does Not Include Valve. . . . .	20023	31	3.5
Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5	Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5
Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5	Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5
Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5	Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5
Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5	Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5
<b>745</b>				<b>750iL</b>			
<b>2002</b>				<b>1997-1999</b>			
OE Sensor: BMW - 36118378682				Service Pack; Does Not Include Valve. . . . .			
EZ-Sensor. . . . .	33100 A	11.5	1.3	Service Pack; W/43mm Silver Insert. . . . .	20023	31	3.5
	33200 A	11.5	1.3	Service Pack; W/48mm Green Insert. . . . .	20037	31	3.5
	33500 A, DB	11.5	1.3	Service Pack; W/49mm Black Insert. . . . .	20038	31	3.5
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	Service Pack; W/51mm Orange Insert. . . . .	20039	31	3.5
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5
Sensor; Includes Transmitter Only; W/433 MHz				<b>2000</b>			
Sensor. . . . .	20080	31	3.5	EZ-Sensor. . . . .	33000 A	11.5	1.3
Service Pack; Does Not Include Valve. . . . .	20023	31	3.5		33500 A, DB	11.5	1.3
Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5	Service Pack; Does Not Include Valve. . . . .	20023	31	3.5
Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5	Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5
				Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5
<b>2003</b>				Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5
OE Sensor: BMW - 36118378682				Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5
EZ-Sensor. . . . .	33100 A	11.5	1.3	<b>2001</b>			
	33200 A	11.5	1.3	EZ-Sensor. . . . .	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	Service Pack; Does Not Include Valve. . . . .	20023	31	3.5
Sensor; Includes Transmitter Only. . . . .	20080	31	3.5	Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5
Service Pack; Does Not Include Valve. . . . .	20023	31	3.5	Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5
Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5	Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5
Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5	Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5
Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5	<b>2002-2003</b>			
Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5	EZ-Sensor. . . . .	33500 A, DB	11.5	1.3
<b>2004-2005</b>				EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
OE Sensor: BMW - 36118378682				EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
Sensor; Includes Transmitter Only. . . . .	20080	31	3.5	<b>760i</b>			
Service Pack; Does Not Include Valve. . . . .	20023	31	3.5	<b>2004-2005</b>			
Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5	OE Sensor: BMW - 36118378682			
Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5	Sensor; Includes Transmitter Only. . . . .	20080	31	3.5
Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5	Service Pack; Does Not Include Valve. . . . .	20023	31	3.5
Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5	Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5
				Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5
				Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5
				Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5
<b>750</b>				<b>2006</b>			
<b>2006-2011</b>				OE Sensor: BMW - 36236781847			
OE Sensor: BMW - 36236781847				Sensor; Includes Transmitter Only. . . . .	20083	31	3.5
Sensor; Includes Transmitter Only. . . . .	20083	31	3.5	Service Pack; Does Not Include Valve. . . . .	20023	31	3.5
Service Pack; Does Not Include Valve. . . . .	20023	31	3.5	Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5
Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5	Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5
Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5	Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5
Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5	Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5
Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>BMW (cont'd)</b>				<b>BMW (cont'd)</b>			
<b>760Li</b>				<b>ActiveHybrid 5 (cont'd)</b>			
<b>2003</b>				<b>2015</b>			
OE Sensor: BMW - 36118378682				OE Sensor: BMW - 36 10 6 856 227			
EZ-Sensor	33200 <sup>A</sup>	11.5	1.3	Sensor	28126	40	4.5
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack; Does Not Include Valve	20023	31	3.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/43mm Silver Insert	20037	31	3.5
EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3	Service Pack; W/48mm Green Insert	20038	31	3.5
Sensor; Includes Transmitter Only	20080	31	3.5	Service Pack; W/49mm Black Insert	20039	31	3.5
Service Pack; Does Not Include Valve	20023	31	3.5	Service Pack; W/51mm Orange Insert	20040	31	3.5
Service Pack; W/43mm Silver Insert	20037	31	3.5				
Service Pack; W/48mm Green Insert	20038	31	3.5	<b>ActiveHybrid 7</b>			
Service Pack; W/49mm Black Insert	20039	31	3.5	<b>2013-2015</b>			
Service Pack; W/51mm Orange Insert	20040	31	3.5	OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
<b>2004-2008</b>				Sensor; Includes Transmitter Only	28081	40	4.5
OE Sensor: BMW - 36236781847				Service Pack; Does Not Include Valve	20023	31	3.5
Sensor; Includes Transmitter Only	20083	31	3.5	Service Pack; W/43mm Silver Insert	20037	31	3.5
Service Pack; Does Not Include Valve	20023	31	3.5	Service Pack; W/48mm Green Insert	20038	31	3.5
Service Pack; W/43mm Silver Insert	20037	31	3.5	Service Pack; W/49mm Black Insert	20039	31	3.5
Service Pack; W/48mm Green Insert	20038	31	3.5	Service Pack; W/51mm Orange Insert	20040	31	3.5
Service Pack; W/49mm Black Insert	20039	31	3.5				
Service Pack; W/51mm Orange Insert	20040	31	3.5	<b>Alpina B7</b>			
<b>2010-2011</b>				<b>2007-2008</b>			
OE Sensor: BMW - 36236781847				OE Sensor: BMW - 36236781847			
Sensor; Includes Transmitter Only	20083	31	3.5	Sensor; Includes Transmitter Only	20083	31	3.5
Service Pack; Does Not Include Valve	20023	31	3.5	Service Pack; Does Not Include Valve	20023	31	3.5
Service Pack; W/43mm Silver Insert	20037	31	3.5	Service Pack; W/43mm Silver Insert	20037	31	3.5
Service Pack; W/48mm Green Insert	20038	31	3.5	Service Pack; W/48mm Green Insert	20038	31	3.5
Service Pack; W/49mm Black Insert	20039	31	3.5	Service Pack; W/49mm Black Insert	20039	31	3.5
Service Pack; W/51mm Orange Insert	20040	31	3.5	Service Pack; W/51mm Orange Insert	20040	31	3.5
<b>2012-2015</b>				<b>2011</b>			
OE Sensor: BMW - 36 10 6 856 227				OE Sensor: BMW - 36118378682			
Sensor	28081	40	4.5	Sensor; Includes Transmitter Only	20080	31	3.5
Service Pack; Does Not Include Valve	20023	31	3.5	Service Pack; Does Not Include Valve	20023	31	3.5
Service Pack; W/43mm Silver Insert	20037	31	3.5	Service Pack; W/43mm Silver Insert	20037	31	3.5
Service Pack; W/48mm Green Insert	20038	31	3.5	Service Pack; W/48mm Green Insert	20038	31	3.5
Service Pack; W/49mm Black Insert	20039	31	3.5	Service Pack; W/49mm Black Insert	20039	31	3.5
Service Pack; W/51mm Orange Insert	20040	31	3.5	Service Pack; W/51mm Orange Insert	20040	31	3.5
<b>ActiveHybrid 3</b>				<b>2012-2014</b>			
<b>2013-2014</b>				Service Pack; Does Not Include Valve	20023	31	3.5
OE Sensor: BMW - 36 10 6 856 227, 36 10 6 856 872				Service Pack; W/43mm Silver Insert	20037	31	3.5
Sensor	28126	40	4.5	Service Pack; W/48mm Green Insert	20038	31	3.5
Service Pack; Does Not Include Valve	20023	31	3.5	Service Pack; W/49mm Black Insert	20039	31	3.5
Service Pack; W/43mm Silver Insert	20037	31	3.5	Service Pack; W/51mm Orange Insert	20040	31	3.5
Service Pack; W/48mm Green Insert	20038	31	3.5				
Service Pack; W/49mm Black Insert	20039	31	3.5	<b>Alpina B7 xDrive</b>			
Service Pack; W/51mm Orange Insert	20040	31	3.5	<b>2011</b>			
<b>ActiveHybrid 5</b>				OE Sensor: BMW - 36118378682			
<b>2012-2014</b>				Sensor; Includes Transmitter Only	20080	31	3.5
OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227				Service Pack; Does Not Include Valve	20023	31	3.5
Sensor; Includes Transmitter Only	28081	40	4.5	Service Pack; W/43mm Silver Insert	20037	31	3.5
Service Pack; Does Not Include Valve	20023	31	3.5	Service Pack; W/48mm Green Insert	20038	31	3.5
Service Pack; W/43mm Silver Insert	20037	31	3.5	Service Pack; W/49mm Black Insert	20039	31	3.5
Service Pack; W/48mm Green Insert	20038	31	3.5	Service Pack; W/51mm Orange Insert	20040	31	3.5
Service Pack; W/49mm Black Insert	20039	31	3.5				
Service Pack; W/51mm Orange Insert	20040	31	3.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>BMW (cont'd)</b>				<b>BMW (cont'd)</b>			
<b>Alpina B7L</b>				<b>M (cont'd)</b>			
<b>2011</b>				<b>2004-2010</b>			
OE Sensor: BMW - 36118378682				OE Sensor: BMW - 36236781847			
Sensor; Includes Transmitter Only. ....	20080	31	3.5	Sensor; Includes Transmitter Only. ....	20083	31	3.5
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/49mm Black Insert. ....	20039	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
<b>Alpina B7L xDrive</b>				<b>2010</b>			
<b>2011</b>				OE Sensor: BMW - 36 10 6 790 054			
OE Sensor: BMW - 36118378682				Sensor; Includes Transmitter Only. ....	28081	40	4.5
Sensor; Includes Transmitter Only. ....	20080	31	3.5	<b>2011-2013</b>			
Service Pack; Does Not Include Valve. ....	20023	31	3.5	OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Sensor; Includes Transmitter Only. ....	28081	40	4.5
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
<b>M</b>				Service Pack; W/49mm Black Insert. ....			
<b>2000-2001</b>				Service Pack; W/51mm Orange Insert. ....			
OE Sensor: BMW - 36118378682				20040	31	3.5	
Sensor; Includes Transmitter Only; W/433 MHz				<b>2014</b>			
Sensor. ....	20080	31	3.5	OE Sensor: BMW - 36 10 6 798 872, 36 10 6 856 227			
Service Pack; Does Not Include Valve. ....	20023	31	3.5	EZ-Sensor; Programmable sensor. Programming			
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	tool req'd. ....	33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	EZ-Sensor Service Pack; Aluminium valve. ....	34000	62	7
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	EZ-Sensor Service Pack; Rubber Valve. ....	20018 <sup>C</sup>	11.5	1.3
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Sensor; Includes Transmitter Only. ....	28081	40	4.5
<b>2002</b>				28126			
OE Sensor: BMW - 36118378682				Service Pack; Does Not Include Valve. ....	20023	31	3.5
EZ-Sensor. ....	33100 <sup>A</sup>	11.5	1.3	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
	33200 <sup>A</sup>	11.5	1.3	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack; W/49mm Black Insert. ....	20039	31	3.5
EZ-Sensor Service Pack; Aluminium Valve. ....	34000	62	7	Service Pack; W/51mm Orange Insert. ....	20040	31	3.5
EZ-Sensor Service Pack; Rubber Valve. ....	20018 <sup>C</sup>	11.5	1.3	<b>2015</b>			
Sensor; Includes Transmitter Only; W/433 MHz				OE Sensor: BMW - 36 10 6 798 872, 36 10 6 856 227			
Sensor. ....	20080	31	3.5	Sensor. ....	28126	40	4.5
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Sensor; Includes Transmitter Only. ....	28081	40	4.5
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; Does Not Include Valve. ....	20023	31	3.5
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	31	3.5
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	31	3.5
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/49mm Black Insert. ....	20039	31	3.5
<b>2003</b>				Service Pack; W/51mm Orange Insert. ....			
OE Sensor: BMW - 36118378682				20040	31	3.5	
EZ-Sensor. ....	33100 <sup>A</sup>	11.5	1.3	<b>X</b>			
	33200 <sup>A</sup>	11.5	1.3	<b>2000-2003</b>			
	33500 <sup>A, DB</sup>	11.5	1.3	OE Sensor: BMW - 36146752128			
EZ-Sensor Service Pack; Aluminium Valve. ....	34000	62	7	EZ-Sensor. ....	33100 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. ....	20018 <sup>C</sup>	11.5	1.3		33200 <sup>A</sup>	11.5	1.3
Sensor; Includes Transmitter Only. ....	20080	31	3.5		33500 <sup>A, DB</sup>	11.5	1.3
Sensor; Includes Transmitter Only; W/433 MHz				EZ-Sensor Service Pack; Aluminium Valve. ....	34000	62	7
Sensor. ....	20080	31	3.5	EZ-Sensor Service Pack; Rubber Valve. ....	20018 <sup>C</sup>	11.5	1.3
Service Pack; Does Not Include Valve. ....	20023	31	3.5	Sensor; Includes Transmitter Only. ....	28082	35	4
Service Pack; W/43mm Silver Insert. ....	20037	31	3.5	Service Pack; Does Not Include Valve. ....	20023	35	4
Service Pack; W/48mm Green Insert. ....	20038	31	3.5	Service Pack; W/43mm Silver Insert. ....	20037	35	4
Service Pack; W/49mm Black Insert. ....	20039	31	3.5	Service Pack; W/48mm Green Insert. ....	20038	35	4
Service Pack; W/51mm Orange Insert. ....	20040	31	3.5	Service Pack; W/49mm Black Insert. ....	20039	35	4
				Service Pack; W/51mm Orange Insert. ....			
				20040			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>BMW (cont'd)</b>				<b>BMW (cont'd)</b>			
<b>X (cont'd)</b>				<b>Z3</b>			
<b>2004</b>				<b>2000-2002</b>			
OE Sensor: BMW - 36146752128				Service Pack; Does Not Include Valve. . . . .	20023	31	3.5
Sensor; Includes Transmitter Only. . . . .	28082	35	4	Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5
Service Pack; Does Not Include Valve. . . . .	20023	35	4	Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5
Service Pack; W/43mm Silver Insert. . . . .	20037	35	4	Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5
Service Pack; W/48mm Green Insert. . . . .	20038	35	4	Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5
Service Pack; W/49mm Black Insert. . . . .	20039	35	4				
Service Pack; W/51mm Orange Insert. . . . .	20040	35	4	<b>Z4</b>			
<b>2005-2011</b>				<b>2003-2011</b>			
OE Sensor: BMW - 36236781847				OE Sensor: BMW - 36236781847			
Sensor; Includes Transmitter Only. . . . .	20083	35	4	Sensor; Includes Transmitter Only. . . . .	20083	31	3.5
Service Pack; Does Not Include Valve. . . . .	20023	35	4	Service Pack; Does Not Include Valve. . . . .	20023	31	3.5
Service Pack; W/43mm Silver Insert. . . . .	20037	35	4	Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5
Service Pack; W/48mm Green Insert. . . . .	20038	35	4	Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5
Service Pack; W/49mm Black Insert. . . . .	20039	35	4	Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5
Service Pack; W/51mm Orange Insert. . . . .	20040	35	4	Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5
<b>2012-2014</b>				<b>2012-2015</b>			
OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227				OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
Sensor; Includes Transmitter Only. . . . .	28081	40	4.5	Sensor; Includes Transmitter Only. . . . .	28081	40	4.5
Service Pack; Does Not Include Valve. . . . .	20023	31	3.5	Service Pack; Does Not Include Valve. . . . .	20023	31	3.5
Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5	Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5
Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5	Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5
Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5	Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5
Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5	Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5
<b>2015</b>				<b>2016</b>			
OE Sensor: BMW - 36 10 6 798 872, 36 10 6 856 227				OE Sensor: BMW - 36 10 6 856 872			
EZ-Sensor; Programmable sensor. Programming tool required. . . . .	33500 A, DB	11.5	1.3	Sensor. . . . .	28126	40	4.5
EZ-Sensor Service Pack; Aluminum valve. . . . .	34000	62	7	Service Pack; Does Not Include Valve. . . . .	20023	31	3.5
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5
Sensor. . . . .	28126	35	4	Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5
Sensor; Includes Transmitter Only. . . . .	28081	40	4.5	Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5
Service Pack; Does Not Include Valve. . . . .	20023	31	3.5	Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5
Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5	<b>Z8</b>			
Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5	<b>2000-2002</b>			
Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5	Service Pack; Does Not Include Valve. . . . .	20023	31	3.5
Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5	Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5
<b>2016</b>				<b>2003</b>			
OE Sensor: BMW - 36 10 6 798 872, 36 10 6 856 872				OE Sensor: BMW - 36118378682			
EZ-Sensor; Programmable sensor. Programming tool required. . . . .	33500 A, DB	11.5	1.3	Sensor; Includes Transmitter Only; W/433 MHz			
EZ-Sensor Service Pack; Aluminum valve. . . . .	34000	62	7	Sensor. . . . .	20080	31	3.5
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	Service Pack; Does Not Include Valve. . . . .	20023	31	3.5
Sensor. . . . .	28126	40	4.5	Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5
	28126	35	4	Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5
Service Pack; Does Not Include Valve. . . . .	20023	31	3.5	Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5
Service Pack; W/43mm Silver Insert. . . . .	20037	31	3.5	Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5
Service Pack; W/48mm Green Insert. . . . .	20038	31	3.5				
Service Pack; W/49mm Black Insert. . . . .	20039	31	3.5				
Service Pack; W/51mm Orange Insert. . . . .	20040	31	3.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Bugatti</b>				<b>Buick (cont'd)</b>			
<b>Veyron 16.4</b>				<b>Enclave (cont'd)</b>			
<b>2006</b>				<b>2009-2015</b>			
Service Pack; Does Not Include Valve. . . . .	20023	35	4	OE Sensor: General Motors - 13598771, 20923680, 22853741, 25920615			
Service Pack; W/43mm Silver Insert. . . . .	20037	35	4	EZ-Sensor. . . . .	33000 <sup>A</sup>	11.5	1.3
Service Pack; W/48mm Green Insert. . . . .	20038	35	4		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; W/49mm Black Insert. . . . .	20039	35	4	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
Service Pack; W/51mm Orange Insert. . . . .	20040	35	4	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 <sup>C</sup>	11.5	1.3
<b>Buick</b>				Sensor. . . . .	20153	11.5	1.3
<b>Allure</b>				Service Pack. . . . .	20008 <sup>C</sup>	11.5	1.3
<b>2006</b>				<b>2016</b>			
Sensor. . . . .	INDIRECT <sup>D</sup>			OE Sensor: General Motors - 13598771			
<b>2007-2008</b>				Sensor. . . . .	20153	11.5	1.3
OE Sensor: General Motors - 10394110, 15921013				Service Pack. . . . .	20008 <sup>C</sup>	11.5	1.3
EZ-Sensor. . . . .	33000 <sup>A</sup>	11.5	1.3	<b>Encore</b>			
	33500 <sup>A, DB</sup>	11.5	1.3	<b>2013-2015</b>			
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	OE Sensor: General Motors - 22854866			
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor. . . . .	33000 <sup>A</sup>	11.5	1.3
Sensor. . . . .	20158	62	7		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; W/Schrader Sensor. . . . .	20004	62	7	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
Service Pack; W/Siemens Sensor. . . . .	20030	80	9	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 <sup>C</sup>	11.5	1.3
<b>2009</b>				Sensor. . . . .	28206	11.5	1.3
OE Sensor: General Motors - 25920615				Service Pack. . . . .	20008 <sup>C</sup>	11.5	1.3
EZ-Sensor. . . . .	33000 <sup>A</sup>	11.5	1.3	<b>2016</b>			
	33500 <sup>A, DB</sup>	11.5	1.3	Sensor. . . . .	28206	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	Service Pack. . . . .	20008 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 <sup>C</sup>	11.5	1.3	<b>LaCrosse</b>			
Sensor. . . . .	20153	11.5	1.3	<b>2006</b>			
Service Pack. . . . .	20008 <sup>C</sup>	11.5	1.3	OE Sensor: General Motors - 15268606			
<b>2010</b>				EZ-Sensor. . . . .	33000 <sup>A</sup>	11.5	1.3
OE Sensor: General Motors - 12768826					33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor. . . . .	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	Sensor. . . . .	20158	62	7
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 <sup>C</sup>	11.5	1.3	Service Pack; W/Schrader Sensor. . . . .	20004	62	7
Sensor. . . . .	28206	11.5	1.3	Service Pack; W/Siemens Sensor. . . . .	20030	80	9
Service Pack. . . . .	20008 <sup>C</sup>	11.5	1.3	<b>2007-2008</b>			
<b>2011</b>				OE Sensor: General Motors - 10394110, 15921013			
EZ-Sensor. . . . .	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor. . . . .	33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
<b>Century</b>				EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 <sup>C</sup>	11.5	1.3
<b>1999-2005</b>				Sensor. . . . .	20158	62	7
Sensor. . . . .	INDIRECT <sup>D</sup>			Service Pack; W/Schrader Sensor. . . . .	20004	62	7
<b>Enclave</b>				Service Pack; W/Siemens Sensor. . . . .	20030	80	9
<b>2008</b>				<b>2009</b>			
OE Sensor: General Motors - 15921013				OE Sensor: General Motors - 25920615			
EZ-Sensor. . . . .	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor. . . . .	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 <sup>C</sup>	11.5	1.3
Sensor. . . . .	20158	62	7	Sensor. . . . .	20153	11.5	1.3
Service Pack; W/Schrader Sensor. . . . .	20004	62	7	Service Pack. . . . .	20008 <sup>C</sup>	11.5	1.3
Service Pack; W/Siemens Sensor. . . . .	20030	80	9				

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Buick (cont'd)</b>				<b>Buick (cont'd)</b>			
<b>LaCrosse (cont'd)</b>				<b>Regal (cont'd)</b>			
2010-2015				2011-2016			
OE Sensor: General Motors - 12768826, 20922900, 22854866				OE Sensor: General Motors - 12768826, 13598772, 22854866			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28206	11.5	1.3	Sensor	28206	11.5	1.3
Service Pack	20008 C	11.5	1.3	Service Pack	20008 C	11.5	1.3
2016				<b>Rendezvous</b>			
OE Sensor: General Motors - 13598772				2003-2007			
Sensor	28206	11.5	1.3	Sensor	INDIRECT D		
Service Pack	20008 C	11.5	1.3	<b>Verano</b>			
<b>LeSabre</b>				2012-2015			
2000-2005				OE Sensor: General Motors - 12768826, 13581558, 22854866			
Sensor	INDIRECT D			EZ-Sensor	33000 A	11.5	1.3
2007					33500 A, DB	11.5	1.3
EZ-Sensor	33500 A, DB			EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	28206	11.5	1.3
<b>Lucerne</b>				Service Pack			
2007-2011				20008 C			
OE Sensor: General Motors - 15254101, 15922396, 25799331, 25920615				2016			
EZ-Sensor	33000 A	11.5	1.3	OE Sensor: General Motors - 13598772			
	33500 A, DB	11.5	1.3	Sensor			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	28206			
Sensor	20153	11.5	1.3	20008 C			
Service Pack	20008 C	11.5	1.3	<b>Cadillac</b>			
<b>Park Avenue</b>				<b>ATS</b>			
1998-2005				2013			
Sensor	INDIRECT D			OE Sensor: General Motors - 22959744			
<b>Rainier</b>				EZ-Sensor; For ATS-V, When installing			
2006				EZ-Sensor the rubber valve MUST be removed			
OE Sensor: General Motors - 25774006				and replaced with Schrader Aluminium valve kit			
Sensor; OEM Part No. 25774006	20116	62	7	34000			
Service Pack	20004	62	7	33000 A			
2007				33500 A, DB			
OE Sensor: General Motors - 25774006				11.5			
EZ-Sensor	33500 A, DB	11.5	1.3	1.3			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	34000			
Sensor; OEM Part No. 25774006	20116	62	7	62			
Service Pack	20004	62	7	7			
<b>Regal</b>				EZ-Sensor Service Pack; exc V; Rubber Valve			
1999-2004				20018 C			
Sensor				28206			
INDIRECT D				28423			
				20008 C			
				20004			

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Cadillac (cont'd)</b>				<b>Cadillac (cont'd)</b>			
<b>ATS (cont'd)</b>				<b>CTS (cont'd)</b>			
<b>2015</b>				<b>2012</b>			
OE Sensor: General Motors - 13581558, 20964159				OE Sensor: General Motors - 20923680, 20925924			
EZ-Sensor; For ATS-V, When installing				EZ-Sensor; For CTS-V, When installing			
EZ-Sensor the rubber valve MUST be removed				EZ-Sensor the rubber valve MUST be removed			
and replaced with Schrader Aluminium valve kit				and replaced with Schrader Aluminium valve kit			
34000.....	33000 <sup>A</sup>	11.5	1.3	34000.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; exc V; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; exc V; Rubber Valve....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; exc V; Rubber Valve....	20018 <sup>C</sup>	11.5	1.3
Sensor; exc V.....	28206	11.5	1.3	Sensor; OEM Part No. 15268606; CTS V; W/315			
Sensor; V.....	28423	62	7	MHz Sensor.....	20158	62	7
Service Pack; exc V.....	20008 <sup>C</sup>	11.5	1.3	Sensor; OEM Part No. 25920615; Exc. CTS V....	20153	11.5	1.3
Service Pack; V.....	20004	62	7	Service Pack; OEM Part No. 15268606; CTS V;			
<b>2016</b>				W/315 MHz Sensor.....			
OE Sensor: General Motors - 13598772				Service Pack; OEM Part No. 25920615; Exc. CTS			
Sensor; exc V.....				V.....			
Service Pack; exc V.....				20008 <sup>C</sup>			
28206				11.5			
20008 <sup>C</sup>				1.3			
11.5				1.3			
<b>CTS</b>				<b>2013</b>			
<b>2004-2007</b>				OE Sensor: General Motors - 20925924, 22853741			
OE Sensor: General Motors - 25774006				EZ-Sensor; For CTS-V, When installing			
Sensor.....				EZ-Sensor the rubber valve MUST be removed			
Service Pack.....				and replaced with Schrader Aluminium valve kit			
20116				34000.....			
20004				33000 <sup>A</sup>			
62				11.5			
7				1.3			
<b>2008</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: General Motors - 25920615				34000			
EZ-Sensor; For CTS-V, When installing				62			
EZ-Sensor the rubber valve MUST be removed				7			
and replaced with Schrader Aluminium valve kit				EZ-Sensor Service Pack; exc V; Rubber Valve....			
34000.....				20018 <sup>C</sup>			
33000 <sup>A</sup>				11.5			
33500 <sup>A, DB</sup>				1.3			
11.5				1.3			
62				7			
7				1.3			
EZ-Sensor Service Pack; Aluminium Valve.....				20153			
EZ-Sensor Service Pack; Rubber Valve.....				11.5			
Sensor.....				1.3			
Service Pack.....				20008 <sup>C</sup>			
20153				11.5			
20008 <sup>C</sup>				1.3			
<b>2009-2011</b>				<b>2014-2015</b>			
OE Sensor: General Motors - 15268606, 15922396, 25920615				OE Sensor: General Motors - 13581558, 13581559, 20964159			
EZ-Sensor; For CTS-V, When installing				EZ-Sensor; For CTS-V, When installing			
EZ-Sensor the rubber valve MUST be removed				EZ-Sensor the rubber valve MUST be removed			
and replaced with Schrader Aluminium valve kit				and replaced with Schrader Aluminium valve kit			
34000.....				34000.....			
33000 <sup>A</sup>				33000 <sup>A</sup>			
33500 <sup>A, DB</sup>				33500 <sup>A, DB</sup>			
11.5				11.5			
1.3				1.3			
62				62			
7				7			
7				7			
EZ-Sensor Service Pack; Aluminium Valve.....				EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor Service Pack; exc V; Rubber Valve....				EZ-Sensor Service Pack; exc V; Rubber Valve....			
Sensor; OEM Part No. 15268606; CTS V; W/315				Sensor; exc V.....			
MHz Sensor.....				Sensor; V.....			
20158				28206			
62				11.5			
7				1.3			
Sensor; OEM Part No. 25920615; Exc. CTS V....				Service Pack; exc V.....			
20153				20008 <sup>C</sup>			
11.5				11.5			
1.3				1.3			
Service Pack; OEM Part No. 15268606; CTS V;				Service Pack; V.....			
W/315 MHz Sensor.....				20004			
20004				62			
62				7			
7				7			
Service Pack; OEM Part No. 25920615; Exc. CTS				<b>2016</b>			
V.....				OE Sensor: General Motors - 13598772			
20008 <sup>C</sup>				Sensor; exc V.....			
11.5				Service Pack; exc V.....			
1.3				28206			
				11.5			
				1.3			
				20008 <sup>C</sup>			
				11.5			
				1.3			
				62			
				7			
				7			
				<b>DeVille</b>			
				<b>2001-2005</b>			
				OE Sensor: General Motors - 25773946			
				Sensor.....			
				Service Pack.....			
				20117 <sup>B</sup>			
				62			
				7			
				20003			
				62			
				7			

A-Programming Tool Required    B-Magnet may be Required to Activate Sensor    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.		
<b>Cadillac (cont'd)</b>				<b>Cadillac (cont'd)</b>					
<b>DTS</b>				<b>Escalade (cont'd)</b>					
<b>2006</b>				<b>2007</b>					
OE Sensor: General Motors - 15268606				OE Sensor: General Motors - 15825475, 25799331					
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3		
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3		
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3		
Sensor	20158	62	7	Sensor; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem	20158	62	7		
Service Pack	20004	62	7	Sensor; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem	20153	11.5	1.3		
<b>2007-2011</b>				Service Pack; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem					
OE Sensor: General Motors - 15254101, 15922396, 20923680, 25799331, 25920615				20015				80	9
EZ-Sensor	33000 A	11.5	1.3	Service Pack; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem	20008 C	11.5	1.3		
	33500 A, DB	11.5	1.3	<b>2008</b>					
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: General Motors - 25799331					
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3		
Sensor	20153	11.5	1.3		33500 A, DB	11.5	1.3		
Service Pack	20008 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		
<b>ELR</b>				EZ-Sensor Service Pack; Rubber Valve					
<b>2014</b>				20018 C				11.5	1.3
OE Sensor: General Motors - 22854866				Sensor; OEM Part No. 25799331; OEM Part No. 15922396					
EZ-Sensor	33000 A	11.5	1.3	Service Pack	20008 C	11.5	1.3		
	33500 A, DB	11.5	1.3	<b>2009-2011</b>					
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: General Motors - 15922396, 20923680, 25920615					
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3		
Sensor	28206	11.5	1.3		33500 A, DB	11.5	1.3		
Service Pack	20008 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		
<b>2015</b>				EZ-Sensor Service Pack; Rubber Valve					
OE Sensor: General Motors - 13598772				20018 C				11.5	1.3
Sensor	28206	11.5	1.3	Sensor	20153	11.5	1.3		
Service Pack	20008 C	11.5	1.3	Service Pack	20008 C	11.5	1.3		
<b>Escalade</b>				<b>2011</b>					
<b>2004</b>				Service Pack					
OE Sensor: General Motors - 15136883				20008 C					
EZ-Sensor	33000 A	11.5	1.3	<b>2012-2013</b>					
	33500 A, DB	11.5	1.3	OE Sensor: General Motors - 13586335, 20923680					
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor	33000 A	11.5	1.3		
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3		33500 A, DB	11.5	1.3		
Sensor	20115	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		
Service Pack	20004	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3		
<b>2005-2006</b>				Sensor					
OE Sensor: General Motors - 15114379				20153				11.5	1.3
EZ-Sensor	33000 A	11.5	1.3	Service Pack	20008 C	11.5	1.3		
	33500 A, DB	11.5	1.3	<b>2014-2015</b>					
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: General Motors - 13581558					
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3		
Sensor	20107	62	7		33500 A, DB	11.5	1.3		
Service Pack	20004	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		
<b>2016</b>				EZ-Sensor Service Pack; Rubber Valve					
OE Sensor: General Motors - 13598772				20018 C				11.5	1.3
Sensor	28206	11.5	1.3	Sensor	28206	11.5	1.3		
Service Pack	20008 C	11.5	1.3	Service Pack	20008 C	11.5	1.3		
<b>2016</b>				<b>2016</b>					
OE Sensor: General Motors - 13581558				OE Sensor: General Motors - 13581558					
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3		
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3		
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	28206	11.5	1.3		
Sensor	20107	62	7	Service Pack	20008 C	11.5	1.3		
Service Pack	20004	62	7	<b>2016</b>					
<b>2016</b>				OE Sensor: General Motors - 13581558					
OE Sensor: General Motors - 13581558				EZ-Sensor					
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3		
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3		
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	28206	11.5	1.3		
Sensor	20107	62	7	Service Pack	20008 C	11.5	1.3		
Service Pack	20004	62	7	<b>2016</b>					

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Cadillac (cont'd)</b>				<b>Cadillac (cont'd)</b>			
<b>Seville</b>				<b>STS (cont'd)</b>			
<b>2001-2004</b>				<b>2010</b>			
OE Sensor: General Motors - 25773946				OE Sensor: General Motors - 15922396			
Sensor.....	20117 <sup>B</sup>	62	7	EZ-Sensor; For STS-V, When installing			
Service Pack.....	20003	62	7	EZ-Sensor the rubber valve <b>MUST</b> be removed			
				and replaced with Schrader Aluminium valve kit			
<b>SRX</b>				<b>2011</b>			
<b>2004-2006</b>				<b>2011</b>			
OE Sensor: General Motors - 25774006				OE Sensor: General Motors - 20923680, 25920615			
Sensor.....	20116	62	7	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
Service Pack.....	20004	62	7		33500 <sup>A, DB</sup>	11.5	1.3
<b>2007-2009</b>				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: General Motors - 15922396, 25799331				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Sensor; OEM Part No. 15922396; OEM Part No.			
	33500 <sup>A, DB</sup>	11.5	1.3	25920615.....	20153	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20008 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>2010-2015</b>			
Sensor.....	20153	11.5	1.3	OE Sensor: General Motors - 12768826, 13581558, 20922900,			
Service Pack.....	20008 <sup>C</sup>	11.5	1.3	22854866			
<b>STS</b>				EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
<b>2005</b>					33500 <sup>A, DB</sup>	11.5	1.3
OE Sensor: General Motors - 25758220				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	Sensor.....	28206	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20008 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>XLR</b>			
Sensor; OEM Part No. 25758220.....	20076	62	7	<b>2004</b>			
Service Pack.....	20004	62	7	OE Sensor: General Motors - 25758220			
<b>2006-2008</b>				EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
OE Sensor: General Motors - 25758220					33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; OEM Part No. 25758220.....	20076	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack.....	20004	62	7
Sensor.....	20076	62	7	<b>2005-2009</b>			
Service Pack.....	20004	62	7	OE Sensor: General Motors - 25758220			
<b>2009</b>				EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
OE Sensor: General Motors - 15922396					33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor; For STS-V, When installing				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor the rubber valve <b>MUST</b> be removed				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
and replaced with Schrader Aluminium valve kit				Sensor.....	20076	62	7
34000.....	33000 <sup>A</sup>	11.5	1.3	Service Pack.....	20004	62	7
	33500 <sup>A, DB</sup>	11.5	1.3	<b>2010-2011</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; exc V; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; OEM Part No. 25920615; Exc. STS V.....	20153	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; OEM Part No. 25920615; Exc. STS				<b>XTS</b>			
V.....	20008 <sup>C</sup>	11.5	1.3	<b>2013-2015</b>			
				OE Sensor: General Motors - 22854866			
				EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
					33500 <sup>A, DB</sup>	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
				Sensor.....	28206	11.5	1.3
				Service Pack.....	20008 <sup>C</sup>	11.5	1.3

A-Programming Tool Required    B-Magnet may be Required to Activate Sensor    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Cadillac (cont'd)</b>				<b>Chevrolet (cont'd)</b>			
<b>XTS (cont'd)</b>				<b>Aveo (cont'd)</b>			
<b>2016</b>				<b>2008-2011</b>			
OE Sensor: General Motors - 13598772				OE Sensor: General Motors - 15922396, 20923680, 25920615			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	34000	62	7
Sensor	28206	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack	20008 C	11.5	1.3	Sensor	20153	11.5	1.3
				Service Pack			
				20008 C			
				11.5			
				1.3			
<b>Chevrolet</b>				<b>Aveo5</b>			
<b>Avalanche</b>				<b>2007</b>			
<b>2004-2006</b>				OE Sensor: General Motors - 25799331			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	34000	62	7
<b>2007</b>				EZ-Sensor Service Pack; Rubber Valve			
OE Sensor: General Motors - 15825475, 25799331				20018 C			
EZ-Sensor	33000 A	11.5	1.3	11.5			
EZ-Sensor Service Pack; Aluminium Valve	33500 A, DB	11.5	1.3	1.3			
EZ-Sensor Service Pack; Rubber Valve	34000	62	7	Sensor; Hatchback			
Sensor; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem	20158	62	7	20153			
Sensor; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem	20153	11.5	1.3	20008 C			
Service Pack; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem	20015	80	9	11.5			
Service Pack; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem	20008 C	11.5	1.3	1.3			
<b>2008</b>				<b>2008-2011</b>			
OE Sensor: General Motors - 25799331				OE Sensor: General Motors - 15922396, 20923680, 25920615			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	34000	62	7
Sensor; OEM Part No. 25799331; OEM Part No. 15922396	20018 C	11.5	1.3	Sensor	20018 C	11.5	1.3
Service Pack	20153	11.5	1.3	Service Pack	20153	11.5	1.3
<b>2009-2013</b>				Service Pack			
OE Sensor: General Motors - 13586335, 15922396, 20923680, 25920615				20008 C			
EZ-Sensor	33000 A	11.5	1.3	11.5			
EZ-Sensor Service Pack; Aluminium Valve	33500 A, DB	11.5	1.3	1.3			
EZ-Sensor Service Pack; Rubber Valve	34000	62	7	Sensor; ZL1			
Sensor	20018 C	11.5	1.3	33000 A			
Service Pack	20153	11.5	1.3	11.5			
				1.3			
				33500 A, DB			
				11.5			
				1.3			
				34000			
				62			
				7			
				20018 C			
				11.5			
				1.3			
				20153			
				11.5			
				1.3			
				20008 C			
				11.5			
				1.3			
				20008 C			
				11.5			
				1.3			
				20004			
				62			
				7			
<b>Aveo</b>				<b>Camaro</b>			
<b>2007</b>				<b>2010-2011</b>			
OE Sensor: General Motors - 25799331				OE Sensor: General Motors - 12768826, 20922900			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	34000	62	7
Sensor; Hatchback	20018 C	11.5	1.3	Sensor	20018 C	11.5	1.3
Service Pack	20153	11.5	1.3	Service Pack	28206	11.5	1.3
				20008 C			
				11.5			
				1.3			
				20008 C			
				11.5			
				1.3			
				20004			
				62			
				7			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Chevrolet (cont'd)</b>				<b>Chevrolet (cont'd)</b>			
<b>Camaro (cont'd)</b>				<b>Captiva Sport (cont'd)</b>			
<b>2013-2015</b>				<b>2014-2015</b>			
OE Sensor: General Motors - 20964159, 22854866				EZ-Sensor. . . . . 33500 <sup>A, DB</sup> 11.5 1.3			
EZ-Sensor; Exc. ZL1. . . . . 33000 <sup>A</sup> 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7			
				EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 <sup>C</sup> 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve; Exc. ZL1. . . . . 34000 62 7				<b>Cobalt</b>			
EZ-Sensor Service Pack; Rubber Valve; Exc. ZL1. . . . . 20018 <sup>C</sup> 11.5 1.3				<b>2008</b>			
Sensor; Exc. ZL1. . . . . 28206 11.5 1.3				OE Sensor: General Motors - 15921013, 15922396			
Sensor; ZL1. . . . . 28423 62 7				EZ-Sensor. . . . . 33000 <sup>A</sup> 11.5 1.3			
Service Pack; Exc. ZL1. . . . . 20008 <sup>C</sup> 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7			
Service Pack; ZL1. . . . . 20004 62 7				EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 <sup>C</sup> 11.5 1.3			
<b>2016</b>				Sensor; Clamp-In Style Only; W/Aluminium Valve Stem. . . . . 20158 62 7			
EZ-Sensor; Exc. ZL1. . . . . 33500 <sup>A, DB</sup> 11.5 1.3				Sensor; Snap-In Style Only; W/Rubber Valve Stem. . . . . 20153 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve; Exc. ZL1. . . . . 34000 62 7				Service Pack; Clamp-In Style Only; W/Aluminium Valve Stem. . . . . 20004 80 9			
EZ-Sensor Service Pack; Rubber Valve; Exc. ZL1. . . . . 20018 <sup>C</sup> 11.5 1.3				Service Pack; Snap-In Style Only; W/Rubber Valve Stem. . . . . 20008 <sup>C</sup> 11.5 1.3			
Sensor; Exc. ZL1. . . . . 20154 11.5 1.3				<b>2009</b>			
Service Pack; Exc. ZL1. . . . . 20008 <sup>C</sup> 11.5 1.3				OE Sensor: General Motors - 15922396			
<b>Caprice</b>				EZ-Sensor. . . . . 33000 <sup>A</sup> 11.5 1.3			
<b>2011-2013</b>				EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7			
OE Sensor: General Motors - 15268606				EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 <sup>C</sup> 11.5 1.3			
EZ-Sensor. . . . . 33500 <sup>A, DB</sup> 11.5 1.3				Sensor; Snap-In Style Only; W/Rubber Valve Stem. . . . . 20153 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7				Service Pack; Clamp-In Style Only; W/Aluminium Valve Stem. . . . . 20004 80 9			
EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 <sup>C</sup> 11.5 1.3				Service Pack; Snap-In Style Only; W/Rubber Valve Stem. . . . . 20008 <sup>C</sup> 11.5 1.3			
Sensor. . . . . 20158 62 7				<b>2010</b>			
Service Pack. . . . . 20004 62 7				OE Sensor: General Motors - 12768826			
<b>2014</b>				EZ-Sensor. . . . . 33000 <sup>A</sup> 11.5 1.3			
OE Sensor: General Motors - 13581559				EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7			
EZ-Sensor; exc Police. . . . . 33500 <sup>A, DB</sup> 11.5 1.3				EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 <sup>C</sup> 11.5 1.3			
EZ-Sensor Service Pack; exc Police; Aluminium Valve. . . . . 34000 62 7				Sensor. . . . . 28206 11.5 1.3			
EZ-Sensor Service Pack; exc Police; Rubber Valve. . . . . 20018 <sup>C</sup> 11.5 1.3				Service Pack. . . . . 20008 <sup>C</sup> 11.5 1.3			
Sensor. . . . . 20228 71 8				<b>Colorado</b>			
Service Pack. . . . . 20047 71 8				<b>2007-2012</b>			
<b>2015</b>				OE Sensor: General Motors - 15122618			
OE Sensor: General Motors - 13581559				EZ-Sensor. . . . . 33000 <sup>A</sup> 11.5 1.3			
Sensor. . . . . 20228 71 8				EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7			
Service Pack. . . . . 20047 71 8				EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 <sup>C</sup> 11.5 1.3			
<b>2016</b>				Sensor. . . . . 20131 62 7			
OE Sensor: General Motors - 13598786				Service Pack. . . . . 20006 62 7			
Sensor. . . . . 28423 71 8				<b>2015</b>			
Service Pack. . . . . 20004 62 7				OE Sensor: General Motors - 13581558			
<b>Captiva Sport</b>				EZ-Sensor. . . . . 33000 <sup>A</sup> 11.5 1.3			
<b>2012-2013</b>				EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7			
OE Sensor: General Motors - 20923680, 22853741				EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 <sup>C</sup> 11.5 1.3			
EZ-Sensor. . . . . 33500 <sup>A, DB</sup> 11.5 1.3				Sensor. . . . . 28206 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7				Service Pack. . . . . 20008 <sup>C</sup> 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 <sup>C</sup> 11.5 1.3				<b>2016</b>			
Sensor. . . . . 20153 11.5 1.3				OE Sensor: General Motors - 13598786			
Service Pack. . . . . 20008 <sup>C</sup> 11.5 1.3				Sensor. . . . . 28423 71 8			
				Service Pack. . . . . 20004 62 7			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Chevrolet (cont'd)</b>				<b>Chevrolet (cont'd)</b>			
<b>Colorado (cont'd)</b>				<b>Corvette (cont'd)</b>			
<b>2016</b>				<b>2014-2015</b>			
OE Sensor: General Motors - 13581558				OE Sensor: General Motors - 13581560			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	34000	62	7
Sensor.....	28206	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack.....	20008 C	11.5	1.3	Sensor.....	20223	71	8
				Service Pack.....	20047	71	8
<b>Corvette</b>				<b>2016</b>			
<b>1997-2000</b>				OE Sensor: General Motors - 13581560			
OE Sensor: General Motors - 10438853				EZ-Sensor.....	33500 A, DB	11.5	1.3
Sensor.....	28006 B	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack.....	20012	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
<b>2001-2004</b>				Sensor.....			
OE Sensor: General Motors - 25773946				Service Pack.....	20047	71	8
Sensor.....	20117 B	62	7				
Service Pack.....	20003	62	7	<b>2011-2015</b>			
<b>2005-2009</b>				OE Sensor: General Motors - 12768826, 13581558, 22854866			
OE Sensor: General Motors - 25758220				EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor; exc Z06; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000.....	33000 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	28206	11.5	1.3
Sensor.....	20076	62	7	Service Pack.....	20008 C	11.5	1.3
Service Pack.....	20004	62	7	<b>2016</b>			
<b>2010-2011</b>				OE Sensor: General Motors - 13598772			
OE Sensor: General Motors - 15268606				Sensor.....	28206	11.5	1.3
EZ-Sensor; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000.....	33000 A	11.5	1.3	Service Pack.....	20008 C	11.5	1.3
	33500 A, DB	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>Equinox</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2007-2009</b>			
Sensor.....	20158	62	7	OE Sensor: General Motors - 10394110, 15921013			
Service Pack.....	20004	62	7	EZ-Sensor.....			
<b>2012</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: General Motors - 15268606				EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor; Z06, Base; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000.....	33000 A	11.5	1.3	Sensor.....			
	33500 A, DB	11.5	1.3	Service Pack; W/Schrader Sensor.....			
EZ-Sensor Service Pack; Z06; Base.....	20018 C	11.5	1.3	Service Pack; W/Siemens Sensor.....			
	34000	62	7	<b>2010-2014</b>			
Sensor; Z06; Base.....	20158	62	7	OE Sensor: General Motors - 12768826, 22854866			
Service Pack; Z06; Base.....	20004	62	7	EZ-Sensor.....			
<b>2013</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: General Motors - 15268606				EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000.....	33000 A	11.5	1.3	Sensor.....			
	33500 A, DB	11.5	1.3	Service Pack.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2015</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	OE Sensor: General Motors - 13598772			
Sensor.....	20158	62	7	EZ-Sensor.....			
Service Pack.....	20004	62	7	EZ-Sensor Service Pack; Aluminium Valve.....			
				EZ-Sensor Service Pack; Rubber Valve.....			
				Sensor.....			
				Service Pack.....			

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Chevrolet (cont'd)</b>				<b>Chevrolet (cont'd)</b>			
<b>Equinox (cont'd)</b>				<b>HHR (cont'd)</b>			
<b>2016</b>				<b>2011</b>			
OE Sensor: General Motors - 13598772				OE Sensor: General Motors - 25920615			
Sensor.....	28206	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
Service Pack.....	20008 <sup>C</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
<b>Express</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
<b>2008-2009</b>				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: General Motors - 15921013				Sensor.....	20153	11.5	1.3
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Service Pack.....	20008 <sup>C</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	<b>Impala</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2000-2005</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....			
Sensor.....	20158	62	7	INDIRECT <sup>D</sup>			
Service Pack; W/Schrader Sensor.....	20004	62	7	<b>2006</b>			
Service Pack; W/Siemens Sensor.....	20030	80	9	OE Sensor: General Motors - 15268606			
<b>2010-2015</b>				EZ-Sensor.....			
OE Sensor: General Motors - 13586335, 22853741, 25920615					33000 <sup>A</sup>	11.5	1.3
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor; W/Alloy Wheels.....			
Sensor.....	20153	11.5	1.3	Service Pack; W/Alloy Wheels.....			
Service Pack.....	20008 <sup>C</sup>	11.5	1.3	2007			
<b>2016</b>				OE Sensor: General Motors - 15268606, 25799331			
OE Sensor: General Motors - 13586335				EZ-Sensor.....			
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3		33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
Sensor.....	20153	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
Service Pack.....	20008 <sup>C</sup>	11.5	1.3	Sensor; Clamp-In Style Only; W/Aluminium Valve Stem.....			
<b>HHR</b>				Sensor; Snap-In Style Only; W/Rubber Valve Stem.....			
<b>2008-2009</b>				Service Pack; Clamp-In Style Only; W/Aluminium Valve Stem.....			
OE Sensor: General Motors - 15268606, 15922396				Service Pack; Snap-In Style Only; W/Rubber Valve Stem.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	2008-2013			
	33500 <sup>A, DB</sup>	11.5	1.3	OE Sensor: General Motors - 15922396, 22853741, 25920615			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3		33000 <sup>A</sup>	11.5	1.3
Sensor; Clamp-In Style Only; W/Aluminium Valve Stem.....	20158	62	7		33500 <sup>A, DB</sup>	11.5	1.3
Sensor; Snap-In Style Only; W/Rubber Valve Stem.....	20153	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
Service Pack; Clamp-In Style Only; W/Aluminium Valve Stem.....	20004	80	9	EZ-Sensor Service Pack; Rubber Valve.....			
Service Pack; Snap-In Style Only; W/Rubber Valve Stem.....	20008 <sup>C</sup>	11.5	1.3	Sensor.....			
<b>2010</b>				Service Pack.....			
OE Sensor: General Motors - 12768826				2014-2015			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	OE Sensor: General Motors - 22854866			
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
Sensor.....	28206	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
Service Pack.....	20008 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
<b>2016</b>				Sensor.....			
OE Sensor: General Motors - 13598772				Service Pack.....			
Sensor.....	28206	11.5	1.3	2016			
Service Pack.....	20008 <sup>C</sup>	11.5	1.3	OE Sensor: General Motors - 13598772			
				Sensor.....			
				Service Pack.....			

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Chevrolet (cont'd)</b>				<b>Chevrolet (cont'd)</b>			
<b>Malibu</b>				<b>Monte Carlo (cont'd)</b>			
<b>2008</b>				<b>2006</b>			
OE Sensor: General Motors - 15921013, 15922396				OE Sensor: General Motors - 15268606			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor; Clamp-In Style Only; W/Aluminium Valve Stem	20158	62	7	Sensor; W/Alloy Wheels	20158	62	7
Sensor; Snap-In Style Only; W/Rubber Valve Stem	20153	11.5	1.3	Service Pack; W/Alloy Wheels	20004	62	7
Service Pack; Clamp-In Style Only; W/Aluminium Valve Stem	20004	80	9	<b>2007</b>			
Service Pack; Snap-In Style Only; W/Rubber Valve Stem	20008 C	11.5	1.3	OE Sensor: General Motors - 15268606, 25799331			
<b>2009</b>				EZ-Sensor			
OE Sensor: General Motors - 15922396				33000 A			
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	20153	11.5	1.3
Sensor	20153	11.5	1.3	Service Pack	20008 C	11.5	1.3
Service Pack	20008 C	11.5	1.3	<b>2010</b>			
<b>2010</b>				OE Sensor: General Motors - 12768826			
OE Sensor: General Motors - 12768826				EZ-Sensor			
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	28206	11.5	1.3
Sensor	28206	11.5	1.3	Service Pack	20008 C	11.5	1.3
Service Pack	20008 C	11.5	1.3	<b>2011-2012</b>			
<b>2011-2012</b>				OE Sensor: General Motors - 25920615			
OE Sensor: General Motors - 25920615				EZ-Sensor			
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	20153	11.5	1.3
Sensor	20153	11.5	1.3	Service Pack	20008 C	11.5	1.3
Service Pack	20008 C	11.5	1.3	<b>2013-2015</b>			
<b>2013-2015</b>				OE Sensor: General Motors - 22854866			
OE Sensor: General Motors - 22854866				EZ-Sensor			
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	28206	11.5	1.3
Sensor	28206	11.5	1.3	Service Pack	20008 C	11.5	1.3
Service Pack	20008 C	11.5	1.3	<b>2016</b>			
<b>2016</b>				OE Sensor: General Motors - 13598773			
OE Sensor: General Motors - 13598773				EZ-Sensor			
EZ-Sensor	33500 A, DB	11.5	1.3		34000	62	7
	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	20154	11.5	1.3
Sensor	20154	11.5	1.3	Service Pack	20008 C	11.5	1.3
Service Pack	20008 C	11.5	1.3	<b>Monte Carlo</b>			
<b>Monte Carlo</b>				<b>2000-2005</b>			
<b>2000-2005</b>				Sensor			
Sensor				INDIRECT <sup>D</sup>			

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Chevrolet (cont'd)</b>				<b>Chevrolet (cont'd)</b>			
<b>Silverado Series (cont'd)</b>				<b>Spark</b>			
<b>2007</b>				<b>2013-2015</b>			
OE Sensor: General Motors - 15114379, 15254101, 15825475				OE Sensor: General Motors - 12768826, 22854866			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic.....				Sensor.....			
	20158	62	7		28206	11.5	1.3
Sensor; Classic.....				Service Pack.....			
	20107	62	7		20008 <sup>C</sup>	11.5	1.3
Sensor; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic.....				<b>2016</b>			
	20153	11.5	1.3	OE Sensor: General Motors - 13598772			
Service Pack; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic.....				Sensor.....			
	20015	80	9		28206	11.5	1.3
Service Pack; Classic.....				Service Pack.....			
	20004	62	7		20008 <sup>C</sup>	11.5	1.3
Service Pack; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic.....				<b>SS</b>			
	20008 <sup>C</sup>	11.5	1.3	<b>2014-2016</b>			
<b>2008-2013</b>				OE Sensor: General Motors - 13598786, 20964159			
OE Sensor: General Motors - 15922396, 25920615				EZ-Sensor.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	28423	62	7
Sensor; W/Single Rear Wheels.....	20153	11.5	1.3	Service Pack.....	20004	62	7
Service Pack; W/Single Rear Wheels.....	20008 <sup>C</sup>	11.5	1.3	<b>SSR</b>			
<b>2014-2015</b>				<b>2006</b>			
OE Sensor: General Motors - 13581558				OE Sensor: General Motors - 25774006			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Sensor; OEM Part No. 25774006.....	20116	62	7
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack.....	20004	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>Suburban</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>2004</b>			
Sensor; W/Single Rear Wheels.....	28206	11.5	1.3	OE Sensor: General Motors - 15136883			
Service Pack; W/Single Rear Wheels.....	20008 <sup>C</sup>	11.5	1.3	EZ-Sensor.....			
<b>2016</b>							
OE Sensor: General Motors - 13581558							
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3				
Sensor; W/Single Rear Wheels.....	28206	11.5	1.3				
Service Pack; W/Single Rear Wheels.....	20008 <sup>C</sup>	11.5	1.3				
<b>Sonic</b>							
<b>2012-2015</b>							
OE Sensor: General Motors - 12768826, 13581558							
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3				
	33500 <sup>A, DB</sup>	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3				
Sensor.....	28206	11.5	1.3				
Service Pack.....	20008 <sup>C</sup>	11.5	1.3				
<b>2016</b>							
OE Sensor: General Motors - 13598772							
Sensor.....	28206	11.5	1.3				
Service Pack.....	20008 <sup>C</sup>	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Chevrolet (cont'd)</b>				<b>Chevrolet (cont'd)</b>			
<b>Suburban (cont'd)</b>				<b>Tahoe (cont'd)</b>			
<b>2007</b>				<b>2005-2006</b>			
OE Sensor: General Motors - 15825475, 25799331				OE Sensor: General Motors - 15114379			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem	20158	62	7	Sensor	20107	62	7
Sensor; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem	20153	11.5	1.3	Service Pack	20004	62	7
Service Pack; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem	20015	80	9	<b>2007</b>			
Service Pack; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem	20008 C	11.5	1.3	OE Sensor: General Motors - 15825475, 25799331			
<b>2008-2014</b>				EZ-Sensor			
OE Sensor: General Motors - 13581558, 13586335, 15922396, 25920615				33000 A			
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem	20158	62	7
Sensor	20153	11.5	1.3	Sensor; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem	20153	11.5	1.3
Service Pack	20008 C	11.5	1.3	Service Pack; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem	20015	80	9
<b>2014</b>				Service Pack; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem			
OE Sensor: General Motors - 13581558				20008 C			
Sensor	28206	11.5	1.3	<b>2008-2013</b>			
<b>2015</b>				OE Sensor: General Motors - 13586335, 15922396, 20923680, 25920615			
OE Sensor: General Motors - 13581558				EZ-Sensor			
EZ-Sensor	33000 A	11.5	1.3		33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28206	11.5	1.3	Sensor	20153	11.5	1.3
Service Pack	20008 C	11.5	1.3	Service Pack	20008 C	11.5	1.3
<b>2016</b>				<b>2014-2015</b>			
OE Sensor: General Motors - 13581558				OE Sensor: General Motors - 13581558			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28206	11.5	1.3	Sensor	28206	11.5	1.3
Service Pack	20008 C	11.5	1.3	Service Pack	20008 C	11.5	1.3
<b>Tahoe</b>				<b>2016</b>			
<b>2004</b>				OE Sensor: General Motors - 13581558			
OE Sensor: General Motors - 15136883				EZ-Sensor			
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	28206	11.5	1.3
Sensor	20115	62	7	Service Pack	20008 C	11.5	1.3
Service Pack	20004	62	7	<b>Trailblazer</b>			
<b>2004</b>				<b>2006-2009</b>			
OE Sensor: General Motors - 15136883				OE Sensor: General Motors - 25774006			
EZ-Sensor	33000 A	11.5	1.3	Sensor; OEM Part No. 25774006	20116	62	7
	33500 A, DB	11.5	1.3	Service Pack	20004	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3				
Sensor	20115	62	7				
Service Pack	20004	62	7				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Chevrolet (cont'd)</b>				<b>Chrysler</b>			
<b>Traverse</b>				<b>200</b>			
<b>2009-2015</b>				<b>2011</b>			
OE Sensor: General Motors - 22853741, 23445327, 25920615				OE Sensor: Chrysler - 68078861AA			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	(Wai) Wheel Arch Initiators.....	33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20153	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack.....	20008 <sup>C</sup>	11.5	1.3	Sensor.....	28308 <sup>F</sup>	11.5	1.3
<b>2016</b>				Service Pack; Fits Schrader Alum stem sensor.			
OE Sensor: General Motors - 13598771				Does not include stem.....			
Sensor.....	20153	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes	20013	58	6.5
Service Pack.....	20008 <sup>C</sup>	11.5	1.3	Stem Only.....	20020	58	6.5
<b>Trax</b>				Service Pack; Rubber Valve.....			
<b>2013-2015</b>				<b>2012</b>			
OE Sensor: General Motors - 13581558, 22854866				OE Sensor: Chrysler - 68078861AA			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	(Wai) Wheel Arch Initiators.....	33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28206	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack.....	20008 <sup>C</sup>	11.5	1.3	Sensor; Rubber Valve.....	28308 <sup>F</sup>	11.5	1.3
<b>2016</b>				Service Pack; Fits Schrader Alum stem sensor.			
OE Sensor: General Motors - 13598772				Does not include stem.....			
Sensor.....	28206	11.5	1.3 N.r	Service Pack; Fits Schrader Sensor; Includes	20013	58	6.5
		in-lbs		Stem Only.....	20020	58	6.5
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3 N.r	Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
		in-lbs		<b>2013-2014</b>			
<b>Uplander</b>				OE Sensor: Chrysler - 68078861AA			
<b>2008-2009</b>				EZ-Sensor.....			
OE Sensor: General Motors - 15268606				EZ-Sensor; Caution: Ez-sensor will not support			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	(Wai) Wheel Arch Initiators.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	28308 <sup>F</sup>	11.5	1.3
Sensor.....	20158	62	7	Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack.....	20004	62	7	<b>2015</b>			
<b>Volt</b>				OE Sensor: Chrysler - 68193586AC			
<b>2010</b>				Sensor.....			
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack.....	28586		
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		20043		
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>300</b>			
<b>2011-2015</b>				<b>2005-2006</b>			
OE Sensor: General Motors - 12768826, 20922900, 22854866				OE Sensor: Chrysler - 56053030AB			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28206	11.5	1.3	Sensor.....	28308 <sup>F</sup>	11.5	1.3
Service Pack.....	20008 <sup>C</sup>	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor.	20013	58	6.5
<b>2016</b>				Does not include stem.....			
OE Sensor: General Motors - 13598772				Service Pack; Fits Schrader Sensor; Includes			
Sensor.....	28206	11.5	1.3	Stem Only.....	20020	58	6.5
Service Pack.....	20008 <sup>C</sup>	11.5	1.3	Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
				Service Pack; W/Siemens Sensor.....			
				20030			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200 F-Supercedes the 20066

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Chrysler (cont'd)</b>				<b>Chrysler (cont'd)</b>			
<b>300 (cont'd)</b>				<b>300 (cont'd)</b>			
<b>2007</b>				<b>2012</b>			
OE Sensor: Chrysler - 56053030AB, 68001696AA				OE Sensor: Chrysler - 56029398AB			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33100 A	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor; W/Rubber Stem Snap-in Sensor.....	20398	11.5	1.3
Sensor; Can also use 28155 until depleted.....	28434 E	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Sensor; Use until depleted-superseded by 20066.	28308 F	11.5	1.3	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5	Service Pack; W/Metal Stem Clamp-in Sensor; Does Not Include Stem.....	20016	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; W/Rubber Stem Snap-in Sensor....	20018 C	11.5	1.3
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2013-2015</b>			
Service Pack; W/Siemens Sensor.....	20030	71	8	OE Sensor: Chrysler - 56029398AB			
<b>2008</b>				EZ-Sensor.....	33200 A	11.5	1.3
OE Sensor: Chrysler - 68001698AB					33500 A, DB	11.5	1.3
EZ-Sensor.....	33100 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33200 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor.....	20398	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; W/Steel Wheels.....	20018 C	11.5	1.3	<b>2016</b>			
Sensor.....	28434 E	11.5	1.3	OE Sensor: Chrysler - 56029398AB			
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	20398	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	71	8	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
<b>2009-2010</b>				<b>300M</b>			
OE Sensor: Chrysler - 56029400AC				<b>2002-2004</b>			
EZ-Sensor.....	33200 A	11.5	1.3	OE Sensor: Chrysler - 52088990AC			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33100 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33200 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.....	28291	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Does Not Include Stem.....	20016	58	6.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Sensor.....	20028 B	35	4
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; W/Schrader Sensor.....	20003	35	4
<b>2010</b>				Service Pack; W/Siemens Sensor.....	20030	35	4
OE Sensor: Chrysler - 56029398AB				<b>Aspen</b>			
Sensor.....	20398	11.5	1.3	<b>2007-2011</b>			
<b>2011</b>				OE Sensor: Chrysler - 56029465AB, 56053036AA			
OE Sensor: Chrysler - 56029398AB				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor; Use 33500 for Wheel Arc Initiator systems.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	28308 F	11.5	1.3
Sensor.....	20398	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
				Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Service Pack; W/Siemens Sensor.....	20030	71	8

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200  
E-Supercedes the 28155 F-Supercedes the 20066

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Chrysler (cont'd)</b>				<b>Chrysler (cont'd)</b>			
<b>Concorde</b>				<b>Intrepid</b>			
<b>2002-2004</b>				<b>2002</b>			
OE Sensor: Chrysler - 52088990AC				OE Sensor: Chrysler - 52088990AC			
EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3
	33200 <sup>A</sup>	11.5	1.3		33200 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	20028 <sup>B</sup>	35	4	Sensor.....	20028 <sup>B</sup>	35	4
Service Pack; W/Schrader Sensor.....	20003	35	4	Service Pack; W/Schrader Sensor.....	20003	35	4
Service Pack; W/Siemens Sensor.....	20030	35	4	Service Pack; W/Siemens Sensor.....	20030	35	4
<b>Crossfire</b>				<b>2003-2004</b>			
<b>2004</b>				OE Sensor: Chrysler - 52088990AC			
OE Sensor: Chrysler - 52088990AD				EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3
EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3		33200 <sup>A</sup>	11.5	1.3
	33200 <sup>A</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	20028 <sup>B</sup>	35	4
Sensor.....	20028 <sup>B</sup>	35	4	Service Pack; W/Schrader Sensor.....	20003	35	4
Service Pack; W/Schrader Sensor.....	20003	35	4	Service Pack; W/Siemens Sensor.....	20030	35	4
Service Pack; W/Siemens Sensor.....	20030	35	4	<b>Pacifica</b>			
<b>2005</b>				<b>2003</b>			
OE Sensor: Chrysler - 5142340AA, 52088990AC				EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3
EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
	33200 <sup>A</sup>	11.5	1.3	<b>2004</b>			
	33500 <sup>A, DB</sup>	11.5	1.3	OE Sensor: Chrysler - 5127335AB, 52088990AC			
EZ-Sensor; W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by				EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3		33200 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20028 <sup>B</sup>	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
	28308 <sup>F</sup>	11.5	1.3	Sensor; OEM Part No. 04727392AD.....	20335	71	8
Service Pack; exc Siemens OE Sensor; Service Pack contains cap, core, grommet, and nut.....	20003	35	4	Sensor; OEM Part No. 52088990AC.....	20028 <sup>B</sup>	35	4
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5	Service Pack; W/Schrader Sensor.....	20003	35	4
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; W/Siemens Sensor.....	20030	71	8
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>2005</b>			
<b>2006-2008</b>				OE Sensor: Chrysler - 5127335AB			
OE Sensor: Chrysler - 5096808AA				EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3	Sensor.....	20335	71	8
	33200 <sup>A</sup>	11.5	1.3	Service Pack.....	20030	71	8
	33500 <sup>A, DB</sup>	11.5	1.3	<b>2006-2007</b>			
EZ-Sensor; W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by				OE Sensor: Chrysler - 56053030AB, 68001696AA			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
Sensor.....	20028 <sup>B</sup>	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/Schrader Sensor.....	20003	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	35	4	Sensor.....	28308 <sup>F</sup>	11.5	1.3
<b>2009-2011</b>				Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5
EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
				Service Pack; W/Siemens Sensor.....	20030	71	8

A-Programming Tool Required    B-Magnet may be Required to Activate Sensor    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200  
F-Supercedes the 20066

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Chrysler (cont'd)</b>				<b>Chrysler (cont'd)</b>			
<b>Pacifica (cont'd)</b>				<b>Sebring</b>			
<b>2008</b>				<b>2007-2009</b>			
OE Sensor: Chrysler - 68001696AA				OE Sensor: Chrysler - 68001696AA, 68001696AB			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28308 F	11.5	1.3	Sensor.....	28308 F	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	71	8	Service Pack; W/Siemens Sensor.....	20030	71	8
<b>Prowler</b>				<b>2008-2009</b>			
<b>2001</b>				<b>2010</b>			
OE Sensor: Chrysler - 4815132AB				OE Sensor: Chrysler - 68078861AA			
Sensor.....	28004	35	4	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; W/Black Sensor Body.....	20012	35	4	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
Service Pack; W/Red Sensor Body.....	20003	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2002</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
OE Sensor: Chrysler - 52088990AC				Sensor.....	28308 F	11.5	1.3
EZ-Sensor.....	33100 A	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5
	33200 A	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
	33500 A, DB	11.5	1.3	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>Town &amp; Country</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2002-2003</b>			
Sensor.....	20028 B	35	4	OE Sensor: Chrysler - 52088990AC			
Service Pack; W/Schrader Sensor.....	20003	35	4	EZ-Sensor.....	33100 A	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	35	4		33200 A	11.5	1.3
<b>PT Cruiser</b>					33500 A, DB	11.5	1.3
<b>2008-2010</b>				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: Chrysler - 68001696AA, 68001696AB				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3	Sensor.....	20028 B	35	4
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	Service Pack.....	20003	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2004-2005</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	OE Sensor: Chrysler - 5127335AB			
Sensor.....	28308 F	11.5	1.3	Sensor.....	20335	71	8
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5	Service Pack.....	20030	71	8
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	<b>2006-2007</b>			
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	OE Sensor: Chrysler - 56053030AB, 68001696AA			
Service Pack; W/Siemens Sensor.....	20030	71	8	EZ-Sensor.....	33500 A, DB	11.5	1.3
				EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Sensor.....	28308 F	11.5	1.3
				Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5
				Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
				Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Service Pack; W/Siemens Sensor.....	20030	71	8

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200  
F-Supercedes the 20066

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Chrysler (cont'd)</b>				<b>Chrysler (cont'd)</b>			
<b>Town &amp; Country (cont'd)</b>				<b>Voyager</b>			
<b>2008</b>				<b>2002-2003</b>			
OE Sensor: Chrysler - 68001696AA, 68001698AB				OE Sensor: Chrysler - 52088990AC			
EZ-Sensor.....	33100 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....				EZ-Sensor Service Pack; Rubber Valve.....			
	33000 A	11.5	1.3	Sensor.....	20028 B	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20003	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3				
Sensor; Can also use 20066 until depleted.....	28308 F	11.5	1.3				
Sensor; Can also use 28155 until depleted.....	28434 E	11.5	1.3				
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5				
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5				
Service Pack; Rubber Valve.....	20018 C	11.5	1.3				
Service Pack; W/Siemens Sensor.....	20030	71	8				
<b>2009-2010</b>				<b>Dodge</b>			
OE Sensor: Chrysler - 68001698AB				<b>Avenger</b>			
EZ-Sensor.....				<b>2007</b>			
	33100 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33200 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2008-2009</b>			
Sensor.....	28434 E	11.5	1.3	OE Sensor: Chrysler - 68001696AA, 68001696AB			
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/Siemens Sensor.....	20030	71	8	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Sensor.....	28308 F	11.5	1.3
				Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5
				Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
				Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Service Pack; W/Siemens Sensor.....	20030	71	8
				<b>2010-2012</b>			
				OE Sensor: Chrysler - 68078861AA			
				EZ-Sensor.....	33500 A, DB	11.5	1.3
				EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Sensor.....	28308 F	11.5	1.3
				Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5
				Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
				Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				<b>2013-2014</b>			
				OE Sensor: Chrysler - 68078861AA			
				EZ-Sensor.....	33500 A, DB	11.5	1.3
				EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Sensor.....	28308 F	11.5	1.3
				Service Pack; Rubber Valve.....	20018 C	11.5	1.3
<b>2011-2014</b>							
OE Sensor: Chrysler - 56029398AB							
EZ-Sensor.....	33100 A	11.5	1.3				
	33200 A	11.5	1.3				
	33500 A, DB	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3				
Sensor.....	20398	11.5	1.3				
Service Pack; Rubber Valve.....	20018 C	11.5	1.3				
<b>2015</b>							
OE Sensor: Chrysler - 56029398AB, 68241067AB							
EZ-Sensor.....	33200 A	11.5	1.3				
	33500 A, DB	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3				
Sensor.....	20398	11.5	1.3				
Service Pack; Rubber Valve.....	20018 C	11.5	1.3				
<b>2016</b>							
OE Sensor: Chrysler - 68241067AB							
EZ-Sensor.....	33500 A, DB	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3				
Sensor.....	20398	11.5	1.3				
Service Pack; Rubber Valve.....	20018 C	11.5	1.3				

A-Programming Tool Required    B-Magnet may be Required to Activate Sensor    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200  
E-Supercedes the 28155    F-Supercedes the 20066



Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Dodge (cont'd)</b>				<b>Dodge (cont'd)</b>			
<b>Caliber</b>				<b>Challenger</b>			
<b>2007-2010</b>				<b>2008</b>			
OE Sensor: Chrysler - 68001696AB, 68078861AA				OE Sensor: Chrysler - 56029400AB, 56029481AB			
EZ-Sensor: . . . . .	33500 A, DB	11.5	1.3	EZ-Sensor: . . . . .	33100 A	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support					33200 A	11.5	1.3
(Wai) Wheel Arch Initiators: . . . . .	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve: . . . . .	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve: . . . . .	34000	62	7
EZ-Sensor Service Pack; Rubber Valve: . . . . .	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve: . . . . .	20018 C	11.5	1.3
Sensor: . . . . .	28308 F	11.5	1.3	Sensor; OEM No. 56029400AB: . . . . .	28291	58	6.5
Service Pack; Fits Schrader Alum stem sensor.				Sensor; OEM No. 56029481AB; 433 MHz Sensor;			
Does not include stem: . . . . .	20013	58	6.5	Rubber Valve: . . . . .	28434 E	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes				Service Pack; Does Not Include Stem: . . . . .	20016	58	6.5
Stem Only: . . . . .	20020	58	6.5	Service Pack; Fits Schrader Sensor; Includes			
Service Pack; Rubber Valve: . . . . .	20018 C	11.5	1.3	Stem Only: . . . . .	20020	58	6.5
Service Pack; W/Siemens Sensor: . . . . .	20030	71	8	Service Pack; Rubber Valve: . . . . .	20018 C	11.5	1.3
<b>2011-2012</b>				<b>2009</b>			
OE Sensor: Chrysler - 68078861AA				OE Sensor: Chrysler - 56029400AC			
EZ-Sensor: . . . . .	33500 A, DB	11.5	1.3	EZ-Sensor: . . . . .	33200 A	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support					33500 A, DB	11.5	1.3
(Wai) Wheel Arch Initiators: . . . . .	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve: . . . . .	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve: . . . . .	34000	62	7	EZ-Sensor Service Pack; Rubber Valve: . . . . .	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve: . . . . .	20018 C	11.5	1.3	Sensor: . . . . .	28291	58	6.5
Sensor: . . . . .	28308 F	11.5	1.3	Service Pack; Does Not Include Stem: . . . . .	20016	58	6.5
Service Pack; Fits Schrader Alum stem sensor.				Service Pack; Fits Schrader Sensor; Includes			
Does not include stem: . . . . .	20013	58	6.5	Stem Only: . . . . .	20020	58	6.5
Service Pack; Fits Schrader Sensor; Includes				<b>2010-2012</b>			
Stem Only: . . . . .	20020	58	6.5	OE Sensor: Chrysler - 56029398AA, 56029398AB, 56029400AC,			
Service Pack; Rubber Valve: . . . . .	20018 C	11.5	1.3	56029400AD			
<b>Caravan</b>				EZ-Sensor: . . . . .	33200 A	11.5	1.3
<b>2002-2003</b>					33500 A, DB	11.5	1.3
OE Sensor: Chrysler - 52088990AC				EZ-Sensor Service Pack; Aluminium Valve: . . . . .	34000	62	7
EZ-Sensor: . . . . .	33100 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve: . . . . .	20018 C	11.5	1.3
	33200 A	11.5	1.3	Sensor; W/Metal Stem Clamp-in Sensor: . . . . .	28291	58	6.5
	33500 A, DB	11.5	1.3	Sensor; W/Rubber Stem Snap-in Sensor: . . . . .	20398	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve: . . . . .	34000	62	7	Service Pack; Fits Schrader Sensor; Includes			
EZ-Sensor Service Pack; Rubber Valve: . . . . .	20018 C	11.5	1.3	Stem Only: . . . . .	20020	58	6.5
Sensor: . . . . .	20028 B	35	4	Service Pack; Rubber Valve: . . . . .	20018 C	11.5	1.3
Service Pack: . . . . .	20003	35	4	Service Pack; W/Metal Stem Clamp-in Sensor;			
<b>2004-2005</b>				Does Not Include Stem: . . . . .	20016	58	6.5
OE Sensor: Chrysler - 5127335AB				<b>2013-2015</b>			
Sensor: . . . . .	20335	71	8	OE Sensor: Chrysler - 56029398AB			
Service Pack: . . . . .	20030	71	8	EZ-Sensor: . . . . .	33200 A	11.5	1.3
<b>2006-2007</b>					33500 A, DB	11.5	1.3
OE Sensor: Chrysler - 68001696AA				EZ-Sensor Service Pack; Aluminium Valve: . . . . .	34000	62	7
EZ-Sensor: . . . . .	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve: . . . . .	20018 C	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support				Sensor; W/Rubber Stem Snap-in Sensor: . . . . .	20398	11.5	1.3
(Wai) Wheel Arch Initiators: . . . . .	33000 A	11.5	1.3	Service Pack; W/Rubber Stem Snap-in Sensor: . . . . .	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve: . . . . .	34000	62	7	<b>2016</b>			
EZ-Sensor Service Pack; Rubber Valve: . . . . .	20018 C	11.5	1.3	OE Sensor: Chrysler - 56029398AB			
Sensor: . . . . .	28308 F	11.5	1.3	EZ-Sensor: . . . . .	33500 A, DB	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor.				EZ-Sensor Service Pack; Aluminium Valve: . . . . .	34000	62	7
Does not include stem: . . . . .	20013	58	6.5	EZ-Sensor Service Pack; Rubber Valve: . . . . .	20018 C	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes				Sensor; W/Rubber Stem Snap-in Sensor: . . . . .	20398	11.5	1.3
Stem Only: . . . . .	20020	58	6.5	Service Pack; W/Rubber Stem Snap-in Sensor: . . . . .	20018 C	11.5	1.3
Service Pack; Rubber Valve: . . . . .	20018 C	11.5	1.3				
Service Pack; W/Siemens Sensor: . . . . .	20030	71	8				

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200  
E-Supercedes the 28155 F-Supercedes the 20066



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Dodge (cont'd)</b>				<b>Dodge (cont'd)</b>			
<b>Charger</b>				<b>Charger (cont'd)</b>			
<b>2005</b>				<b>2011</b>			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Chrysler - 56029398AB			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3		33500 A, DB	11.5	1.3
<b>2006-2007</b>				<b>2012-2015</b>			
OE Sensor: Chrysler - 68001696AA				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	Sensor; W/Rubber Stem Snap-in Sensor.....	20398	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2016</b>			
Sensor.....	28308 F	11.5	1.3	OE Sensor: Chrysler - 56029398AB			
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	71	8	Sensor.....	20398	11.5	1.3
<b>2008</b>				<b>2012-2015</b>			
OE Sensor: Chrysler - 68001698AB				Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor.....	33100 A	11.5	1.3	<b>2016</b>			
	33200 A	11.5	1.3	OE Sensor: Chrysler - 56029398AB			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28434 E	11.5	1.3	Sensor.....	20398	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	<b>Dakota</b>			
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2008-2010</b>			
Service Pack; W/Siemens Sensor.....	20030	71	8	OE Sensor: Chrysler - 56029319AA, 56029319AB			
<b>2009</b>				EZ-Sensor.....	33500 A, DB	11.5	1.3
OE Sensor: Chrysler - 56029400AC				EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28461 G	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5
Sensor.....	28291	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Service Pack; Does Not Include Stem.....	20016	58	6.5	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	<b>2011</b>			
<b>2010</b>				EZ-Sensor.....	33500 A, DB	11.5	1.3
OE Sensor: Chrysler - 56029398AA, 56029400AC				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
	33500 A, DB	11.5	1.3	<b>Dart</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2013-2015</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	OE Sensor: Chrysler - 68193586AA, 68193586AB, 68193586AC			
Sensor; W/Metal Stem Clamp-in Sensor.....	28291	58	6.5	Sensor.....	28586		
Sensor; W/Rubber Stem Snap-in Sensor.....	20398	11.5	1.3	Service Pack.....	20043		
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5				
Service Pack; Rubber Valve.....	20018 C	11.5	1.3				
Service Pack; W/Metal Stem Clamp-in Sensor; Does Not Include Stem.....	20016	58	6.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200 E-Supercedes the 28155 F-Supercedes the 20066 G-Supercedes the 28154

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Dodge (cont'd)</b>				<b>Dodge (cont'd)</b>			
<b>Durango</b>				<b>Grand Caravan</b>			
<b>2007</b>				<b>2002-2003</b>			
OE Sensor: Chrysler - 56053036AA				OE Sensor: Chrysler - 52088990AC			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33100 A	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support					33200 A	11.5	1.3
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28308 F	11.5	1.3	Sensor.....	20028 B	35	4
Service Pack; Fits Schrader Alum stem sensor.				Service Pack.....	20003	35	4
Does not include stem.....	20013	58	6.5	<b>2004-2005</b>			
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	OE Sensor: Chrysler - 5127335AB			
Service Pack; W/Schrader Sensor; Includes Stem				Sensor.....	20335	71	8
Only.....	20020	58	6.5	Service Pack.....	20030	71	8
Service Pack; W/Siemens Sensor.....	20030	71	8	<b>2006-2007</b>			
<b>2008</b>				OE Sensor: Chrysler - 68001696AA			
OE Sensor: Chrysler - 56053036AA				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support			
EZ-Sensor; Caution: Ez-sensor will not support				(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	28308 F	11.5	1.3
Sensor.....	28308 F	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor.			
Service Pack; Fits Schrader Alum stem sensor.				Does not include stem.....	20013	58	6.5
Does not include stem.....	20013	58	6.5	Service Pack; Fits Schrader Sensor; Includes			
Service Pack; Fits Schrader Sensor; Includes				Stem Only.....	20020	58	6.5
Stem Only.....	20020	58	6.5	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	71	8
Service Pack; W/Siemens Sensor.....	20030	71	8	<b>2008</b>			
<b>2009</b>				OE Sensor: Chrysler - 68001698AB			
OE Sensor: Chrysler - 56029465AB				EZ-Sensor.....	33100 A	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3		33200 A	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support					33500 A, DB	11.5	1.3
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	28434 E	11.5	1.3
Sensor.....	28308 F	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor.			
Service Pack; Fits Schrader Alum stem sensor.				Does not include stem.....	20013	58	6.5
Does not include stem.....	20013	58	6.5	Service Pack; Fits Schrader Sensor; Includes			
Service Pack; Fits Schrader Sensor; Includes				Stem Only.....	20020	58	6.5
Stem Only.....	20020	58	6.5	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	71	8
Service Pack; W/Siemens Sensor.....	20030	71	8	<b>2009-2010</b>			
<b>2011-2015</b>				OE Sensor: Chrysler - 68001698AB			
OE Sensor: Chrysler - 56029398AB				EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28434 E	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor.			
Sensor.....	20398	11.5	1.3	Does not include stem.....	20013	58	6.5
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes			
				Stem Only.....	20020	58	6.5
				Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Service Pack; W/Siemens Sensor.....	20030	71	8

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200  
E-Supercedes the 28155 F-Supercedes the 20066

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Dodge (cont'd)</b>				<b>Dodge (cont'd)</b>			
<b>Grand Caravan (cont'd)</b>				<b>Journey (cont'd)</b>			
<b>2011-2015</b>				<b>2011-2015</b>			
OE Sensor: Chrysler - 56029398AB				OE Sensor: Chrysler - 56029398AA, 56029398AB			
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	20398	11.5	1.3	Sensor.....	20398	11.5	1.3
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
<b>2016</b>				<b>2016</b>			
OE Sensor: Chrysler - 68241067AB				OE Sensor: Chrysler - 68241067AB			
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	20398	11.5	1.3	Sensor.....	20398	11.5	1.3
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
<b>Intrepid</b>				<b>Magnum</b>			
<b>2002-2004</b>				<b>2005-2007</b>			
OE Sensor: Chrysler - 52088990AC				OE Sensor: Chrysler - 68001696AA			
EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
	33200 <sup>A</sup>	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	28308 <sup>F</sup>	11.5	1.3
Sensor.....	20028 <sup>B</sup>	35	4	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5
Service Pack.....	20003	35	4	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
				Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
				Service Pack; W/Siemens Sensor.....	20030	71	8
<b>Journey</b>				<b>2008</b>			
<b>2009</b>				OE Sensor: Chrysler - 68001698AA			
OE Sensor: Chrysler - 68001698AB				EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3
EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3		33200 <sup>A</sup>	11.5	1.3
	33200 <sup>A</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	28434 <sup>E</sup>	11.5	1.3
Sensor.....	28434 <sup>E</sup>	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	71	8
Service Pack; W/Siemens Sensor.....	20030	71	8	<b>2009-2011</b>			
<b>2010</b>				EZ-Sensor.....			
OE Sensor: Chrysler - 56029398AA, 68001698AB					33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33200 <sup>A</sup>	11.5	1.3	Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3				
Sensor; OEM No. 56029398AA; Rubber Valve....	20398	11.5	1.3				
Sensor; Replaces clamp-in Sensor.....	28434 <sup>E</sup>	11.5	1.3				
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5				
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5				
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3				
Service Pack; W/Siemens Sensor.....	20030	71	8				

A-Programming Tool Required    B-Magnet may be Required to Activate Sensor    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200  
E-Supercedes the 28155    F-Supercedes the 20066

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Dodge (cont'd)</b>				<b>Dodge (cont'd)</b>			
<b>Nitro</b>				<b>Ram Series</b>			
<b>2007-2008</b>				<b>2008</b>			
OE Sensor: Chrysler - 56053036AA				OE Sensor: Chrysler - 56029319AA			
EZ-Sensor: .....	33500 A, DB	11.5	1.3	EZ-Sensor: .....	33500 A, DB	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators: .....	33000 A	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators: .....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve: .....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve: .....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve: .....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve: .....	20018 C	11.5	1.3
Sensor: .....	28308 F	11.5	1.3	Sensor: .....	28461 G	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem: .....	20013	58	6.5	Service Pack; Fits Schrader Alum stem sensor. Does not include stem: .....	20013	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only: .....	20020	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only: .....	20020	58	6.5
Service Pack; Rubber Valve: .....	20018 C	11.5	1.3	Service Pack; Rubber Valve: .....	20018 C	11.5	1.3
Service Pack; W/Siemens Sensor: .....	20030	71	8	<b>2009</b>			
<b>2009-2011</b>				OE Sensor: Chrysler - 56029359AB			
OE Sensor: Chrysler - 56029465AB, 56029465AC				EZ-Sensor: .....	33000 A		
EZ-Sensor: .....	33500 A, DB	11.5	1.3	EZ-Sensor: .....	33100 A	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators: .....	33000 A	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators: .....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve: .....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve: .....	33200 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve: .....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve: .....	34000	62	7
Sensor: .....	28308 F	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve: .....	20018 C	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem: .....	20013	58	6.5	Sensor: .....	28434 E	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only: .....	20020	58	6.5	Sensor: .....	28461 G	11.5	1.3
Service Pack; Rubber Valve: .....	20018 C	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem: .....	20013	58	6.5
<b>2012</b>				Service Pack; Fits Schrader Sensor; Includes Stem Only: .....	20020	58	6.5
EZ-Sensor: .....	33500 A, DB	11.5	1.3	Service Pack; Rubber Valve: .....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve: .....	34000	62	7	<b>2010</b>			
EZ-Sensor Service Pack; Rubber Valve: .....	20018 C	11.5	1.3	OE Sensor: Chrysler - 56029359AB, 56029398AA			
<b>Ram 4500</b>				EZ-Sensor: .....			
<b>2010</b>				EZ-Sensor: .....			
OE Sensor: Chrysler - 56029359AB, 56029398AA				EZ-Sensor: .....	33100 A	11.5	1.3
EZ-Sensor: .....	33200 A	11.5	1.3	EZ-Sensor: .....	33200 A	11.5	1.3
EZ-Sensor: .....	33500 A, DB	11.5	1.3	EZ-Sensor: .....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve: .....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve: .....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve: .....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve: .....	20018 C	11.5	1.3
Sensor; W/Rubber Stem Snap-in Sensor: .....	20398	11.5	1.3	Sensor; W/Rubber Stem Snap-in Sensor: .....	20398	11.5	1.3
Sensor: .....	28434 E	11.5	1.3	Sensor: .....	28434 E	11.5	1.3
Service Pack; W/Rubber Stem Snap-in Sensor: .....	20018 C	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem: .....	20013	58	6.5
<b>Ram 5500</b>				Service Pack; Fits Schrader Sensor; Includes Stem Only: .....			
<b>2010</b>				Service Pack; Fits Schrader Sensor; Includes Stem Only: .....			
OE Sensor: Chrysler - 56029359AB, 56029398AA				Service Pack; Rubber Valve: .....	20020	58	6.5
EZ-Sensor: .....	33200 A	11.5	1.3	Service Pack; Rubber Valve: .....	20018 C	11.5	1.3
EZ-Sensor: .....	33500 A, DB	11.5	1.3	Service Pack; W/Rubber Stem Snap-in Sensor: .....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve: .....	34000	62	7	<b>2011-2013</b>			
EZ-Sensor Service Pack; Rubber Valve: .....	20018 C	11.5	1.3	EZ-Sensor: .....	33100 A	11.5	1.3
Sensor; W/Rubber Stem Snap-in Sensor: .....	20398	11.5	1.3	EZ-Sensor: .....	33500 A, DB	11.5	1.3
Sensor: .....	28434 E	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve: .....	34000	62	7
Service Pack; W/Rubber Stem Snap-in Sensor: .....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve: .....	20018 C	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200 E-Supersedes the 28155 F-Supersedes the 20066 G-Supersedes the 28154

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Dodge (cont'd)</b>				<b>Dodge (cont'd)</b>			
<b>Sprinter</b>				<b>Viper (cont'd)</b>			
<b>2007-2009</b>				<b>2014-2015</b>			
OE Sensor: Chrysler - 68006771AA, 68038945AA				OE Sensor: Chrysler - 56029400AD			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....				EZ-Sensor.....			
	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	20089	53	6	Sensor; W/Metal Stem Clamp-in Sensor.....	28291	58	6.5
Service Pack; Includes Valve.....	20036	53	6	Service Pack; W/Metal Stem Clamp-in Sensor; Does Not Include Stem.....	20016	58	6.5
<b>Stratus</b>				<b>2016</b>			
<b>2007</b>				OE Sensor: Chrysler - 56029400AD			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
<b>Viper</b>				Sensor; W/Metal Stem Clamp-in Sensor.....			
<b>2003-2006</b>				Service Pack; W/Metal Stem Clamp-in Sensor; Does Not Include Stem.....			
OE Sensor: Chrysler - 52088990AC				20016			
EZ-Sensor.....	33100 A	11.5	1.3	OE Sensor: Chrysler - 56029400AD			
	33200 A	11.5	1.3	EZ-Sensor.....			
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor; W/Metal Stem Clamp-in Sensor.....			
Sensor.....	20028 B	35	4	Service Pack; W/Metal Stem Clamp-in Sensor; Does Not Include Stem.....			
Service Pack.....	20003	35	4	20016			
<b>2007</b>				<b>Ferrari</b>			
OE Sensor: Chrysler - 52088990AC				<b>612 Scaglietti</b>			
EZ-Sensor.....	33100 A	11.5	1.3	<b>2005-2009</b>			
	33500 A, DB	11.5	1.3	OE Sensor: Ferrari - 224549			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor; Includes Transmitter Only.....			
<b>2008-2010</b>				Service Pack; Does Not Include Valve.....			
OE Sensor: Chrysler - 52088990AC				Service Pack; W/43mm Silver Insert.....			
EZ-Sensor.....	33100 A	11.5	1.3	Service Pack; W/48mm Green Insert.....			
	33200 A	11.5	1.3	Service Pack; W/49mm Black Insert.....			
	33500 A, DB	11.5	1.3	Service Pack; W/51mm Orange Insert.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	20077			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	20023			
Sensor.....	20028 B	35	4	20037			
Service Pack.....	20003	35	4	20038			
<b>2011</b>				20039			
OE Sensor: Chrysler - 52088990AC				20040			
EZ-Sensor.....	33100 A	11.5	1.3	<b>Enzo</b>			
	33500 A, DB	11.5	1.3	<b>2003-2004</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	OE Sensor: Ferrari - 224551			
<b>2012-2013</b>				Sensor; Includes Transmitter Only.....			
OE Sensor: Chrysler - 56029400AD				Service Pack; Does Not Include Valve.....			
EZ-Sensor.....	33200 A	11.5	1.3	Service Pack; W/43mm Silver Insert.....			
	33500 A, DB	11.5	1.3	Service Pack; W/48mm Green Insert.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/49mm Black Insert.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; W/51mm Orange Insert.....			
Sensor; W/Metal Stem Clamp-in Sensor.....	28291	58	6.5	20084			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	20023			
Service Pack; W/Metal Stem Clamp-in Sensor; Does Not Include Stem.....	20016	58	6.5	20037			
				20038			
				20039			
				20040			
				<b>F430</b>			
				<b>2006-2009</b>			
				OE Sensor: Ferrari - 224549			
				Sensor; Includes Transmitter Only.....			
				Service Pack; Does Not Include Valve.....			
				Service Pack; W/43mm Silver Insert.....			
				Service Pack; W/48mm Green Insert.....			
				Service Pack; W/49mm Black Insert.....			
				Service Pack; W/51mm Orange Insert.....			
				20077			
				20023			
				20037			
				20038			
				20039			
				20040			
				<b>FF</b>			
				<b>2011</b>			
				OE Sensor: Original Equipment Manufacturer - 4F0 907 275			
				Sensor.....			
				20078			

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Ferrari (cont'd)</b>				<b>Ford (cont'd)</b>			
<b>LaFerrari</b>				<b>Crown Victoria</b>			
<b>2014</b>				<b>2006-2011</b>			
OE Sensor: Original Equipment Manufacturer - 4F0 907 275				OE Sensor: Ford Motor Company - 6F2Z1A189A			
Sensor	20078			EZ-Sensor	33000 A	11.5	1.3
<b>Maranello</b>				EZ-Sensor			
<b>2001-2005</b>				33500 A, DB			
OE Sensor: Ferrari - 224549				34000			
Sensor; Includes Transmitter Only	20077	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; Does Not Include Valve	20023	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack; W/43mm Silver Insert	20037	35	4	Sensor	28385	27	3
Service Pack; W/48mm Green Insert	20038	35	4	Sensor Clip	22100		
Service Pack; W/49mm Black Insert	20039	35	4	Sensor Cradle	22101		
Service Pack; W/51mm Orange Insert	20040	35	4	Universal Band	22102		
<b>Fiat</b>				<b>Edge</b>			
<b>500</b>				<b>2007-2008</b>			
<b>2012-2015</b>				OE Sensor: Ford Motor Company - 6F2Z1A189A, 7L1Z1A189A			
OE Sensor: Chrysler - 56029398AB, 68241067AB				EZ-Sensor			
EZ-Sensor	33200 A	11.5	1.3	33000 A	11.5	1.3	
	33500 A, DB	11.5	1.3	33500 A, DB	11.5	1.3	
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	20398	11.5	1.3	Sensor; W/Chrome Plated Almm. Wheels	28385	27	3
Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor; W/O Chrome Plated Almm. Wheels	28390	27	3
<b>2016</b>				Sensor Clip			
OE Sensor: Chrysler - 68241067AB				22100			
EZ-Sensor	33500 A, DB	11.5	1.3	Sensor Cradle	22101		
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Universal Band	22102		
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>2009-2010</b>			
Sensor	20398	11.5	1.3	OE Sensor: Ford Motor Company - 7L1Z1A189A			
Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor			
<b>Ford</b>				33000 A			
<b>C-Max</b>				33500 A, DB			
<b>2012-2015</b>				34000			
OE Sensor: Ford Motor Company - DE8T-1A180-AA, DE8T-1A180AA				EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor	28390	27	3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor Clip	22100		
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor Cradle	22101		
Sensor	20315	11.5	1.3	Universal Band	22102		
Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>2011-2014</b>			
<b>2016</b>				OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA			
OE Sensor: Ford Motor Company - DE8T-1A180AA				EZ-Sensor			
EZ-Sensor	33500 A, DB	11.5	1.3	33000 A	11.5	1.3	
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	33500 A, DB	11.5	1.3	
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	20315	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	20315	11.5	1.3
<b>Ford</b>				Service Pack; Rubber Valve			
<b>C-Max</b>				20018 C			
<b>2012-2015</b>				<b>2015-2016</b>			
OE Sensor: Ford Motor Company - DE8T-1A180-AA, DE8T-1A180AA				OE Sensor: Ford Motor Company - F2GT-1A180-AB			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor			
	33500 A, DB	11.5	1.3	33500 A, DB			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	34000			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve			
Sensor	20315	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve			
Service Pack; Rubber Valve	20018 C	11.5	1.3	20018 C			
<b>2016</b>				Sensor			
OE Sensor: Ford Motor Company - DE8T-1A180AA				20280			
EZ-Sensor	33500 A, DB	11.5	1.3	Service Pack; Rubber Valve			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	20018 C			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3				
Sensor	20315	11.5	1.3				
Service Pack; Rubber Valve	20018 C	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Ford (cont'd)</b>				<b>Ford (cont'd)</b>			
<b>Escape</b>				<b>E-Series Van</b>			
<b>2005</b>				<b>2007</b>			
OE Sensor: Ford Motor Company - 6F2Z1A189A				OE Sensor: Ford Motor Company - 6F2Z1A189A; Original Equipment			
EZ-Sensor..... 33000 <sup>A</sup> 11.5 1.3				Manufacturer - 8C2Z1A189A			
EZ-Sensor..... 33500 <sup>A, DB</sup> 11.5 1.3				EZ-Sensor..... 33000 <sup>A</sup> 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				EZ-Sensor..... 33500 <sup>A, DB</sup> 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
Sensor; Oct. 3, 2005 & Newer..... 28385 27 3				EZ-Sensor Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3			
Sensor Clip..... 22100				Sensor..... 28385 27 3			
Sensor Cradle..... 22101				Sensor..... 28395 27 3			
Universal Band..... 22102				Sensor Clip..... 22100			
<b>2006-2008</b>				Sensor Cradle..... 22101			
OE Sensor: Ford Motor Company - 6F2Z1A189A				Universal Band..... 22102			
EZ-Sensor..... 33000 <sup>A</sup> 11.5 1.3				<b>2008-2009</b>			
EZ-Sensor..... 33500 <sup>A, DB</sup> 11.5 1.3				OE Sensor: Ford Motor Company - 8C2Z1A189A; Original Equipment			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				Manufacturer - 8C2Z1A189A			
EZ-Sensor Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3				EZ-Sensor..... 33000 <sup>A</sup> 11.5 1.3			
Sensor..... 28385 27 3				EZ-Sensor..... 33500 <sup>A, DB</sup> 11.5 1.3			
Sensor Clip..... 22100				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
Sensor Cradle..... 22101				EZ-Sensor Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3			
Universal Band..... 22102				Sensor..... 28395 27 3			
<b>2009-2010</b>				Sensor Clip..... 22100			
OE Sensor: Ford Motor Company - 9L3Z1A189A				Sensor Cradle..... 22101			
EZ-Sensor..... 33000 <sup>A</sup> 11.5 1.3				Universal Band..... 22102			
EZ-Sensor..... 33500 <sup>A, DB</sup> 11.5 1.3				<b>2010</b>			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				OE Sensor: Ford Motor Company - 8C2Z1A189A, 9L3Z1A189A; Original			
EZ-Sensor Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3				Equipment Manufacturer - 8C2Z1A189A			
Sensor..... 20315 11.5 1.3				EZ-Sensor..... 33000 <sup>A</sup> 11.5 1.3			
Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3				EZ-Sensor..... 33500 <sup>A, DB</sup> 11.5 1.3			
<b>2011</b>				EZ-Sensor; W/Alloy Wheels..... 33000 <sup>A</sup> 11.5 1.3			
OE Sensor: Ford Motor Company - 9L3Z1A189A				EZ-Sensor..... 33500 <sup>A, DB</sup> 11.5 1.3			
EZ-Sensor..... 33000 <sup>A</sup> 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
EZ-Sensor..... 33500 <sup>A, DB</sup> 11.5 1.3				EZ-Sensor Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				EZ-Sensor Service Pack; W/Alloy Wheels;			
EZ-Sensor Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3				Aluminium Valve..... 34000 62 7			
Sensor..... 20315 11.5 1.3				EZ-Sensor Service Pack; W/Alloy Wheels;			
Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3				Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3			
<b>2012-2015</b>				Sensor..... 20315 11.5 1.3			
OE Sensor: Ford Motor Company - CM5T 1A180 AA, DE8T-1A180-AA,				Sensor..... 28395 27 3			
DE8T1A180AA				Sensor; W/Alloy Wheels..... 28395 27 3			
EZ-Sensor..... 33000 <sup>A</sup> 11.5 1.3				Sensor; W/Steel Wheels..... 20315 11.5 1.3			
EZ-Sensor..... 33500 <sup>A, DB</sup> 11.5 1.3				Sensor Clip..... 22100			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				Sensor Clip; W/Alloy Wheels..... 22100			
EZ-Sensor Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3				Sensor Cradle..... 22101			
Sensor..... 20315 11.5 1.3				Sensor Cradle; W/Alloy Wheels..... 22101			
Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3				Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3			
<b>2016</b>				Service Pack; W/Steel Wheels..... 20018 <sup>C</sup> 11.5 1.3			
OE Sensor: Ford Motor Company - DE8T1A180AA				Universal Band..... 22102			
EZ-Sensor..... 33500 <sup>A, DB</sup> 11.5 1.3				Universal Band; W/Alloy Wheels..... 22102			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				<b>2011-2013</b>			
EZ-Sensor Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3				OE Sensor: Ford Motor Company - 9L3Z1A189A, DE8T1A180AA			
Sensor..... 20315 11.5 1.3				EZ-Sensor..... 33000 <sup>A</sup> 11.5 1.3			
Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3				EZ-Sensor..... 33500 <sup>A, DB</sup> 11.5 1.3			
				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
				EZ-Sensor Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3			
				Sensor..... 20315 11.5 1.3			
				Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3			
				<b>2013</b>			
				EZ-Sensor Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5 1.3			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Ford (cont'd)</b>				<b>Ford (cont'd)</b>			
<b>E-Series Van (cont'd)</b>				<b>Explorer</b>			
<b>2014-2015</b>				<b>2002-2003</b>			
OE Sensor: Ford Motor Company - 9L3Z1A189A, DE8T-1A180-AA, DE8T1A180AA				OE Sensor: Ford Motor Company - 4L2Z 1A150 BA			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33100 A	11.5	1.3
	33500 A, DB	11.5	1.3		33200 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	20315	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor; Exc. Sport	20096 B	44	5
<b>2016</b>				Service Pack; Exc. Sport	20002	44	5
OE Sensor: Ford Motor Company - DE8T1A180AA				<b>2004-2005</b>			
EZ-Sensor	33500 A, DB	11.5	1.3	OE Sensor: Ford Motor Company - 4L2Z 1A150 BA			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor	33100 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3		33200 A	11.5	1.3
Sensor	20315	11.5	1.3		33500 A, DB	11.5	1.3
Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
<b>Expedition</b>				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
<b>2003-2004</b>				Sensor	20096 B	44	5
OE Sensor: Ford Motor Company - 4L2Z 1A150 BA				Service Pack	20002	44	5
EZ-Sensor	33100 A	11.5	1.3	<b>2006-2010</b>			
	33200 A	11.5	1.3	OE Sensor: Ford Motor Company - 6F2Z1A189A			
	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	20096 B	44	5	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack	20002	44	5	Sensor	28385	27	3
<b>2005-2006</b>				Sensor Clip	22100		
OE Sensor: Ford Motor Company - 5L1Z 1A150 AA				Sensor Cradle	22101		
Sensor	20135 B	44	5	Universal Band	22102		
Service Pack	20002	44	5	<b>2011-2014</b>			
<b>2007-2010</b>				OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA			
OE Sensor: Ford Motor Company - 7L1Z1A189A				EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	20315	11.5	1.3
Sensor	28390	27	3	Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor Clip	22100			<b>2015</b>			
Sensor Cradle	22101			OE Sensor: Ford Motor Company - DE8T-1A180-AA			
Universal Band	22102			EZ-Sensor	33000 A	11.5	1.3
<b>2011-2015</b>					33500 A, DB	11.5	1.3
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor	20315	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>2016</b>			
Sensor	20315	11.5	1.3	OE Sensor: Ford Motor Company - F2GT-1A180-AB			
Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
<b>2016</b>				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
OE Sensor: Ford Motor Company - DE8T1A180AA				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor	33500 A, DB	11.5	1.3	Sensor	20280	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3				
Sensor	20315	11.5	1.3				
Service Pack; Rubber Valve	20018 C	11.5	1.3				

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Ford (cont'd)</b>				<b>Ford (cont'd)</b>			
<b>Explorer Sport Trac</b>				<b>F-250 Super Duty</b>			
<b>2007-2010</b>				<b>2008-2010</b>			
OE Sensor: Ford Motor Company - 6F2Z1A189A				OE Sensor: Ford Motor Company - 8C2Z1A189A			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28385	27	3	Sensor.....	28395	27	3
Sensor Clip.....	22100			Sensor Clip.....	22100		
Sensor Cradle.....	22101			Sensor Cradle.....	22101		
Universal Band.....	22102			Universal Band.....	22102		
<b>F-150</b>				<b>2011-2015</b>			
<b>2007</b>				OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-A, DE8T1A180AA			
OE Sensor: Ford Motor Company - 6F2Z1A189A				EZ-Sensor.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3		33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28385	27	3	Sensor.....	20315	11.5	1.3
Sensor Clip.....	22100			Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor Cradle.....	22101			<b>2016</b>			
Universal Band.....	22102			OE Sensor: Ford Motor Company - DE8T1A180AA			
<b>2008</b>				EZ-Sensor.....			
OE Sensor: Ford Motor Company - 6F2Z1A189A, 8C2Z1A189A					33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	20315	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor: W/H.D. Payload Pkg.....	28395	27	3	<b>F-350 Super Duty</b>			
Sensor: W/O H.D. Payload Pkg.....	28385	27	3	<b>2008-2010</b>			
Sensor Clip.....	22100			OE Sensor: Ford Motor Company - 8C2Z1A189A			
Sensor Cradle.....	22101			EZ-Sensor.....			
Universal Band.....	22102				33000 <sup>A</sup>	11.5	1.3
<b>2009-2014</b>					33500 <sup>A, DB</sup>	11.5	1.3
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA				EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3		34000	62	7
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28395	27	3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor Clip.....	22100		
Sensor.....	20315	11.5	1.3	Sensor Cradle.....	22101		
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Universal Band.....	22102		
<b>2015-2016</b>				<b>2011-2015</b>			
OE Sensor: Ford Motor Company - F2GT-1A180-AA, F2GT-1A180-AB				OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-A, DE8T1A180AA			
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor.....			
					33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20280	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	20315	11.5	1.3
				Service Pack; Rubber Valve.....			
				20018 <sup>C</sup>			
				<b>2016</b>			
				OE Sensor: Ford Motor Company - DE8T1A180AA			
				EZ-Sensor.....			
					33500 <sup>A, DB</sup>	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
				Sensor.....	20315	11.5	1.3
				Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Ford (cont'd)</b>				<b>Ford (cont'd)</b>			
<b>F-450 Super Duty</b>				<b>Fiesta (cont'd)</b>			
<b>2008</b>				<b>2016</b>			
OE Sensor: Ford Motor Company - 8C2Z1A189A				OE Sensor: Ford Motor Company - DE8T1A180AA			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	20315	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28395	27	3	<b>Five Hundred</b>			
Sensor Clip.....	22100			<b>2006-2007</b>			
Sensor Cradle.....	22101			OE Sensor: Ford Motor Company - 7L1Z1A189A			
Universal Band.....	22102			EZ-Sensor.....	33000 A	11.5	1.3
<b>2009</b>					33500 A, DB	11.5	1.3
OE Sensor: Ford Motor Company - 8C2Z1A189A				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor.....	28390	27	3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor Clip.....	22100		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor Cradle.....	22101		
Sensor.....	28395	27	3	Universal Band.....	22102		
Sensor Clip.....	22100			<b>Flex</b>			
Sensor Cradle.....	22101			<b>2009-2010</b>			
Universal Band.....	22102			OE Sensor: Ford Motor Company - 7L1Z1A189A			
<b>2010</b>				EZ-Sensor.....	33000 A	11.5	1.3
OE Sensor: Ford Motor Company - 8C2Z1A189A					33500 A, DB	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28390	27	3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor Clip.....	22100		
Sensor.....	28395	27	3	Sensor Cradle.....	22101		
Sensor Clip.....	22100			Universal Band.....	22102		
Sensor Cradle.....	22101			<b>2011-2015</b>			
Universal Band.....	22102			OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A-180-AA, DE8T-1A180-AA			
<b>F-550 Super Duty</b>				EZ-Sensor.....	33000 A	11.5	1.3
<b>2010</b>					33500 A, DB	11.5	1.3
OE Sensor: Ford Motor Company - 8C2Z1A189A				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor.....	20315	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2016</b>			
Sensor.....	28395	27	3	OE Sensor: Ford Motor Company - DE8T-1A-180-AA			
Sensor Clip.....	22100			EZ-Sensor.....	33500 A, DB	11.5	1.3
Sensor Cradle.....	22101			EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Universal Band.....	22102			EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
<b>Fiesta</b>				Sensor.....	20315	11.5	1.3
<b>2011-2015</b>				Service Pack; Rubber Valve.....	20018 C	11.5	1.3
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA				<b>Focus</b>			
EZ-Sensor.....	33000 A	11.5	1.3	<b>2007</b>			
	33500 A, DB	11.5	1.3	OE Sensor: Ford Motor Company - 6F2Z1A189A			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.....	20315	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Sensor.....	28385	27	3
				Sensor Clip.....	22100		
				Sensor Cradle.....	22101		
				Universal Band.....	22102		

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Ford (cont'd)</b>				<b>Ford (cont'd)</b>			
<b>Focus (cont'd)</b>				<b>Freestar (cont'd)</b>			
<b>2008-2009</b>				<b>2006-2007</b>			
OE Sensor: Ford Motor Company - 7L1Z1A189A				OE Sensor: Ford Motor Company - 6F2Z1A189A			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28390	27	3	Sensor.....	28385	27	3
Sensor Clip.....	22100			Sensor Clip.....	22100		
Sensor Cradle.....	22101			Sensor Cradle.....	22101		
Universal Band.....	22102			Universal Band.....	22102		
<b>2010</b>				<b>Fusion</b>			
OE Sensor: Ford Motor Company - 9L3Z1A189A				<b>2007-2009</b>			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	OE Sensor: Ford Motor Company - 6F2Z1A189A			
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20315	13	1.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	28385	27	3
<b>2011</b>				Sensor Clip.....	22100		
OE Sensor: Ford Motor Company - 9L3Z1A189A				Sensor Cradle.....	22101		
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Universal Band.....	22102		
	33500 <sup>A, DB</sup>	11.5	1.3	<b>2010-2015</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
Sensor.....	20315	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2012-2015</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
OE Sensor: Ford Motor Company - CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA				Sensor.....	20315	11.5	1.3
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	<b>2016</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Ford Motor Company - DE8T1A180AA			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
Sensor.....	20315	13	1.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
<b>2016</b>				Sensor.....	20315	11.5	1.3
OE Sensor: Ford Motor Company - DE8T1A180AA				Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	<b>Mustang</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2007-2009</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	OE Sensor: Ford Motor Company - 6F2Z1A189A			
Sensor.....	20315	13	1.5	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
<b>Freestar</b>				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2004-2005</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
OE Sensor: Ford Motor Company - 5L1Z 1A150 AA				Sensor.....	28385	27	3
Sensor; W/Aluminium Valve Stem.....	20135 <sup>B</sup>	44	5	Sensor Clip.....	22100		
Service Pack; W/Aluminium Valve Stem.....	20002	44	5	Sensor Cradle.....	22101		
				Universal Band.....	22102		
				<b>2010-2011</b>			
				OE Sensor: Ford Motor Company - 9L3Z1A189A			
				EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
					33500 <sup>A, DB</sup>	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
				Sensor.....	20315	11.5	1.3
				Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3

A-Programming Tool Required    B-Magnet may be Required to Activate Sensor    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Ford (cont'd)</b>				<b>Ford (cont'd)</b>			
<b>Mustang (cont'd)</b>				<b>Police Interceptor Sedan (cont'd)</b>			
<b>2012</b>				<b>2013</b>			
OE Sensor: Ford Motor Company - CM5T 1A180 AA				EZ-Sensor: . . . . .	33000 A	11.5	1.3
EZ-Sensor; exc Shelby GT500. . . . .	33000 A	11.5	1.3	<b>Ranger</b>			
EZ-Sensor; Shelby GT500; MUST use Aluminium stem kit 34000 before Sensor installation. . . . .	33000 A	11.5	1.3	<b>2007-2011</b>			
	33500 A, DB	11.5	1.3	OE Sensor: Ford Motor Company - 6F2Z1A189A			
EZ-Sensor Service Pack; exc Shelby GT500; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor: . . . . .	33000 A	11.5	1.3
EZ-Sensor Service Pack; exc Shelby GT500; Rubber Valve. . . . .	20018 C	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Shelby GT500; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
EZ-Sensor Service Pack; Shelby GT500; Rubber Valve. . . . .	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
Sensor; exc Shelby GT500. . . . .	20315	11.5	1.3	Sensor. . . . .	28385	27	3
Service Pack; exc Shelby GT500. . . . .	20018 C	11.5	1.3	Sensor Clip. . . . .	22100		
<b>2013</b>				Sensor Cradle. . . . .	22101		
OE Sensor: Ford Motor Company - 9L3Z1A189A				Universal Band. . . . .	22102		
EZ-Sensor: . . . . .	33100 A	11.5	1.3	<b>Taurus</b>			
EZ-Sensor; exc Shelby GT500. . . . .	33000 A	11.5	1.3	<b>2008-2009</b>			
	33500 A, DB	11.5	1.3	OE Sensor: Ford Motor Company - 7L1Z1A189A			
EZ-Sensor Service Pack; exc Shelby GT500; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor: . . . . .	33000 A	11.5	1.3
EZ-Sensor Service Pack; exc Shelby GT500; Rubber Valve. . . . .	20018 C	11.5	1.3		33500 A, DB	11.5	1.3
Sensor; exc Shelby GT500. . . . .	20315	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
Service Pack; exc Shelby GT500. . . . .	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
<b>2014</b>				Sensor. . . . .	28390	27	3
OE Sensor: Ford Motor Company - CM5T 1A180 AA, DE8T-1A180-A				Sensor Clip. . . . .	22100		
EZ-Sensor: . . . . .	33100 A	11.5	1.3	Sensor Cradle. . . . .	22101		
EZ-Sensor; exc Shelby GT500. . . . .	33000 A	11.5	1.3	Universal Band. . . . .	22102		
EZ-Sensor; Shelby GT500; MUST use Aluminium stem kit 34000 before Sensor installation. . . . .	33000 A	11.5	1.3	<b>2010</b>			
	33500 A, DB	11.5	1.3	OE Sensor: Ford Motor Company - 7L1Z1A189A, 9L3Z1A189A			
EZ-Sensor Service Pack; exc Shelby GT500; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor: . . . . .	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; exc Shelby GT500; Rubber Valve. . . . .	20018 C	11.5	1.3	EZ-Sensor; Apr. & Older. . . . .	33000 A	11.5	1.3
EZ-Sensor Service Pack; Shelby GT500; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor Service Pack; Apr. & Older; Aluminium Valve. . . . .	34000	62	7
EZ-Sensor Service Pack; Shelby GT500; Rubber Valve. . . . .	20018 C	11.5	1.3	EZ-Sensor Service Pack; Apr. & Older; Rubber Valve. . . . .	20018 C	11.5	1.3
Sensor; exc Shelby GT500. . . . .	20315	11.5	1.3	Sensor; Apr. & Older. . . . .	28390	27	3
Service Pack; exc Shelby GT500. . . . .	20018 C	11.5	1.3	Sensor; May & Newer. . . . .	20315	11.5	1.3
<b>2015-2016</b>				Sensor Clip; Apr. & Older. . . . .	22100		
OE Sensor: Ford Motor Company - F2GT-1A180-AB				Sensor Cradle; Apr. & Older. . . . .	22101		
EZ-Sensor: . . . . .	33500 A, DB	11.5	1.3	Service Pack; May & Newer. . . . .	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	Universal Band; Apr. & Older. . . . .	22102		
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	<b>2011-2015</b>			
Sensor. . . . .	20280	11.5	1.3	OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA			
Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	EZ-Sensor: . . . . .	33000 A	11.5	1.3
<b>Police Interceptor Sedan</b>					33500 A, DB	11.5	1.3
<b>2011-2013</b>				EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
EZ-Sensor: . . . . .	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	Sensor. . . . .	20315	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
				<b>2016</b>			
				OE Sensor: Ford Motor Company - DE8T1A180AA			
				EZ-Sensor: . . . . .	33500 A, DB	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
				Sensor. . . . .	20315	11.5	1.3
				Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Ford (cont'd)</b>				<b>GMC</b>			
<b>Transit</b>				<b>Acadia</b>			
<b>2014-2015</b>				<b>2007-2008</b>			
OE Sensor: Ford Motor Company - DE8T-1A180-AA, DE8T1A180AA				OE Sensor: General Motors - 10394110, 15921013			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	20315	11.5	1.3	Sensor.....	20158	62	7
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack; W/Schrader Sensor.....	20004	62	7
<b>2016</b>				<b>2009-2015</b>			
OE Sensor: Ford Motor Company - DE8T1A180AA				OE Sensor: General Motors - 22853741, 23445327, 25920615			
Sensor.....	20315	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
<b>Transit Connect</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
<b>2010-2015</b>				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA				Sensor.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Service Pack.....	20008 <sup>C</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	<b>2016</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: General Motors - 13598771			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	20153	11.5	1.3
Sensor.....	20315	11.5	1.3	Service Pack.....	20008 <sup>C</sup>	11.5	1.3
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>Canyon</b>			
<b>2016</b>				<b>2007-2012</b>			
OE Sensor: Ford Motor Company - DE8T1A180AA				OE Sensor: General Motors - 15122618			
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20315	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	20131	62	7
<b>Freightliner</b>				Service Pack.....			
<b>Sprinter</b>				20006			
<b>2007-2008</b>				<b>2015</b>			
OE Sensor: Chrysler - 68006771AA				OE Sensor: General Motors - 13581558			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	28206	11.5	1.3
Sensor.....	20089	53	6	Service Pack.....	20008 <sup>C</sup>	11.5	1.3
Service Pack; Includes Valve.....	20036	53	6	<b>2016</b>			
<b>2009-2012</b>				OE Sensor: General Motors - 13581558			
EZ-Sensor.....				Sensor.....			
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack.....	20008 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>Envoy</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>2006</b>			
<b>2013</b>				OE Sensor: General Motors - 25774006			
OE Sensor: Chrysler - 68006771AA				EZ-Sensor.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3		33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	20089	53	6	Sensor.....	20116	62	7
Service Pack; Includes Valve.....	20036	53	6	Service Pack.....	20004	62	7
<b>2007-2009</b>				OE Sensor: General Motors - 25774006			
OE Sensor: General Motors - 25774006				Sensor.....			
Sensor.....	20116	62	7	Service Pack.....	20004	62	7
Service Pack.....	20004	62	7				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>GMC (cont'd)</b>				<b>GMC (cont'd)</b>			
<b>Savana Series</b>				<b>Sierra Series (cont'd)</b>			
<b>2008-2009</b>				<b>2007</b>			
OE Sensor: General Motors - 15921013				OE Sensor: General Motors - 15114379, 15254101, 15825475			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	20158	62	7	Sensor; Clamp-In Style Only; TRW Sensor;			
Service Pack; W/Schrader Sensor	20004	62	7	W/Aluminium Valve Stem; Exc. Classic	20158	62	7
Service Pack; W/Siemens Sensor	20030	80	9	Sensor; Classic	20107	62	7
<b>2010-2015</b>				Sensor; Snap-In Style Only; Schrader Sensor;			
OE Sensor: General Motors - 13586335, 20923680, 22853741, 25920615				W/Rubber Valve Stem; Exc. Classic			
EZ-Sensor	33000 A	11.5	1.3		20153	11.5	1.3
	33500 A, DB	11.5	1.3	Service Pack; Clamp-In Style Only; TRW Sensor;			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	W/Aluminium Valve Stem; Exc. Classic	20015	80	9
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Service Pack; Classic	20004	62	7
Sensor	20153	11.5	1.3	Service Pack; Snap-In Style Only; Schrader			
Service Pack	20008 C	11.5	1.3	Sensor; W/Rubber Valve Stem; Exc. Classic	20008 C	11.5	1.3
<b>2016</b>				<b>2008-2013</b>			
OE Sensor: General Motors - 13586335				OE Sensor: General Motors - 13586335, 15922396, 25920615			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	20153	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack	20008 C	11.5	1.3	Sensor; W/Single Rear Wheels	20153	11.5	1.3
<b>Sierra Series</b>				Service Pack; W/Single Rear Wheels			
<b>2004</b>				20008 C			
OE Sensor: General Motors - 15136883				<b>2014</b>			
EZ-Sensor	33000 A	11.5	1.3	OE Sensor: General Motors - 13581558			
	33500 A, DB	11.5	1.3	EZ-Sensor			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	33000 A			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	33500 A, DB			
Sensor	20115	62	7	EZ-Sensor Service Pack; Aluminium Valve			
Service Pack	20004	62	7	34000			
<b>2005-2006</b>				EZ-Sensor Service Pack; Rubber Valve			
OE Sensor: General Motors - 15114379				20018 C			
EZ-Sensor	33000 A	11.5	1.3	Sensor; W/Single Rear Wheels			
	33500 A, DB	11.5	1.3	28206			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/Single Rear Wheels			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	20008 C			
Sensor	20107	62	7	<b>2015</b>			
Service Pack	20004	62	7	OE Sensor: General Motors - 13581558			
				EZ-Sensor			
				33000 A			
				33500 A, DB			
				EZ-Sensor Service Pack; Aluminium Valve			
				34000			
				EZ-Sensor Service Pack; Rubber Valve			
				20018 C			
				Sensor; W/Single Rear Wheels			
				28206			
				Service Pack			
				20008 C			
				Service Pack; W/Single Rear Wheels			
				20008 C			
				<b>2016</b>			
				OE Sensor: General Motors - 13581558			
				EZ-Sensor			
				33500 A, DB			
				EZ-Sensor Service Pack; Aluminium Valve			
				34000			
				EZ-Sensor Service Pack; Rubber Valve			
				20018 C			
				Sensor; W/Single Rear Wheels			
				28206			
				Service Pack			
				20008 C			
				Service Pack; W/Single Rear Wheels			
				20008 C			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>GMC (cont'd)</b>				<b>GMC (cont'd)</b>			
<b>Terrain</b>				<b>Yukon (cont'd)</b>			
<b>2010-2014</b>				<b>2008-2013</b>			
OE Sensor: General Motors - 12768826, 22854866				OE Sensor: General Motors - 13586335, 15922396, 20923680, 25920615			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28206	11.5	1.3	Sensor.....	20153	11.5	1.3
Service Pack.....	20008 C	11.5	1.3	Service Pack.....	20008 C	11.5	1.3
<b>2015</b>				<b>2014-2015</b>			
OE Sensor: General Motors - 13598772				OE Sensor: General Motors - 13581558			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28206	11.5	1.3	Sensor.....	28206	11.5	1.3
Service Pack; Rubber Valve.....	20008 C	11.5	1.3	Service Pack.....	20008 C	11.5	1.3
<b>2016</b>				<b>2016</b>			
OE Sensor: General Motors - 13598772				OE Sensor: General Motors - 13581558			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28206	11.5	1.3	Sensor.....	28206	11.5	1.3
Service Pack; Rubber Valve.....	20008 C	11.5	1.3	Service Pack.....	20008 C	11.5	1.3
<b>Yukon</b>				<b>Honda</b>			
<b>2004</b>				<b>Accord</b>			
OE Sensor: General Motors - 15136883				<b>2008-2012</b>			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Honda - 42753SWA306, 42753SWA316			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20115	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack.....	20004	62	7	Sensor.....	20099	35	4
<b>2005-2006</b>				Service Pack.....			
OE Sensor: General Motors - 15114379				20032			
EZ-Sensor.....	33000 A	11.5	1.3	<b>2013-2016</b>			
	33500 A, DB	11.5	1.3	Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	INDIRECT <sup>D</sup>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>Accord Crosstour</b>			
Sensor.....	20107	62	7	<b>2010-2015</b>			
Service Pack.....	20004	62	7	OE Sensor: Honda - 42753-TP6-A82, 42753TP6A82			
<b>2007</b>				EZ-Sensor.....			
OE Sensor: General Motors - 15254101, 15825475				33500 A, DB			
EZ-Sensor.....	33000 A	11.5	1.3	11.5			
	33500 A, DB	11.5	1.3	1.3			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	34000			
Sensor: Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem.....	20158	62	7	EZ-Sensor Service Pack; Rubber Valve.....			
Sensor: Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem.....	20153	11.5	1.3	20018 C			
Service Pack: Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem.....	20015	62	7	Sensor.....			
Service Pack: Snap-In Style Only; Schrader Sensor: W/Rubber Valve Stem.....	20008 C	11.5	1.3	20100			
				35			
				4			
				<b>Civic</b>			
				<b>2008-2014</b>			
				OE Sensor: Honda - 42753SNAA83, 42753TR0A81, 42753TR3A81			
				EZ-Sensor.....			
				33000 A			
				11.5			
				1.3			
				33500 A, DB			
				11.5			
				1.3			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				34000			
				62			
				7			
				EZ-Sensor Service Pack; Rubber Valve.....			
				20018 C			
				11.5			
				1.3			
				Sensor.....			
				28720			
				35			
				4			
				Service Pack.....			
				20019			
				35			
				4			

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Honda (cont'd)</b>				<b>Honda (cont'd)</b>			
<b>Crosstour</b>				<b>Fit</b>			
2010-2015				2008			
OE Sensor: Honda - 42753TP6A82				OE Sensor: Honda - 42753SWA306			
Sensor	20100	71	8	EZ-Sensor	33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
<b>CR-V</b>				EZ-Sensor Service Pack; Aluminium Valve			
2007-2011				EZ-Sensor Service Pack; Rubber Valve			
OE Sensor: Honda - 42753SWA306, 42753SWA316				Sensor	20099	35	4
EZ-Sensor	33000 A	11.5	1.3	Service Pack	20032	35	4
	33500 A, DB	11.5	1.3	<b>2009-2014</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: Honda - 42753SNAA83, 42753TR3A81			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
Sensor	20099	35	4		33500 A, DB	11.5	1.3
Service Pack	20032	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
<b>2012-2013</b>				EZ-Sensor Service Pack; Rubber Valve			
OE Sensor: Honda - 42753-TP6-A82				Sensor	28720	35	4
EZ-Sensor	33500 A, DB	11.5	1.3	Service Pack	20019	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>2015-2016</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor			INDIRECT D
Sensor	20100	35	4	<b>Insight</b>			
2014-2015				2010-2014			
Sensor			INDIRECT D	OE Sensor: Honda - 42753SNAA83			
<b>CR-Z</b>				EZ-Sensor			
2011-2014				EZ-Sensor Service Pack; Aluminium Valve			
OE Sensor: Honda - 42753SNAA83, 42753SNAA84				EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor	33000 A	11.5	1.3	Sensor	28720	35	4
	33500 A, DB	11.5	1.3	Service Pack	20019	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>Odyssey</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	2005-2007			
Sensor	28720	35	4	OE Sensor: Honda - 06421S3VA04			
Service Pack	20019	35	4	Sensor; Touring	28981	35	4
<b>2015</b>				Service Pack; Touring; Includes Valve			
OE Sensor: Honda - 42753TR3A81					20036	35	4
EZ-Sensor	33500 A, DB	11.5	1.3	<b>2008</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: Honda - 42753-AHJ-A53, 42753-SHJ-A82			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	28983	35	4
Sensor	28720	35	4	Sensor; Touring	28981	35	4
Service Pack	20019	35	4	Service Pack; Includes Valve	20036	31-40	3.5-4.5
<b>Element</b>				Service Pack; Touring; Includes Valve			
2007-2008				2009-2010			
Service Pack; Includes Valve	20036	35	4	OE Sensor: Honda - 42753-SHJ-A82			
2009-2011				Sensor			
OE Sensor: Honda - 42753SNAA83					28983	35	4
EZ-Sensor	33000 A	11.5	1.3	Service Pack; Includes Valve	20036	31-40	3.5-4.5
	33500 A, DB	11.5	1.3	<b>2011-2016</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: Honda - 42753-TR3-A81, 42753-TR3-A83			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
Sensor	28720	35	4		33500 A, DB	11.5	1.3
Service Pack	20019	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve			
				Sensor			
				Service Pack			

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Honda (cont'd)</b>				<b>Honda (cont'd)</b>			
<b>Pilot</b>				<b>S2000</b>			
<b>2005</b>				<b>2008-2009</b>			
OE Sensor: Honda - 06421S3VA02, 06421S9VA01				EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
Sensor; LX; W/Long Stem Valve.....	28982	35	4		33500 <sup>A, DB</sup>	11.5	1.3
Sensor; W/Short Stem Valve.....	28981	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; EX; Includes Valve.....	20036	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; LX; W/Long Stem Valve; Includes Valve.....	20035	35	4	Service Pack.....	20032	35	4
Service Pack; LX; W/Short Stem Valve; Includes Valve.....	20036	35	4				
<b>2006-2008</b>				<b>Hummer</b>			
OE Sensor: Honda - 06421S3VA02, 06421S3VA04				<b>H2</b>			
Sensor.....	28981	35	4	<b>2008-2009</b>			
Service Pack; Includes Valve.....	20036	35	4	OE Sensor: General Motors - 15922396			
<b>2009</b>				EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
OE Sensor: Honda - 42753STKA03					33500 <sup>A, DB</sup>	11.5	1.3
Sensor; W/Alloy Wheels.....	20098	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/Alloy Wheels.....	20032	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
<b>2010-2011</b>				Sensor.....	20153	11.5	1.3
OE Sensor: Honda - 42753STKA04				Service Pack.....	20008 <sup>C</sup>	11.5	1.3
Sensor; Exc. LX.....	20098	35	4				
Service Pack; Exc. LX.....	20032	35	4	<b>H3</b>			
<b>2012-2015</b>				<b>2006-2010</b>			
OE Sensor: Honda - 42753STKA04				OE Sensor: General Motors - 15122618			
Sensor; W/Alloy Wheels.....	20098	35	4	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
Service Pack; W/Alloy Wheels.....	20032	35	4		33500 <sup>A, DB</sup>	11.5	1.3
<b>Ridgeline</b>				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2006</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
OE Sensor: Honda - 06421S3VA02, 06421S9VA01				Sensor.....	20131	62	7
Sensor; RT.....	28982	35	4	Service Pack.....	20006	62	7
Sensor; RTL, RTS.....	28981	35	4				
Service Pack; RT; Includes Valve.....	20035	35	4	<b>H3T</b>			
Service Pack; RTL, RTS; Includes Valve.....	20036	35	4	<b>2006-2008</b>			
<b>2007-2008</b>				EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
OE Sensor: Honda - 06421S3VA04, 06421S9VA03				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; RT.....	28982	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor; RTL, RTS, RTX.....	28981	35	4	<b>2009-2010</b>			
Service Pack; RT; Includes Valve.....	20035	35	4	OE Sensor: General Motors - 15122618			
Service Pack; RTL, RTS, RTX; Includes Valve.....	20036	35	4	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
<b>2009</b>					33500 <sup>A, DB</sup>	11.5	1.3
OE Sensor: Honda - 06421S3VA04				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28981	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; Includes Valve.....	20036	35	4	Sensor.....	20131	62	7
<b>2010</b>				Service Pack.....	20006	62	7
OE Sensor: Honda - 06421S3VA04, 42753SHJA53				<b>Hyundai</b>			
Sensor; W/Alloy Wheels.....	28981	35	4	<b>Accent</b>			
Sensor; W/Steel Wheels.....	28981	35	4	<b>2006-2007</b>			
Service Pack; RT; Includes Valve.....	20036	35	4	OE Sensor: Hyundai - 52933-1F000			
<b>2011-2014</b>				Sensor.....	28983		
OE Sensor: Honda - 06421S3VA04, 42753SHJA53, 42753SHJA54				Service Pack.....	20036		
Sensor.....	28981	35	4	<b>2008-2011</b>			
Service Pack; RT; Includes Valve.....	20036	35	4	OE Sensor: Hyundai - 529332F000			
				EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
					33500 <sup>A, DB</sup>	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
				Sensor.....	28849	35	4
				Service Pack.....	20022	35	4

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Hyundai (cont'd)</b>				<b>Hyundai (cont'd)</b>			
<b>Accent (cont'd)</b>				<b>Elantra (cont'd)</b>			
2012-2014				2012			
OE Sensor: Hyundai - 529332M000				OE Sensor: Hyundai - 529332M000, 529333X200			
EZ-Sensor	33000 A	11.5	1.3	Sensor; exc Touring; W/Transmitter Only	20086	31-40	3.5-4.5
	33500 A, DB	11.5	1.3	Sensor; Touring; W/Transmitter Only	20092	31-40	3.5-4.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack	20019	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Service Pack; exc Touring; Includes Valve	20036	31-40	3.5-4.5
Sensor	20092	31-40	3.5-4.5	<b>2013</b>			
<b>Azera</b>				OE Sensor: Hyundai - 529333X200			
2006				Sensor; W/Transmitter Only			
OE Sensor: Hyundai - 529332G200				Service Pack	20019	35	4
Sensor; Includes Transmitter Only	20086	31-40	3.5-4.5	Service Pack; Includes Valve	20036	31-40	3.5-4.5
Service Pack; Includes Valve	20036	31-40	3.5-4.5	<b>2014</b>			
2007-2012				OE Sensor: Hyundai - 52933-3N000			
OE Sensor: Hyundai - 529332G200				Sensor	20092		
EZ-Sensor	33000 A	11.5	1.3	<b>2015-2016</b>			
	33500 A, DB	11.5	1.3	EZ-Sensor; exc Touring	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; exc Touring; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; exc Touring; Rubber Valve	20018 C	11.5	1.3
Sensor; Includes Transmitter Only	20086	31-40	3.5-4.5	<b>Elantra Coupe</b>			
Service Pack; Includes Valve	20036	31-40	3.5-4.5	2013			
<b>2013</b>				OE Sensor: Hyundai - 529333X200			
OE Sensor: Hyundai - 529332G201				Sensor; W/Transmitter Only	20086	31-40	3.5-4.5
EZ-Sensor	33000 A	11.5	1.3	Service Pack; Includes Valve	20036	31-40	3.5-4.5
	33500 A, DB	11.5	1.3	<b>Elantra GT</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2013-2015			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	OE Sensor: Hyundai - 52933-3N000			
Sensor	20086	31-40	3.5-4.5	Sensor			
Service Pack; Includes Valve	20036	31-40	3.5-4.5	20092			
<b>Elantra</b>				<b>Entourage</b>			
2007-2009				2007-2009			
OE Sensor: Hyundai - 529332G200				OE Sensor: Hyundai - 529334D200			
EZ-Sensor	33000 A	11.5	1.3	Sensor; Includes Transmitter Only	20085	31-40	3.5-4.5
	33500 A, DB	11.5	1.3	Service Pack; Includes Valve	20036	31-40	3.5-4.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>Equus</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	2011-2013			
Sensor; Includes Transmitter Only	20086	31-40	3.5-4.5	OE Sensor: Hyundai - 529332F000, 529332F001			
Service Pack; Includes Valve	20036	31-40	3.5-4.5	Sensor			
<b>2010</b>				Service Pack			
OE Sensor: Hyundai - 529332G200, 529332M000				20022			
EZ-Sensor; exc Touring	33000 A	11.5	1.3	<b>2014-2015</b>			
	33500 A, DB	11.5	1.3	OE Sensor: Hyundai - 529332M001			
EZ-Sensor Service Pack; exc Touring; Aluminium Valve	34000	62	7	EZ-Sensor			
EZ-Sensor Service Pack; exc Touring; Rubber Valve	20018 C	11.5	1.3	Sensor			
Sensor; exc Touring; Includes Transmitter Only	20086	31-40	3.5-4.5	Service Pack			
Sensor; Touring; Includes Transmitter Only	20092	31-40	3.5-4.5	20022			
Service Pack	20019	35	4	33000 A			
Service Pack; exc Touring; Includes Valve	20036	31-40	3.5-4.5	33500 A, DB			
<b>2011</b>				EZ-Sensor Service Pack; Aluminium Valve			
OE Sensor: Hyundai - 529332M000, 529333X200				EZ-Sensor Service Pack; Rubber Valve			
Sensor; exc Touring; Includes Transmitter Only	20086	31-40	3.5-4.5	Sensor			
Sensor; Touring; Includes Transmitter Only	20092	31-40	3.5-4.5	20092			
Service Pack	20019	35	4	31-40			
Service Pack; exc Touring; Includes Valve	20036	31-40	3.5-4.5	3.5-4.5			
<b>Genesis</b>				<b>Genesis</b>			
2009				2009			
Service Pack	20022	35	4	Service Pack			
				20022			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Hyundai (cont'd)</b>				<b>Hyundai (cont'd)</b>			
<b>Genesis (cont'd)</b>				<b>Santa Fe (cont'd)</b>			
<b>2011-2013</b>				<b>2013</b>			
OE Sensor: Hyundai - 529332F000				OE Sensor: Hyundai - 529332M001			
Sensor.....	28849	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack.....	20022	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
<b>2014</b>				Sensor.....			
OE Sensor: Hyundai - 529332F000					20092	31-40	3.5-4.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack.....	20022	35	4
Sensor.....	28849	35	4	<b>2014-2015</b>			
Service Pack.....	20022	35	4	OE Sensor: Hyundai - 529332M000, 529333N000			
<b>Genesis Coupe</b>				Sensor.....			
					20092	31-40	3.5-4.5
<b>2010-2012</b>				<b>Santa Fe XL</b>			
OE Sensor: Hyundai - 529332M000				<b>2013</b>			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Hyundai - 52933A5000			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20092	31-40	3.5-4.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
<b>2013</b>				Sensor.....			
OE Sensor: Hyundai - 52933-A5000					28849	35	4
Sensor.....	20092	31-40	3.5-4.5	Service Pack.....	20022	35	4
<b>2014-2015</b>				<b>Sonata</b>			
OE Sensor: Hyundai - 529332M000				<b>2007</b>			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Hyundai - 529331FA00			
	33500 A, DB	11.5	1.3	Sensor.....	28983	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Includes Valve.....	20036	31-40	3.5-4.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2008</b>			
Sensor.....	20092	31-40	3.5-4.5	OE Sensor: Hyundai - 52933-1F000, 52933-2F000			
<b>Santa Fe</b>				EZ-Sensor.....			
<b>2007</b>					33000 A	11.5	1.3
OE Sensor: Hyundai - 529334D200					33500 A, DB	11.5	1.3
Sensor; Includes Transmitter Only.....	20085	31-40	3.5-4.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Includes Valve.....	20036	31-40	3.5-4.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
<b>2008</b>				Sensor.....			
OE Sensor: Hyundai - 529332G200, 529334D200					28849	35	4
EZ-Sensor.....	33000 A	11.5	1.3		28983	35	4
	33500 A, DB	11.5	1.3	Service Pack; Includes Valve.....	20036	31-40	3.5-4.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2009-2010</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	OE Sensor: Hyundai - 529332F000			
Sensor; Includes Transmitter Only.....	20085	31-40	3.5-4.5	EZ-Sensor.....	33000 A	11.5	1.3
	20086	31-40	3.5-4.5		33500 A, DB	11.5	1.3
Service Pack; Includes Valve.....	20036	31-40	3.5-4.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2009</b>				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Hyundai - 529332G200					20018 C	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	Sensor.....	28849	35	4
	33500 A, DB	11.5	1.3	Service Pack.....	20022	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2011-2013</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	OE Sensor: Hyundai - 529332M000, 529332M001			
Sensor; Includes Transmitter Only.....	20086	31-40	3.5-4.5	EZ-Sensor.....	33000 A	11.5	1.3
Service Pack; Includes Valve.....	20036	31-40	3.5-4.5		33500 A, DB	11.5	1.3
<b>2010-2012</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor.....	33000 A	11.5	1.3		34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	20092	31-40	3.5-4.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2014</b>			
Sensor; Includes Transmitter Only.....	20086	31-40	3.5-4.5	OE Sensor: Hyundai - 529332M550			
Service Pack; Includes Valve.....	20036	31-40	3.5-4.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
<b>2010-2012</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor.....	33000 A	11.5	1.3		34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	20092	31-40	3.5-4.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Hyundai (cont'd)</b>				<b>Hyundai (cont'd)</b>			
<b>Sonata (cont'd)</b>				<b>Veracruz (cont'd)</b>			
<b>2015-2016</b>				<b>2008</b>			
OE Sensor: Hyundai - 52933-C1100				OE Sensor: Hyundai - 529332G200, 529334D200			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	20281	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack; Rubber Valve	20046	11.5	1.3	Sensor	20086		
				Sensor; Includes Transmitter Only	20085	31-40	3.5-4.5
				Service Pack; Includes Valve	20036	31-40	3.5-4.5
<b>Tiburon</b>				<b>2009-2012</b>			
<b>2007-2008</b>				OE Sensor: Hyundai - 529332G200			
OE Sensor: Hyundai - 529331FA00				EZ-Sensor	33000 A	11.5	1.3
Sensor	28983	35	4	EZ-Sensor	33500 A, DB	11.5	1.3
Service Pack; Includes Valve	20036	31-40	3.5-4.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
				Sensor; Includes Transmitter Only	20086	31-40	3.5-4.5
				Service Pack; Includes Valve	20036	31-40	3.5-4.5
<b>Tucson</b>				<b>Infiniti</b>			
<b>2006-2009</b>				<b>EX35</b>			
OE Sensor: Hyundai - 529331FA00				<b>2008-2010</b>			
Sensor	28983	35	4	OE Sensor: Nissan - 40700-JK00B			
Service Pack; Includes Valve	20036	31-40	3.5-4.5	EZ-Sensor	33000 A	11.5	1.3
				EZ-Sensor	33500 A, DB	11.5	1.3
<b>2010-2013</b>				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
OE Sensor: Hyundai - 529332F000				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3	Sensor	28849	35	4
EZ-Sensor	33500 A, DB	11.5	1.3	Service Pack	20022	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3				
Sensor	28849	35	4				
Service Pack	20022	35	4				
<b>2014</b>				<b>2011-2012</b>			
OE Sensor: Hyundai - 529332S500				EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28500						
<b>2015-2016</b>				<b>2013</b>			
OE Sensor: Hyundai - 52933-C1100				EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3				
Sensor	20281	11.5	1.3				
Service Pack; Rubber Valve	20046	11.5	1.3				
<b>Veloster</b>				<b>EX37</b>			
<b>2012-2015</b>				<b>2011-2012</b>			
OE Sensor: Hyundai - 529332V000; Original Equipment Manufacturer - 529332V000				EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28505	11.5	1.3				
Service Pack	20008 C	11.5	1.3				
<b>Veracruz</b>				<b>FX35</b>			
<b>2006-2007</b>				<b>2003-2006</b>			
OE Sensor: Hyundai - 529334D200				OE Sensor: Nissan - 40700-CD001			
Sensor; Includes Transmitter Only	20085	31-40	3.5-4.5	EZ-Sensor	33000 A	11.5	1.3
Service Pack; Includes Valve	20036	31-40	3.5-4.5	EZ-Sensor	33500 A, DB	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
				Sensor	20064	66	7.5
				Service Pack	20007	66	7.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Infiniti (cont'd)</b>				<b>Infiniti (cont'd)</b>			
<b>FX35 (cont'd)</b>				<b>FX45 (cont'd)</b>			
<b>2007</b>				<b>2007</b>			
OE Sensor: Nissan - 40700-CD001, 40700-JA01B				OE Sensor: Nissan - 40700-CD001, 40700-JA01B			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor; Jul. & Newer.....	28204	66	7.5	Sensor; Jul. & Newer.....	28204	66	7.5
Sensor; Jun. & Older.....	20064	66	7.5	Sensor; Jun. & Older.....	20064	66	7.5
Service Pack; Jul. & Newer.....	20014	66	7.5	Service Pack; Jul. & Newer.....	20014	66	7.5
Service Pack; Jun. & Older.....	20007	66	7.5	Service Pack; Jun. & Older.....	20007	66	7.5
<b>2008</b>				<b>2008</b>			
OE Sensor: Nissan - 40700-JA01B				OE Sensor: Nissan - 40700-JA01B			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28204	66	7.5	Sensor.....	28204	66	7.5
Service Pack.....	20014	66	7.5	Service Pack.....	20014	66	7.5
<b>2009-2010</b>				<b>FX50</b>			
OE Sensor: Nissan - 40700-JK00B				<b>2009-2010</b>			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28210	66	7.5	Sensor.....	28210	66	7.5
Service Pack.....	20014	66	7.5	Service Pack.....	20014	66	7.5
<b>2011-2012</b>				<b>2011-2013</b>			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
<b>2013</b>				<b>G25</b>			
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	<b>2011-2013</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
<b>FX37</b>				<b>G25</b>			
<b>2013</b>				<b>2011-2013</b>			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
<b>FX45</b>				<b>G35</b>			
<b>2003-2006</b>				<b>2003</b>			
OE Sensor: Nissan - 40700-CD001				OE Sensor: Nissan - 40700-CD001			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	20064	66	7.5	Sensor; Jun. & Newer.....	20064	61-72	6.8-8.2
Service Pack.....	20007	66	7.5	Service Pack; Jun. & Newer.....	20007	61-72	6.8-8.2
<b>2004-2006</b>				<b>2004-2006</b>			
OE Sensor: Nissan - 40700-CD001				OE Sensor: Nissan - 40700-CD001			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	20064	66	7.5	Sensor.....	20064	61-72	6.8-8.2
Service Pack.....	20007	66	7.5	Service Pack.....	20007	61-72	6.8-8.2

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Infiniti (cont'd)</b>				<b>Infiniti (cont'd)</b>			
<b>G35 (cont'd)</b>				<b>M35h</b>			
<b>2007</b>				<b>2012</b>			
OE Sensor: Nissan - 40700-JA01B, 40700-JK00B				OE Sensor: Nissan - 40700-JA01C			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor; Coupe.....	28204	66	7.5	Sensor.....	28204	66	7.5
Sensor; Sedan.....	28210	66	7.5	Service Pack.....	20014	66	7.5
Service Pack.....	20014	66	7.5				
<b>2008</b>				<b>M37</b>			
OE Sensor: Nissan - 40700-JK00B				<b>2011-2012</b>			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Nissan - 40700-JA01C			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28210	66	7.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack.....	20014	66	7.5	Sensor.....	28204	66	7.5
				Service Pack.....	20014	66	7.5
<b>G37</b>				<b>2013</b>			
<b>2008-2010</b>				EZ-Sensor.....	33000 A	11.5	1.3
OE Sensor: Nissan - 40700-JK00B					33500 A, DB	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>M45</b>			
Sensor.....	28210	66	7.5	<b>2003-2004</b>			
Service Pack.....	20014	66	7.5	OE Sensor: Nissan - 40700-CD001			
<b>2011-2013</b>				EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	20064	66	7.5
				Service Pack.....	20007	66	7.5
<b>M35</b>				<b>2006-2007</b>			
<b>2006-2007</b>				OE Sensor: Nissan - 40700-CD001			
OE Sensor: Nissan - 40700-CD001				EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	20064	66	7.5
Sensor.....	20064	66	7.5	Service Pack.....	20007	66	7.5
Service Pack.....	20007	66	7.5	<b>2008-2009</b>			
<b>2008-2010</b>				OE Sensor: Nissan - 40700-CD001			
OE Sensor: Nissan - 40700-JA00C, 40700-JA01C				EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	28204	66	7.5
Sensor.....	28204	66	7.5	Service Pack.....	20014	66	7.5
Service Pack.....	20014	66	7.5	<b>2010</b>			
<b>2011-2012</b>				OE Sensor: Nissan - 40700-JA01C			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Sensor.....	28204	66	7.5
				Service Pack.....	20014	66	7.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Infiniti (cont'd)</b>				<b>Infiniti (cont'd)</b>			
<b>M45 (cont'd)</b>				<b>QX4</b>			
<b>2011</b>				<b>2003</b>			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Nissan - 40700-CD001			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>M56</b>				<b>QX50</b>			
<b>2011-2012</b>				<b>2014-2015</b>			
OE Sensor: Nissan - 40700-JA01C				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	20064	66	7.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack.....	20007	66	7.5
Sensor.....	28204	66	7.5	<b>QX56</b>			
Service Pack.....	20014	66	7.5	<b>2004</b>			
<b>2013</b>				OE Sensor: Nissan - 40700-CK002			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28204	66	7.5	Sensor.....	20069	49	5.5
Service Pack.....	20014	66	7.5	Service Pack.....	20005	49	5.5
<b>Q45</b>				<b>2005-2006</b>			
<b>2002</b>				OE Sensor: Nissan - 40700-CK001, 40700-CK002			
Service Pack.....	20007	66	7.5	EZ-Sensor.....	33000 A	11.5	1.3
<b>2003-2005</b>				EZ-Sensor.....			
OE Sensor: Nissan - 40700-CD001					33500 A, DB	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; W/Alloy Wheels.....	20161	49	5.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor; W/Steel Wheels.....	20069	49	5.5
Sensor.....	20064	66	7.5	Service Pack; W/Alloy Wheels.....	20007	49	5.5
Service Pack.....	20007	66	7.5	Service Pack; W/Steel Wheels.....	20005	49	5.5
<b>2006</b>				<b>2007</b>			
OE Sensor: Nissan - 40700-CD001, 40700-JA01B				OE Sensor: Nissan - 40700-CK001, 40700-JA02B			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor; Aug. & Newer.....	28204	66	7.5	Sensor; Apr. 1 & Newer.....	28204	49	5.5
Sensor; Jul. & Older.....	20064	66	7.5	Sensor; Mar. & Older.....	20161	49	5.5
Service Pack; Aug. & Newer.....	20014	66	7.5	Service Pack; Apr. 1 & Newer.....	20014	49	5.5
Service Pack; Jul. & Older.....	20007	66	7.5	Service Pack; Mar. & Older.....	20007	49	5.5
<b>Q70</b>				<b>2008-2010</b>			
<b>2014-2015</b>				OE Sensor: Nissan - 40700-JA01B, 40700-JA02B			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....			
				20018 C			
				Sensor.....			
				28204			
				Service Pack.....			
				20014			
				<b>2011-2013</b>			
				EZ-Sensor.....			
				33000 A			
				11.5			
				1.3			
				33500 A, DB			
				11.5			
				1.3			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				34000			
				62			
				7			
				EZ-Sensor Service Pack; Rubber Valve.....			
				20018 C			
				11.5			
				1.3			
				Sensor.....			
				28204			
				49			
				5.5			
				Service Pack.....			
				20014			
				49			
				5.5			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Infiniti (cont'd)</b>				<b>Isuzu (cont'd)</b>			
<b>QX70</b>				<b>Rodeo</b>			
2014-2015				2004			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Isuzu - 8973271890			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33100 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3		33200 A	11.5	1.3
<b>QX80</b>					33500 A, DB	11.5	1.3
2014-2015				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	20028 B	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack.....	20003	62	7
<b>Isuzu</b>				<b>Jaguar</b>			
<b>Ascender</b>				<b>Jaguar</b>			
2006-2008				2004-2012			
OE Sensor: Isuzu - 8257740060				OE Sensor: Jaguar - C2C25519, C2C40476, C2C40725, C2S40710, C2Z15016, C2Z15017, XR855949, XR855950			
Sensor.....	20116	62	7	Sensor; W/315 MHz Sensor.....	20090	71	8
Service Pack.....	20004	62	7	Sensor; W/433 MHz Sensor.....	20091	71	8
<b>i-290</b>				Service Pack.....	20030	71	8
2007-2008				<b>Jeep</b>			
OE Sensor: General Motors - 15122618				<b>Cherokee</b>			
EZ-Sensor.....	33000 A	11.5	1.3	2014			
	33500 A, DB	11.5	1.3	OE Sensor: Chrysler - 682397208AA			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28984	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack.....	20635	11.5	1.3
Sensor.....	20131	62	7	<b>2015</b>			
Service Pack.....	20006	62	7	OE Sensor: Chrysler - 68239720AC			
<b>2009</b>				Sensor.....	28984	35	4
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; Rubber Valve.....	20635	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>Commander</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	2006-2007			
<b>i-370</b>				OE Sensor: Chrysler - 56053030AB, 56053036AA			
2007-2008				EZ-Sensor.....	33500 A, DB	11.5	1.3
OE Sensor: General Motors - 15122618				EZ-Sensor: Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28308 F	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor.			
Sensor.....	20131	62	7	Does not include stem.....	20013	58	6.5
Service Pack.....	20006	62	7	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
<b>2009</b>				Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	71	8
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3				

A-Programming Tool Required    B-Magnet may be Required to Activate Sensor    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200  
 F-Supercedes the 20066



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Jeep (cont'd)</b>				<b>Jeep (cont'd)</b>			
<b>Commander (cont'd)</b>				<b>Compass (cont'd)</b>			
<b>2008-2010</b>				<b>2016</b>			
OE Sensor: Chrysler - 56029359AA, 56029359AB				OE Sensor: Chrysler - 56029479AB			
EZ-Sensor.....	33100 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33200 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28308 F	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28434 E	11.5	1.3	<b>Grand Cherokee</b>			
Service Pack; Fits Schrader Alum stem sensor.				<b>2002-2004</b>			
Does not include stem.....	20013	58	6.5	OE Sensor: Chrysler - 52088990AC			
Service Pack; Fits Schrader Sensor; Includes				EZ-Sensor.....			
Stem Only.....	20020	58	6.5		33100 A	11.5	1.3
Service Pack; Rubber Valve.....	20018 C	11.5	1.3		33200 A	11.5	1.3
<b>2011</b>					33500 A, DB	11.5	1.3
EZ-Sensor.....	33100 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
<b>Compass</b>				Sensor.....	20028 B	64	7
<b>2007-2010</b>				Service Pack.....	20003	64	7
OE Sensor: Chrysler - 68001696AA, 68001696AB				<b>2005-2007</b>			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Chrysler - 56053030AB, 68001696AA			
EZ-Sensor; Caution: Ez-sensor will not support				EZ-Sensor.....			
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor; Caution: Ez-sensor will not support			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
Sensor.....	28308 F	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Fits Schrader Alum stem sensor.				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Does not include stem.....	20013	58	6.5	Sensor.....	28308 F	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes				Service Pack; Fits Schrader Alum stem sensor.			
Stem Only.....	20020	58	6.5	Does not include stem.....	20013	58	6.5
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes			
Service Pack; W/Siemens Sensor.....	20030	71	8	Stem Only.....	20020	58	6.5
<b>2011</b>				Service Pack; Rubber Valve.....	20018 C	11.5	1.3
OE Sensor: Chrysler - 68001696AB				Service Pack; W/Siemens Sensor.....	20030	71	8
EZ-Sensor.....	33500 A, DB	11.5	1.3	<b>2008-2010</b>			
EZ-Sensor; Caution: Ez-sensor will not support				OE Sensor: Chrysler - 56029359AB			
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	EZ-Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33100 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3		33200 A	11.5	1.3
Sensor.....	28308 F	11.5	1.3		33500 A, DB	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor.				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Does not include stem.....	20013	58	6.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes				Sensor.....	28434 E	11.5	1.3
Stem Only.....	20020	58	6.5	Service Pack; Fits Schrader Alum stem sensor.			
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Does not include stem.....	20013	58	6.5
<b>2012-2015</b>				Service Pack; Fits Schrader Sensor; Includes			
OE Sensor: Chrysler - 56029481AB, 68001696AB				Stem Only.....	20020	58	6.5
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support				<b>2011-2015</b>			
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	OE Sensor: Chrysler - 56029398AA, 56029398AB			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3		33200 A	11.5	1.3
Sensor.....	28308 F	11.5	1.3		33500 A, DB	11.5	1.3
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Sensor.....	20398	11.5	1.3
				Service Pack.....	20018 C	11.5	1.3

A-Programming Tool Required    B-Magnet may be Required to Activate Sensor    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200  
 E-Supercedes the 28155    F-Supercedes the 20066

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Jeep (cont'd)</b>				<b>Jeep (cont'd)</b>			
<b>Liberty</b>				<b>Patriot</b>			
<b>2002-2004</b>				<b>2007-2010</b>			
OE Sensor: Chrysler - 52088990AC				OE Sensor: Chrysler - 68001696AA, 68001696AB			
EZ-Sensor.....	33100 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33200 A	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support			
	33500 A, DB	11.5	1.3	(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	20028 B	64	7	Sensor.....	28308 F	11.5	1.3
Service Pack.....	20003	64	7	Service Pack; Fits Schrader Alum stem sensor.			
<b>2005-2008</b>				Does not include stem.....			
OE Sensor: Chrysler - 56053036AA, 68001696AB				Service Pack; Fits Schrader Sensor; Includes	20013	58	6.5
EZ-Sensor.....	33500 A, DB	11.5	1.3	Stem Only.....	20020	58	6.5
EZ-Sensor; Caution: Ez-sensor will not support				Service Pack; Rubber Valve.....	20018 C	11.5	1.3
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	71	8
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2011-2012</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	OE Sensor: Chrysler - 68078861AA			
Sensor.....	28308 F	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor.				EZ-Sensor; Caution: Ez-sensor will not support			
Does not include stem.....	20013	58	6.5	(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Stem Only.....	20020	58	6.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	28308 F	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	71	8	Service Pack; Fits Schrader Alum stem sensor.			
<b>2009</b>				Does not include stem.....			
OE Sensor: Chrysler - 56029359AB, 56029465AB				Service Pack; Fits Schrader Sensor; Includes	20013	58	6.5
EZ-Sensor.....	33100 A	11.5	1.3	Stem Only.....	20020	58	6.5
	33200 A	11.5	1.3	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
	33500 A, DB	11.5	1.3	<b>2013-2015</b>			
EZ-Sensor; Caution: Ez-sensor will not support				OE Sensor: Chrysler - 56029479AB, 56029481AB			
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor; Caution: Ez-sensor will not support			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
Sensor; W/315 MHz Snap-in Sensor.....	28308 F	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; W/433 MHz Clamp-in Sensor.....	28434 E	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor.				Sensor; W/315 MHz.....	28308 F	11.5	1.3
Does not include stem.....	20013	58	6.5	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes				<b>2016</b>			
Stem Only.....	20020	58	6.5	OE Sensor: Chrysler - 56029481AB			
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
<b>2010-2012</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: Chrysler - 56029465AB				34000	62	7	
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support				Sensor; W/315 MHz.....	28308 F	11.5	1.3
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>Wrangler</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2007-2008</b>			
Sensor.....	28308 F	11.5	1.3	OE Sensor: Chrysler - 56053036AA			
Service Pack; Fits Schrader Alum stem sensor.				EZ-Sensor.....	33500 A, DB	11.5	1.3
Does not include stem.....	20013	58	6.5	EZ-Sensor; Caution: Ez-sensor will not support			
Service Pack; Fits Schrader Sensor; Includes				(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
Stem Only.....	20020	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200  
E-Supercedes the 28155 F-Supercedes the 20066

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Jeep (cont'd)</b>				<b>Jeep (cont'd)</b>			
<b>Wrangler (cont'd)</b>				<b>Wrangler (cont'd)</b>			
<b>2009</b>				<b>2016</b>			
OE Sensor: Chrysler - 56029359AB				OE Sensor: Chrysler - 68241067AB			
EZ-Sensor.....	33100 A	11.5	1.3	Sensor.....	20398	11.5	1.3
	33200 A	11.5	1.3	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
	33500 A, DB	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3				
Sensor.....	28434 E	11.5	1.3				
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5				
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5				
Service Pack; Rubber Valve.....	20018 C	11.5	1.3				
<b>2010</b>				<b>Kia</b>			
OE Sensor: Chrysler - 56029359AB				<b>Amanti</b>			
EZ-Sensor.....	33200 A	11.5	1.3	<b>2007-2009</b>			
	33500 A, DB	11.5	1.3	OE Sensor: Kia - 529331FA00			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28983	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; Includes Valve.....	20036	35	4
Sensor.....	28434 E	11.5	1.3				
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5				
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5				
Service Pack; Rubber Valve.....	20018 C	11.5	1.3				
<b>2011</b>				<b>Borrego</b>			
OE Sensor: Chrysler - 56029479AA				<b>2009-2011</b>			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Hyundai - 529332F000			
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28308 F	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5	Sensor.....	28849	35	4
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack.....	20022	35	4
Service Pack; Rubber Valve.....	20018 C	11.5	1.3				
<b>2012</b>				<b>Cadenza</b>			
OE Sensor: Chrysler - 56029479AA				<b>2014-2015</b>			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Hyundai - 529332M550, 52933A5000; Kia - 529332M550			
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28308 F	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5	Sensor.....	20092	31-40	3.5-4.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5				
Service Pack; Rubber Valve.....	20018 C	11.5	1.3				
<b>2013-2015</b>				<b>Forte</b>			
OE Sensor: Chrysler - 56029398AB, 68241067AB				<b>2010-2013</b>			
EZ-Sensor.....	33200 A	11.5	1.3	OE Sensor: Hyundai - 529332M000; Kia - 529332M000			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20398	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	20092	31-40	3.5-4.5
				<b>2014-2015</b>			
				OE Sensor: Kia - 52933-A7000			
				Sensor.....	28070		
				<b>2016</b>			
				EZ-Sensor.....	33500 A, DB	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				<b>Forte Koup</b>			
				<b>2010-2013</b>			
				OE Sensor: Hyundai - 529332M000; Kia - 529332M000			
				EZ-Sensor.....	33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Sensor.....	20092	31-40	3.5-4.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200 E-Supercedes the 28155 F-Supercedes the 20066

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Kia (cont'd)</b>				<b>Kia (cont'd)</b>			
<b>Forte Koup (cont'd)</b>				<b>Rio5</b>			
<b>2014</b>				<b>2007-2011</b>			
Sensor	20092	31-40	3.5-4.5	OE Sensor: Hyundai - 529332F000			
<b>Forte5</b>				EZ-Sensor	33000 A	11.5	1.3
<b>2012-2013</b>					33500 A, DB	11.5	1.3
OE Sensor: Hyundai - 529332M000				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor	28849	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack	20022	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>2012</b>			
Sensor	20092	31-40	3.5-4.5	OE Sensor: Hyundai - 529332M000			
<b>Magentis</b>				Sensor	20092	31-40	3.5-4.5
<b>2008</b>				<b>Rondo</b>			
OE Sensor: Hyundai - 52933-2G200				<b>2007-2011</b>			
EZ-Sensor	33000 A	11.5	1.3	OE Sensor: Hyundai - 529332G200			
	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor; Includes Transmitter Only	20086	31-40	3.5-4.5	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack; Includes Valve	20036	31-40	3.5-4.5	Sensor; Includes Transmitter Only	20086	31-40	3.5-4.5
<b>2009</b>				Service Pack; Includes Valve	20036	31-40	3.5-4.5
OE Sensor: Hyundai - 52933-2G200				<b>Sedona</b>			
Sensor; Includes Transmitter Only	20086	31-40	3.5-4.5	<b>2006-2008</b>			
Service Pack; Includes Valve	20036	31-40	3.5-4.5	OE Sensor: Hyundai - 529334D200			
<b>2010</b>				Sensor; Includes Transmitter Only	20085	31-40	3.5-4.5
OE Sensor: Hyundai - 52933-2G200				Service Pack; Includes Valve	20036	31-40	3.5-4.5
EZ-Sensor	33500 A, DB	11.5	1.3	<b>2009-2012</b>			
Sensor; Includes Transmitter Only	20086	31-40	3.5-4.5	OE Sensor: Hyundai - 529332G200			
Service Pack; Includes Valve	20036	31-40	3.5-4.5	EZ-Sensor	33000 A	11.5	1.3
<b>Optima</b>					33500 A, DB	11.5	1.3
<b>2006-2010</b>				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
OE Sensor: Hyundai - 529332G200				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3	Sensor; Includes Transmitter Only	20086	31-40	3.5-4.5
	33500 A, DB	11.5	1.3	Service Pack; Includes Valve	20036	31-40	3.5-4.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>2013</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
Sensor; Includes Transmitter Only	20086	31-40	3.5-4.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; Includes Valve	20036	31-40	3.5-4.5	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
<b>2011-2015</b>				<b>2015-2016</b>			
OE Sensor: Kia - 52933-2M000, 529332M000				OE Sensor: Kia - 52933-B2100			
EZ-Sensor	33000 A	11.5	1.3	Sensor	20218	11.5	1.3
	33500 A, DB	11.5	1.3	Service Pack; Rubber Valve	20046	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>Sorento</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>2007-2009</b>			
Sensor	20092	31-40	3.5-4.5	OE Sensor: Kia - 529331FA00			
<b>Rio</b>				Sensor	28983	35	4
<b>2007-2011</b>				Service Pack; Includes Valve	20036	35	4
OE Sensor: Hyundai - 529332F000				<b>2011-2014</b>			
EZ-Sensor	33000 A	11.5	1.3	OE Sensor: Kia - 529332M000; Original Equipment Manufacturer - 529332M00			
	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	28849	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack	20022	35	4	Sensor	20092	31-40	3.5-4.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Kia (cont'd)</b>				<b>Kia (cont'd)</b>			
<b>Sorento (cont'd)</b>				<b>Spectra5 (cont'd)</b>			
<b>2015</b>				<b>2007-2009</b>			
OE Sensor: Kia - 52933-2M550				OE Sensor: Hyundai - 529332F000			
Sensor.....	20092	31-40	3.5-4.5	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
					33500 <sup>A, DB</sup>	11.5	1.3
<b>Soul</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
<b>2010-2013</b>				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Kia - 529332M000, 529332M001				Sensor.....	28849	35	4
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Service Pack.....	20022	35	4
	33500 <sup>A, DB</sup>	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>Sportage</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>2005</b>			
Sensor.....	20092	31-40	3.5-4.5	OE Sensor: Hyundai - 529331FA00			
<b>2014</b>				Sensor; Jun. 15, 2005 & Newer.....	28983	35	4
OE Sensor: Kia - 52933-B2100				Service Pack; Jun. 15, 2005 & Newer; Includes			
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	Valve.....	20036	31-40	3.5-4.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2006-2008</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	OE Sensor: Hyundai - 529331FA00; Kia - 529331FA00			
Sensor.....	20218	11.5	1.3	Sensor.....	28983	35	4
Service Pack.....	20046	11.5	1.3	Service Pack; Includes Valve.....	20036	31-40	3.5-4.5
<b>2015</b>				<b>2009-2012</b>			
OE Sensor: Kia - 52933-B2100				OE Sensor: Kia - 529332F000			
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20218	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; Rubber Valve.....	20046	11.5	1.3	Sensor.....	28849	35	4
<b>2016</b>				Service Pack.....	20022	35	4
OE Sensor: Kia - 52933-B2100				<b>2013</b>			
Sensor.....	20218	11.5	1.3	OE Sensor: Kia - 529332F000			
Service Pack; Rubber Valve.....	20046	11.5	1.3	EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
<b>Spectra</b>				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2006</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
OE Sensor: Hyundai - 529332F000				Sensor.....	28849	35	4
Sensor.....	28849	35	4	Service Pack.....	20022	35	4
Service Pack.....	20022	35	4	<b>2014-2015</b>			
<b>2007-2009</b>				OE Sensor: Hyundai - 529332S500			
OE Sensor: Hyundai - 529332F000				EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28500		
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>2016</b>			
Sensor.....	28849	35	4	EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
Service Pack.....	20022	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2010-2011</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	<b>Lamborghini</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>Aventador</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>2011</b>			
<b>Spectra5</b>				OE Sensor: Volkswagen - 4F0 907 275			
<b>2006</b>				Sensor.....	20078		
OE Sensor: Hyundai - 529332F000							
Sensor.....	28849	35	4				
Service Pack.....	20022	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Land Rover</b>				<b>Land Rover (cont'd)</b>			
<b>LR2</b>				<b>Range Rover (cont'd)</b>			
2008-2015				2003-2005			
OE Sensor: Land Rover - LR021936, LR032833, LR066378				OE Sensor: Land Rover - YBD000061			
Sensor	20090	71	8	EZ-Sensor	33100 A	11.5	1.3
Service Pack	20030	71	8		33200 A	11.5	1.3
					33500 A, DB	11.5	1.3
<b>LR3</b>				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
2002-2005				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
OE Sensor: Land Rover - YBD000060				Sensor; Includes Transmitter Only	28082	58	6.5
EZ-Sensor	33100 A	11.5	1.3	Service Pack; Does Not Include Valve	20023	58	6.5
	33200 A	11.5	1.3	Service Pack; W/43mm Silver Insert	20037	58	6.5
	33500 A, DB	11.5	1.3	Service Pack; W/48mm Green Insert	20038	58	6.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/49mm Black Insert	20039	58	6.5
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Service Pack; W/51mm Orange Insert	20040	58	6.5
Sensor; Includes Transmitter Only	28082	58	6.5	<b>2006-2011</b>			
Service Pack; Does Not Include Valve	20023	58	6.5	OE Sensor: Land Rover - LR010532, LR010533, LR018860,			
Service Pack; W/43mm Silver Insert	20037	58	6.5	LR018861, LR0500461, ROH500471			
Service Pack; W/48mm Green Insert	20038	58	6.5	Sensor; W/315 MHz Sensor	20090	71	8
Service Pack; W/49mm Black Insert	20039	58	6.5	Sensor; W/433 MHz Sensor	20091	71	8
Service Pack; W/51mm Orange Insert	20040	58	6.5	Service Pack	20030	71	8
<b>2006-2009</b>				<b>2012-2014</b>			
OE Sensor: Land Rover - LR010532, LR010533, LR018860,				OE Sensor: Land Rover - LR0031713, LR021936			
LR018861, LR0500461, ROH500471				Sensor	20090	71	8
Sensor; W/315 MHz Sensor	20090	71	8	Service Pack	20030	71	8
Sensor; W/433 MHz Sensor	20091	71	8	<b>Range Rover Evoque</b>			
Service Pack	20030	71	8	2012-2015			
<b>LR4</b>				OE Sensor: Land Rover - LR0031713, LR021936			
2010-2011				Sensor	20090	71	8
OE Sensor: Land Rover - LR018860, LR018861				Service Pack	20030	71	8
Sensor; W/315 MHz Sensor	20090	71	8	<b>Range Rover Sport</b>			
Sensor; W/433 MHz Sensor	20091	71	8	2006-2011			
Service Pack	20030	71	8	OE Sensor: Land Rover - LR010532, LR010533, LR018860,			
<b>2012-2014</b>				LR018861, LR0500461, ROH500471			
OE Sensor: Land Rover - LR021936, LR032833				Sensor; W/315 MHz Sensor	20090	71	8
Sensor	20090	71	8	Sensor; W/433 MHz Sensor	20091	71	8
Service Pack	20030	71	8	Service Pack	20030	71	8
<b>Range Rover</b>				<b>2012-2014</b>			
2002				OE Sensor: Land Rover - LR021936, LR031713			
OE Sensor: Land Rover - YBD000061				Sensor	20090	71	8
Sensor; Includes Transmitter Only	28082	58	6.5	Service Pack	20030	71	8
Service Pack; Does Not Include Valve	20023	58	6.5	<b>Lexus</b>			
Service Pack; W/43mm Silver Insert	20037	58	6.5	<b>CT200h</b>			
Service Pack; W/48mm Green Insert	20038	58	6.5	2011			
Service Pack; W/49mm Black Insert	20039	58	6.5	OE Sensor: Toyota - 4260733021			
Service Pack; W/51mm Orange Insert	20040	58	6.5	EZ-Sensor	33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
				Sensor	28370	35	4
				Service Pack	20032	35	4

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Lexus (cont'd)</b>				<b>Lexus (cont'd)</b>			
<b>CT200h (cont'd)</b>				<b>GS350</b>			
<b>2012-2015</b>				<b>2007-2011</b>			
OE Sensor: Toyota - 4260733021				OE Sensor: Toyota - 4260733021			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28370	35	4	Sensor.....	28370	35	4
Service Pack.....	20032	35	4	Service Pack.....	20032	35	4
<b>ES300h</b>				<b>2013</b>			
<b>2013</b>				OE Sensor: Toyota - 4260733021			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28370	35	4	Sensor.....	28370	35	4
Service Pack.....	20032	35	4	Service Pack.....	20032	35	4
<b>2014-2015</b>				<b>2014-2016</b>			
OE Sensor: Toyota - 4260730060, 4260733021				OE Sensor: Toyota - 42607-30060, 4260730060			
Sensor.....	28370	35	4	EZ-Sensor; For use with 433 MHz sensor			
Service Pack.....	20032	35	4	42607-30070.....	33500 <sup>A, DB</sup>	11.5	1.3
<b>ES350</b>				<b>2014-2016</b>			
<b>2007-2013</b>				OE Sensor: Toyota - 42607-30060, 4260730060			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor; For use with 433 MHz sensor			
	33500 <sup>A, DB</sup>	11.5	1.3	42607-30070.....	33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28370	35	4	Sensor; 315 MHz.....	28370	35	4
Service Pack.....	20032	35	4	Service Pack.....	20032	62	7
<b>GS300</b>				<b>2014-2016</b>			
<b>2006</b>				OE Sensor: Toyota - 4260730030, 4260733021			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28335	35	4	Sensor; Jul. & Newer.....	28370	35	4
Service Pack.....	20031	35	4	Sensor; Jun. & Older.....	28335	35	4
<b>2007-2011</b>				<b>2006</b>			
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>GS430</b>				<b>2005</b>			
<b>2005</b>				OE Sensor: Toyota - 4260730030			
OE Sensor: Toyota - 4260730030				EZ-Sensor.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28335	35	4	Sensor.....	28335	35	4
Service Pack.....	20031	35	4	Service Pack.....	20031	35	4
<b>2006</b>				<b>2007</b>			
OE Sensor: Toyota - 4260730030, 4260733021				OE Sensor: Toyota - 4260730030			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor; Jul. & Newer.....	28370	35	4	Sensor.....	28370	35	4
Sensor; Jun. & Older.....	28335	35	4	Service Pack.....	20032	35	4
Service Pack; Jul. & Newer.....	20032	35	4	Service Pack; Jun. & Older.....	20031	35	4
Service Pack; Jun. & Older.....	20031	35	4	<b>2007</b>			
<b>2007</b>				OE Sensor: Toyota - 4260733021			
OE Sensor: Toyota - 4260733021				EZ-Sensor.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28370	35	4	Sensor.....	28370	35	4
Service Pack.....	20032	35	4	Service Pack.....	20032	35	4

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Lexus (cont'd)</b>				<b>Lexus (cont'd)</b>			
<b>GS450h</b>				<b>GX470</b>			
2007-2011				2004-2005			
OE Sensor: Toyota - 4260733021				OE Sensor: Toyota - 4260735010			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28370	35	4	Sensor	28345	35	4
Service Pack	20032	35	4	Service Pack	20031	35	4
2013-2016				2006			
OE Sensor: Toyota - 4260730060, 4260730600, 4260733021				OE Sensor: Toyota - 4260730030, 4260733011, 4260735010			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28370	35	4	Sensor; Feb. & Newer; W/O Valve Cap	28335	35	4
Service Pack	20032	35	4	Sensor; Feb. & Newer; W/Valve Cap	28365	35	4
				Sensor; Jan. 31 & Older			
				Service Pack; Feb. & Newer			
				Service Pack; Jan. 31 & Older			
				2007-2009			
OE Sensor: Toyota - 4260733021				OE Sensor: Toyota - 4260733021			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28370	35	4	Sensor	28370	35	4
Service Pack	20032	35	4	Service Pack	20032	35	4
2012-2016				<b>HS250h</b>			
OE Sensor: Toyota - 4260730600, 4260733021				2010-2012			
EZ-Sensor	33500 A, DB	11.5	1.3	OE Sensor: Toyota - 4260775010			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor			
Sensor	28370	35	4	EZ-Sensor Service Pack; Aluminium Valve			
Service Pack	20032	35	4	EZ-Sensor Service Pack; Rubber Valve			
2016				Sensor			
EZ-Sensor				Service Pack			
EZ-Sensor				EZ-Sensor			
EZ-Sensor Service Pack; Aluminium Valve				EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor Service Pack; Rubber Valve				EZ-Sensor Service Pack; Rubber Valve			
				Sensor			
				Service Pack			
				<b>IS F</b>			
				2008-2015			
				OE Sensor: Toyota - 4260733021			
				EZ-Sensor			
				EZ-Sensor Service Pack; Aluminium Valve			
				EZ-Sensor Service Pack; Rubber Valve			
				Sensor			
				Service Pack			
				2016			
				OE Sensor: Toyota - 4260733021			
				EZ-Sensor			
				EZ-Sensor Service Pack; Aluminium Valve			
				EZ-Sensor Service Pack; Rubber Valve			
				Sensor			
				Service Pack			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Lexus (cont'd)</b>				<b>Lexus (cont'd)</b>			
<b>IS250</b>				<b>IS350 (cont'd)</b>			
<b>2006</b>				<b>2016</b>			
OE Sensor: Toyota - 4260730030, 4260733021				OE Sensor: Toyota - 4260733021			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	28370	35	4
Sensor; Apr. 1 & Newer.....	28370	35	4	Service Pack.....	20032	35	4
Sensor; Mar. & Older.....	28335	35	4				
Service Pack; Apr. 1 & Newer.....	20032	35	4	<b>LFA</b>			
Service Pack; Mar. & Older.....	20031	35	4	<b>2012</b>			
<b>2007</b>				OE Sensor: Toyota - 4260733021			
OE Sensor: Toyota - 4260733021				EZ-Sensor.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3		33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; C; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; exc C; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	28370	35	4
Sensor.....	28370	35	4	Service Pack.....	20032	35	4
Service Pack.....	20032	35	4	<b>2013-2015</b>			
<b>2008-2015</b>				EZ-Sensor.....			
OE Sensor: Toyota - 4260733021							
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	28370	35	4
Sensor.....	28370	35	4	Service Pack.....	20032	35	4
Service Pack.....	20032	35	4	<b>2016</b>			
<b>2016</b>				OE Sensor: Toyota - 4260733021			
OE Sensor: Toyota - 4260730060				EZ-Sensor.....			
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28370	35	4	Sensor.....	28370	35	4
Service Pack.....	20032	35	4	Service Pack.....	20032	35	4
<b>IS350</b>				<b>LS430</b>			
<b>2006</b>				<b>2004-2006</b>			
OE Sensor: Toyota - 4260730030, 4260733021				Sensor.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3		INDIRECT <sup>D</sup>		
	33500 <sup>A, DB</sup>	11.5	1.3	<b>LS460</b>			
EZ-Sensor Service Pack.....	20018 <sup>C</sup>	11.5	1.3	<b>2007-2015</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Toyota - 4260733021			
Sensor; Apr. 1 & Newer.....	28370	35	4	EZ-Sensor.....			
Sensor; Mar. & Older.....	28335	35	4		33000 <sup>A</sup>	11.5	1.3
Service Pack; Apr. 1 & Newer.....	20032	35	4		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; Mar. & Older.....	20031	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2007-2015</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
OE Sensor: Toyota - 4260733021				Sensor.....	28370	35	4
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Service Pack.....	20032	35	4
	33500 <sup>A, DB</sup>	11.5	1.3	<b>2016</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Toyota - 4260706020			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor.....			
Sensor.....	28370	35	4		33000 <sup>A</sup>	11.5	1.3
Service Pack.....	20032	35	4		33500 <sup>A, DB</sup>	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
				Sensor.....	28360	35	4
				Service Pack.....	20032	35	4

A-Programming Tool Required    C-20018 and 20008 are interchangeable.    D-Indirect TPMS system. No sensor in wheel    DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Lexus (cont'd)</b>				<b>Lexus (cont'd)</b>			
<b>LS600h</b>				<b>LX570 (cont'd)</b>			
2008-2016				2015			
OE Sensor: Toyota - 4260730600, 4260733021				EZ-Sensor: . . . . .	33000 A	11.5	1.3
EZ-Sensor: . . . . .	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	2016			
Sensor: . . . . .	28370	35	4	OE Sensor: Toyota - 4260733021			
Service Pack: . . . . .	20032	35	4	EZ-Sensor: . . . . .	33500 A, DB	11.5	1.3
<b>LX470</b>				EZ-Sensor Service Pack; Aluminium Valve. . . . .			
2005				34000			
OE Sensor: Toyota - 4260733011				EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
EZ-Sensor: . . . . .	33000 A	11.5	1.3	Sensor: . . . . .	28365	35	4
	33500 A, DB	11.5	1.3	Service Pack: . . . . .	20031	35	4
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	<b>RX330</b>			
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	2004-2005			
Sensor: . . . . .	28365	35	4	Sensor: . . . . .	INDIRECT D		
Service Pack: . . . . .	20031	35	4	2006			
2006				OE Sensor: Toyota - 4260733021			
OE Sensor: Toyota - 4260733011, 4260733021				EZ-Sensor: . . . . .	33000 A	11.5	1.3
EZ-Sensor: . . . . .	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	Sensor; Models made in Japan; Feb. & Newer. . . . .	28370	35	4
Sensor; Aug. & Newer. . . . .	28370	35	4	Service Pack; Feb. & Newer. . . . .	20032	35	4
Sensor; Jul. & Older. . . . .	28365	35	4	Service Pack; Jan. 31 & Older. . . . .	20031	35	4
Service Pack; Aug. & Newer. . . . .	20032	35	4	<b>RX350</b>			
Service Pack; Jul. & Older. . . . .	20031	35	4	2007-2010			
2007				OE Sensor: Toyota - 4260733021			
OE Sensor: Toyota - 4260733021				EZ-Sensor: . . . . .	33000 A	11.5	1.3
EZ-Sensor: . . . . .	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	Sensor; Models made in Japan. . . . .	28370	35	4
Sensor: . . . . .	28370	35	4	Service Pack: . . . . .	20032	35	4
Service Pack: . . . . .	20032	35	4	2011-2012			
<b>LX570</b>				OE Sensor: Toyota - 426070E011, 4260733021			
2008-2011				EZ-Sensor: . . . . .			
OE Sensor: Toyota - 4260733021					33000 A	11.5	1.3
EZ-Sensor: . . . . .	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	Sensor: . . . . .	28370	35	4
Sensor: . . . . .	28370	35	4	Service Pack: . . . . .	20032	35	4
Service Pack: . . . . .	20032	35	4	2013			
2013-2014				OE Sensor: Toyota - 426070E011			
OE Sensor: Toyota - 4260733021				EZ-Sensor; exc F Sport. . . . .	33000 A	11.5	1.3
EZ-Sensor: . . . . .	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; exc F Sport; Aluminium Valve. . . . .	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor Service Pack; exc F Sport; Rubber Valve. . . . .	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	Sensor; exc F Sport. . . . .	28370	35	4
Sensor: . . . . .	28370	35	4	Service Pack; exc F Sport. . . . .	20032	35	4
Service Pack: . . . . .	20032	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.		
<b>Lexus (cont'd)</b>				<b>Lexus (cont'd)</b>					
<b>RX350 (cont'd)</b>				<b>SC430 (cont'd)</b>					
<b>2014-2015</b>				<b>2006</b>					
OE Sensor: Toyota - 4260733021				OE Sensor: Toyota - 4260724010, 4260724020, 4260724030, 4260724040, 4260733021					
EZ-Sensor; exc F Sport	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3		
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3		
EZ-Sensor Service Pack; exc F Sport; Aluminium Valve				EZ-Sensor Service Pack; Aluminium Valve					
	34000	62	7		34000	62	7		
EZ-Sensor Service Pack; exc F Sport; Rubber Valve				EZ-Sensor Service Pack; Rubber Valve					
	20018 C	11.5	1.3		20018 C	11.5	1.3		
Sensor; F Sport; Vehicle Made for Canada				Sensor; Aug. & Newer					
	28370	35	4		28370	27	3		
Service Pack				Sensor; W/Blue I.D. Mark; Jul. & Older					
	20032	35	4		28315	27	3		
				Sensor; W/Gold I.D. Mark; Jul. & Older					
				28325				27	3
				Sensor; W/Red I.D. Mark; Jul. & Older					
				28320				27	3
				Sensor; W/White I.D. Mark; Jul. & Older					
				28310				27	3
				Service Pack; Aug. & Newer					
				20032				27	3
				<b>2007-2010</b>					
OE Sensor: Toyota - 4260733021				OE Sensor: Toyota - 4260733021					
Sensor	28370	35	4	EZ-Sensor	33000 A	11.5	1.3		
Service Pack	20032	35	4		33500 A, DB	11.5	1.3		
<b>2007-2008</b>				EZ-Sensor Service Pack; Aluminium Valve					
OE Sensor: Toyota - 4260733021				34000				62	7
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve					
	33500 A, DB	11.5	1.3	20018 C				11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve				Sensor					
	34000	62	7	28370				27	3
EZ-Sensor Service Pack; Rubber Valve				Service Pack					
	20018 C	11.5	1.3	20032				27	3
Sensor; Models made in Japan									
	28370	35	4						
Service Pack									
	20032	35	4						
<b>2009-2012</b>									
EZ-Sensor				33500 A, DB				11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve				34000				62	7
EZ-Sensor Service Pack; Rubber Valve				20018 C				11.5	1.3
<b>RX450h</b>									
<b>2010-2013</b>									
OE Sensor: Toyota - 4260733021									
EZ-Sensor	33000 A	11.5	1.3						
	33500 A, DB	11.5	1.3						
EZ-Sensor Service Pack; Aluminium Valve									
	34000	62	7						
EZ-Sensor Service Pack; Rubber Valve									
	20018 C	11.5	1.3						
Sensor									
	28370	35	4						
Service Pack									
	20032	35	4						
<b>2014-2015</b>									
OE Sensor: Toyota - 4260733021									
Sensor	28370	35	4						
Service Pack	20032	35	4						
<b>SC430</b>									
<b>2002-2005</b>									
OE Sensor: Toyota - 4260724010, 4260724020, 4260724030, 4260724040									
Sensor; W/Blue I.D. Mark	28315	27	3						
Sensor; W/Gold I.D. Mark	28325	27	3						
Sensor; W/Red I.D. Mark	28320	27	3						
Sensor; W/White I.D. Mark	28310	27	3						
				<b>Lincoln</b>					
				<b>Aviator</b>					
				<b>2003-2005</b>					
				OE Sensor: Ford Motor Company - 4L2Z 1A150 BA					
				EZ-Sensor					
				33100 A				11.5	1.3
				33200 A				11.5	1.3
				33500 A, DB				11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve					
				34000				62	7
				EZ-Sensor Service Pack; Rubber Valve					
				20018 C				11.5	1.3
				Sensor					
				20096 B				44	5
				Service Pack					
				20002				44	5
				<b>Mark LT</b>					
				<b>2007-2008</b>					
				OE Sensor: Ford Motor Company - 6F2Z1A189A					
				EZ-Sensor					
				33000 A				11.5	1.3
				33500 A, DB				11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve					
				34000				62	7
				EZ-Sensor Service Pack; Rubber Valve					
				20018 C				11.5	1.3
				Sensor					
				28385				27	3
				Sensor Clip					
				22100					
				Sensor Cradle					
				22101					
				Universal Band					
				22102					
				<b>2013-2014</b>					
				OE Sensor: Ford Motor Company - DE8T1A180AA					
				EZ-Sensor					
				33000 A				11.5	1.3
				33500 A, DB				11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve					
				34000				62	7
				EZ-Sensor Service Pack; Rubber Valve					
				20018 C				11.5	1.3
				Sensor					
				20315				11.5	1.3
				Service Pack; Rubber Valve					
				20018 C				11.5	1.3

A-Programming Tool Required    B-Magnet may be Required to Activate Sensor    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Lincoln (cont'd)</b>				<b>Lincoln (cont'd)</b>			
<b>Mark LT (cont'd)</b>				<b>MKT (cont'd)</b>			
2015-2016				2011-2016			
OE Sensor: Ford Motor Company - F2GT-1A180-AB				OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-10A-180-AA, DE8T-1A180-AA, DE8T1A180AA			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	20280	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	20315	11.5	1.3
<b>MKC</b>				<b>MKX</b>			
2015				2007-2008			
OE Sensor: Ford Motor Company - 9L3Z1A189A				OE Sensor: Ford Motor Company - 6F2Z1A189A, 7L1Z1A189A			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	20315	11.5	1.3	Sensor; W/Chrome Plated Almm. Wheels	28385	27	3
Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor; W/O Chrome Plated Almm. Wheels	28390	27	3
<b>MKS</b>				Sensor Clip			
2009-2010				22100			
OE Sensor: Ford Motor Company - 7L1Z1A189A				Sensor Cradle			
EZ-Sensor	33000 A	11.5	1.3	22101			
	33500 A, DB	11.5	1.3	Universal Band			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	22102			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>2009-2010</b>			
Sensor	28390	27	3	OE Sensor: Ford Motor Company - 7L1Z1A189A			
Sensor Clip	22100			EZ-Sensor	33000 A	11.5	1.3
Sensor Cradle	22101			EZ-Sensor	33500 A, DB	11.5	1.3
Universal Band	22102			EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
<b>2011-2015</b>				EZ-Sensor Service Pack; Rubber Valve			
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA				20018 C			
EZ-Sensor	33000 A	11.5	1.3	Sensor			
	33500 A, DB	11.5	1.3	28390			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor Clip			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	22100			
Sensor	20315	11.5	1.3	Sensor Cradle			
Service Pack; Rubber Valve	20018 C	11.5	1.3	22101			
<b>2016</b>				Universal Band			
OE Sensor: Ford Motor Company - F2GT-1A180-AB				22102			
EZ-Sensor	33500 A, DB	11.5	1.3	<b>2011-2014</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor			
Sensor	20315	11.5	1.3	33000 A			
Service Pack; Rubber Valve	20018 C	11.5	1.3	33500 A, DB			
<b>2015-2016</b>				EZ-Sensor Service Pack; Aluminium Valve			
OE Sensor: Ford Motor Company - F2GT-1A180-AB				34000			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	20018 C			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor			
Sensor	20280	11.5	1.3	20315			
Service Pack; Rubber Valve	20018 C	11.5	1.3	Service Pack; Rubber Valve			
<b>MKT</b>				20018 C			
2010				11.5			
OE Sensor: Ford Motor Company - 7L1Z1A189A				1.3			
EZ-Sensor	33000 A	11.5	1.3	20018 C			
	33500 A, DB	11.5	1.3	11.5			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	1.3			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	20280			
Sensor	28390	27	3	11.5			
Sensor Clip	22100			1.3			
Sensor Cradle	22101			20018 C			
Universal Band	22102			11.5			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Lincoln (cont'd)</b>				<b>Lincoln (cont'd)</b>			
<b>MKZ</b>				<b>Navigator (cont'd)</b>			
<b>2007-2009</b>				<b>2011-2015</b>			
OE Sensor: Ford Motor Company - 6F2Z1A189A				OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28385	27	3	Sensor.....	20315	11.5	1.3
Sensor Clip.....	22100			Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor Cradle.....	22101			<b>2016</b>			
Universal Band.....	22102			EZ-Sensor.....	33500 A, DB	11.5	1.3
<b>2010-2015</b>				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, CM5T-1A180-AA, DE8T-1A180-AA, DE8T1A180AA				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	Sensor.....	20315	11.5	1.3
	33500 A, DB	11.5	1.3	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>Town Car</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2006-2010</b>			
Sensor.....	20315	11.5	1.3	OE Sensor: Ford Motor Company - 6F2Z1A189A			
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
<b>2016</b>					33500 A, DB	11.5	1.3
OE Sensor: Ford Motor Company - DE8T1A180AA				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28385	27	3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor Clip.....	22100		
Sensor.....	20315	11.5	1.3	Sensor Cradle.....	22101		
Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Universal Band.....	22102		
<b>Navigator</b>				<b>2011</b>			
<b>2003-2004</b>				OE Sensor: Ford Motor Company - 9L3Z1A189A			
OE Sensor: Ford Motor Company - 4L2Z 1A150 BA				EZ-Sensor.....			
EZ-Sensor.....	33100 A	11.5	1.3		33000 A	11.5	1.3
	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	20315	11.5	1.3
Sensor.....	20096 B	44	5	Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack.....	20002	44	5	<b>Zephyr</b>			
<b>2005-2006</b>				<b>2006</b>			
OE Sensor: Ford Motor Company - 5L1Z 1A150 AA				OE Sensor: Ford Motor Company - 6F2Z1A189A			
Sensor.....	20135 B	44	5	EZ-Sensor.....	33000 A	11.5	1.3
Service Pack.....	20002	44	5		33500 A, DB	11.5	1.3
<b>2007-2010</b>				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: Ford Motor Company - 7L1Z1A189A				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	Sensor.....	28385	27	3
	33500 A, DB	11.5	1.3	Sensor Clip.....	22100		
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor Cradle.....	22101		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Universal Band.....	22102		
Sensor.....	28390	27	3	<b>Lotus</b>			
Sensor Clip.....	22100			<b>Elise</b>			
Sensor Cradle.....	22101			<b>2008</b>			
Universal Band.....	22102			OE Sensor: Original Equipment Manufacturer - 13227143			
				Sensor.....	20159	88	10
				Service Pack.....	20009	88	10

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Lotus (cont'd)</b>				<b>Maserati (cont'd)</b>			
<b>Elise (cont'd)</b>				<b>GranTurismo</b>			
<b>2009</b>				<b>2014</b>			
OE Sensor: Original Equipment Manufacturer - 13227143				OE Sensor: Original Equipment Manufacturer - 282189			
Sensor . . . . .	20159			Sensor; Does Not Include Valve . . . . .	20078	35	4
Service Pack . . . . .	20009	88	10	Service Pack; W/43mm Silver Insert . . . . .	20037	35	4
<b>2010-2015</b>				Service Pack; W/48mm Green Insert . . . . .	20038	35	4
OE Sensor: Original Equipment Manufacturer - 12825085, 13227143				Service Pack; W/49mm Black Insert . . . . .	20039	35	4
Sensor . . . . .	20159	88	10	Service Pack; W/51mm Orange Insert . . . . .	20040	35	4
Service Pack . . . . .	20009	88	10	<b>2015</b>			
<b>Evora</b>				OE Sensor: Original Equipment Manufacturer - 282189			
<b>2010</b>				Sensor . . . . .	20078	35	4
OE Sensor: Original Equipment Manufacturer - 13227143				<b>Quattroporte</b>			
Sensor . . . . .	20159			<b>2004-2008</b>			
Service Pack . . . . .	20009	88	10	OE Sensor: Original Equipment Manufacturer - 185189			
<b>2011-2013</b>				EZ-Sensor . . . . .	33100 A	11.5	1.3
OE Sensor: Original Equipment Manufacturer - 12825085					33200 A	11.5	1.3
Sensor . . . . .	20159	88	10		33500 A, DB	11.5	1.3
Service Pack . . . . .	20009	88	10	EZ-Sensor Service Pack; Aluminium Valve . . . . .	34000	62	7
<b>2014</b>				EZ-Sensor Service Pack; Rubber Valve . . . . .	20018 C	11.5	1.3
Service Pack . . . . .	20009	88	10	Sensor; Includes Transmitter Only . . . . .	20077	35	4
<b>2015</b>				Service Pack; Does Not Include Valve . . . . .	20023	35	4
OE Sensor: Original Equipment Manufacturer - 12825085				Service Pack; W/43mm Silver Insert . . . . .	20037	35	4
Sensor . . . . .	20159	88	10	Service Pack; W/48mm Green Insert . . . . .	20038	35	4
Service Pack . . . . .	20009	88	10	Service Pack; W/49mm Black Insert . . . . .	20039	35	4
<b>Exige</b>				Service Pack; W/51mm Orange Insert . . . . .	20040	35	4
<b>2008-2015</b>				<b>2014-2015</b>			
OE Sensor: Original Equipment Manufacturer - 12825085, 13227143				OE Sensor: Original Equipment Manufacturer - 670002790			
Sensor . . . . .	20159	88	10	Sensor . . . . .	20284	71	8
Service Pack . . . . .	20009	88	10	Service Pack . . . . .	20047	71	8
<b>Maserati</b>				<b>Spyder</b>			
<b>Coupe</b>				<b>2004-2006</b>			
<b>2004-2006</b>				Service Pack; Does Not Include Valve . . . . .	20023	35	4
Service Pack; Does Not Include Valve . . . . .	20023	35	4	Service Pack; W/43mm Silver Insert . . . . .	20037	35	4
Service Pack; W/43mm Silver Insert . . . . .	20037	35	4	Service Pack; W/48mm Green Insert . . . . .	20038	35	4
Service Pack; W/48mm Green Insert . . . . .	20038	35	4	Service Pack; W/49mm Black Insert . . . . .	20039	35	4
Service Pack; W/49mm Black Insert . . . . .	20039	35	4	Service Pack; W/51mm Orange Insert . . . . .	20040	35	4
Service Pack; W/51mm Orange Insert . . . . .	20040	35	4	<b>Maybach</b>			
<b>Ghibli</b>				<b>57,62</b>			
<b>2014-2015</b>				<b>2003-2011</b>			
OE Sensor: Original Equipment Manufacturer - 670002790				OE Sensor: Volkswagen - 4D0907275D			
EZ-Sensor . . . . .	33500 A, DB	11.5	1.3	EZ-Sensor . . . . .	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve . . . . .	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve . . . . .	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve . . . . .	34000	62	7
Sensor . . . . .	20284	71	8	EZ-Sensor Service Pack; Rubber Valve . . . . .	20018 C	11.5	1.3
Service Pack . . . . .	20047	71	8	Sensor; Includes Transmitter Only . . . . .	20079	35	4
<b>2016</b>							
EZ-Sensor . . . . .	33500 A, DB	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve . . . . .	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve . . . . .	20018 C	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mazda</b>				<b>Mazda (cont'd)</b>			
<b>2</b>				<b>6 (cont'd)</b>			
2011-2013				2014-2016			
OE Sensor: Mazda - BBM237140B, GN3A37140B				Sensor..... INDIRECT <sup>D</sup>			
EZ-Sensor..... 33500 <sup>A, DB</sup>							
EZ-Sensor Service Pack..... 20018 <sup>C</sup>							
34000							
Sensor..... 20093      71      8							
<b>3</b>				<b>B2300</b>			
2004				2007-2009			
OE Sensor: Mazda - GN3A37140B				OE Sensor: Ford Motor Company - 6F2Z1A189A; Mazda - 6F2Z1A189A			
Sensor..... 20093      71      8				EZ-Sensor..... 33000 <sup>A</sup> 11.5      1.3			
				33500 <sup>A, DB</sup> 11.5      1.3			
2005-2012				EZ-Sensor Service Pack; Aluminium Valve..... 34000      62      7			
OE Sensor: Mazda - GN3A37140B				EZ-Sensor Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5      1.3			
EZ-Sensor..... 33500 <sup>A, DB</sup>				Sensor..... 28385      27      3			
EZ-Sensor Service Pack..... 20018 <sup>C</sup>				Sensor Clip..... 22100			
34000				Sensor Cradle..... 22101			
Sensor..... 20093      71      8				Universal Band..... 22102			
<b>2013</b>				<b>B3000</b>			
OE Sensor: Mazda - BBM2-37-140B				2007-2008			
Sensor..... 20093      71      8				OE Sensor: Mazda - 6F2Z1A189A			
2014-2015				EZ-Sensor..... 33000 <sup>A</sup> 11.5      1.3			
Sensor..... INDIRECT <sup>D</sup>				33500 <sup>A, DB</sup> 11.5      1.3			
				EZ-Sensor Service Pack; Aluminium Valve..... 34000      62      7			
				EZ-Sensor Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5      1.3			
				Sensor..... 28385      27      3			
				Sensor Clip..... 22100			
				Sensor Cradle..... 22101			
				Universal Band..... 22102			
<b>5</b>				<b>B4000</b>			
2006-2010				2007-2009			
OE Sensor: Mazda - GN3A37140B				OE Sensor: Ford Motor Company - ZZDA-37-140; Mazda - 6F2Z1A189A			
EZ-Sensor..... 33500 <sup>A, DB</sup>				EZ-Sensor..... 33000 <sup>A</sup> 11.5      1.3			
EZ-Sensor Service Pack..... 20018 <sup>C</sup>				33500 <sup>A, DB</sup> 11.5      1.3			
34000				EZ-Sensor Service Pack; Aluminium Valve..... 34000      62      7			
Sensor..... 20093      71      8				EZ-Sensor Service Pack; Rubber Valve..... 20018 <sup>C</sup> 11.5      1.3			
<b>2011</b>				Sensor..... 28385      27      3			
EZ-Sensor..... 33500 <sup>A, DB</sup>				Sensor Clip..... 22100			
EZ-Sensor Service Pack..... 20018 <sup>C</sup>				Sensor Cradle..... 22101			
34000				Universal Band..... 22102			
2012-2013				<b>CX-5</b>			
OE Sensor: Mazda - BBM2-37-140B, GN3A37140B				2013-2016			
EZ-Sensor..... 33500 <sup>A, DB</sup>				Sensor..... INDIRECT <sup>D</sup>			
EZ-Sensor Service Pack..... 20018 <sup>C</sup>							
34000							
Sensor..... 20093      71      8							
2014-2015				<b>CX-7</b>			
EZ-Sensor..... 33500 <sup>A, DB</sup>				2007-2011			
EZ-Sensor Service Pack..... 20018 <sup>C</sup>				OE Sensor: Mazda - GN3A37140B			
34000				EZ-Sensor..... 33500 <sup>A, DB</sup>			
				EZ-Sensor Service Pack..... 20018 <sup>C</sup>			
				34000			
				Sensor..... 20093      71      8			
				<b>2012</b>			
				EZ-Sensor..... 33500 <sup>A, DB</sup>			
				EZ-Sensor Service Pack..... 20018 <sup>C</sup>			
				34000			
<b>6</b>							
2005-2007							
EZ-Sensor..... 33500 <sup>A, DB</sup>							
EZ-Sensor Service Pack..... 20018 <sup>C</sup>							
34000							
2008-2013							
OE Sensor: Mazda - BBM2-37-140B, GN3A37140B							
EZ-Sensor..... 33500 <sup>A, DB</sup>							
EZ-Sensor Service Pack..... 20018 <sup>C</sup>							
34000							
Sensor..... 20093      71      8							

A-Programming Tool Required    C-20018 and 20008 are interchangeable.    D-Indirect TPMS system. No sensor in wheel    DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mazda (cont'd)</b>				<b>Mazda (cont'd)</b>			
<b>CX-9</b>				<b>Tribute (cont'd)</b>			
2007-2012				2009-2011			
OE Sensor: Mazda - GN3A37140B				OE Sensor: Mazda - ZZDA37140			
EZ-Sensor	33500 A, DB			EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack	20018 C				33500 A, DB	11.5	1.3
	34000			EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	20093	71	8	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
2013				Sensor	20315	11.5	1.3
OE Sensor: Mazda - BBM2-37-140B				Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	20093	71	8	<b>Mercedes-Benz</b>			
<b>MX-5 Miata</b>				<b>550,63AMG</b>			
2006-2015				2007-2009			
OE Sensor: Mazda - GN3A37140B, GS1D37140				OE Sensor: Mercedes-Benz - 0025409017			
EZ-Sensor	33500 A, DB			EZ-Sensor	33200 A	11.5	1.3
EZ-Sensor Service Pack	20018 C				33500 A, DB	11.5	1.3
	34000			EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	20093	71	8	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
2016				Sensor	28214	58	6.5
Sensor	INDIRECT <sup>D</sup>			Service Pack; Does Not Include Stem	20016	58	6.5
<b>RX-8</b>				Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
2004				<b>B200</b>			
OE Sensor: Mazda - GN3A37140B				2014			
Sensor	20093	71	8	OE Sensor: Mercedes-Benz - A0009050030			
2005-2011				Sensor	20213	80	9
OE Sensor: Mazda - GN3A37140B				Service Pack	20049	80	9
EZ-Sensor	33500 A, DB			2015-2016			
EZ-Sensor Service Pack	20018 C			OE Sensor: Mercedes-Benz - A0009050030			
	34000			EZ-Sensor	33200 A	11.5	1.3
Sensor	20093	71	8		33500 A, DB	11.5	1.3
<b>Tribute</b>				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
2006				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
OE Sensor: Mazda - ZZC137140				Sensor	20213	80	9
EZ-Sensor	33000 A	11.5	1.3	Service Pack	20049	80	9
	33500 A, DB	11.5	1.3	<b>B250</b>			
	33500 A, DB			2015			
EZ-Sensor Service Pack	20018 C			OE Sensor: Mercedes-Benz - A0009050030			
	34000			Sensor	20213	80	9
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack	20049	80	9
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	2016			
Sensor	28385	27	3	OE Sensor: Mercedes-Benz - A0009050030			
Sensor Clip	22100			EZ-Sensor	33200 A	11.5	1.3
Sensor Cradle	22101				33500 A, DB	11.5	1.3
Universal Band	22102			EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
2008				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
OE Sensor: Mazda - ZZC137140				Sensor	20213	80	9
EZ-Sensor	33000 A	11.5	1.3	Service Pack	20049	80	9
	33500 A, DB	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3				
Sensor	28385	27	3				
Sensor Clip	22100						
Sensor Cradle	22101						
Universal Band	22102						

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.		
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>					
<b>C Series</b>				<b>C Series (cont'd)</b>					
<b>2001-2006</b>				<b>2014-2015</b>					
EZ-Sensor; Programmable Sensor. Programming tool required.....				OE Sensor: Mercedes-Benz - A0009050030					
	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3		
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	33500 A, DB	11.5	1.3		
EZ-Sensor Service Pack; Aluminium valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	20213	80	9		
Service Pack; Does Not Include Valve.....	20023	35	4	Service Pack.....	20049	80	9		
Service Pack; W/43mm Silver Insert.....	20037	35	4	<b>2016</b>					
Service Pack; W/48mm Green Insert.....	20038	35	4	OE Sensor: Mercedes-Benz - A0009050030					
Service Pack; W/49mm Black Insert.....	20039	35	4	Sensor.....	20213	80	9		
Service Pack; W/51mm Orange Insert.....	20040	35	4	Service Pack.....	20049	80	9		
<b>2007</b>				<b>C250</b>					
OE Sensor: Mercedes-Benz - 0025406817, 0025409017				<b>2012</b>					
Sensor.....	20094	53	6	OE Sensor: Mercedes-Benz - 0009054100					
Sensor; Jun. & Newer.....	28214	58	6.5	EZ-Sensor.....	33200 A	11.5	1.3		
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5		33500 A, DB	11.5	1.3		
Service Pack; Includes Valve.....	20036	53	6	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		
Service Pack; Jun. & Newer; Does Not Include Stem.....	20016	58	6.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3		
<b>2008-2009</b>				Sensor.....					
OE Sensor: Mercedes-Benz - 0025406817, 0025407917, 0025409017				28214				58	6.5
EZ-Sensor.....	33200 A	11.5	1.3	Service Pack; Does Not Include Stem.....	20016	58	6.5		
	33500 A, DB	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5		
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Includes Valve.....	20036	53	6		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2010-2012</b>					
Sensor.....	20094	53	6	OE Sensor: Mercedes-Benz - 0009054100, 0035400217					
	28214	58	6.5	EZ-Sensor.....	33200 A	11.5	1.3		
Service Pack; Does Not Include Stem.....	20016	58	6.5		33500 A, DB	11.5	1.3		
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		
Service Pack; Includes Valve.....	20036	53	6	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3		
<b>2010-2012</b>				Sensor.....					
OE Sensor: Mercedes-Benz - 0009054100, 0035400217				28214				58	6.5
EZ-Sensor.....	33200 A	11.5	1.3	Service Pack; Does Not Include Stem.....	20016	58	6.5		
	33500 A, DB	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5		
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/O Valve.....	20016	58	6.5		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2014-2016</b>					
Sensor.....	28214	58	6.5	OE Sensor: Mercedes-Benz - A0009050030					
Service Pack; Does Not Include Stem.....	20016	58	6.5	Sensor.....	20213	80	9		
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack.....	20049	80	9		
Service Pack; Includes Valve.....	20036	53	6	<b>C280</b>					
<b>2010-2012</b>				<b>2007</b>					
OE Sensor: Mercedes-Benz - 0009057200				OE Sensor: Mercedes-Benz - 0025408617					
EZ-Sensor.....	33200 A	11.5	1.3	Sensor; Mar. & Newer.....	28214	58	6.5		
	33500 A, DB	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5		
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Mar. & Newer; Does Not Include Stem.....	20016	58	6.5		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3						
Sensor.....	28214	58	6.5						
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5						
Service Pack; W/O Valve.....	20016	58	6.5						

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>			
<b>CL</b>				<b>CLK350</b>			
<b>2000-2006</b>				<b>2006-2009</b>			
EZ-Sensor	33000 A	11.5	1.3	OE Sensor: Mercedes-Benz - 0025409017			
	33500 A, DB	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; Does Not Include Valve	20023	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack; W/43mm Silver Insert	20037	35	4	Sensor	28214	58	6.5
Service Pack; W/48mm Green Insert	20038	35	4	Service Pack; Does Not Include Stem	20016	58	6.5
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; Fits Schrader Sensor; Includes			
Service Pack; W/51mm Orange Insert	20040	35	4	Stem Only	20020	58	6.5
<b>2008-2009</b>				<b>CLS</b>			
OE Sensor: Mercedes-Benz - 0025407917				<b>2006</b>			
Sensor	20094	53	6	OE Sensor: Mercedes-Benz - 0025407917			
Service Pack; Includes Valve	20036	53	6	Sensor	20094	53	6
<b>2010-2012</b>				<b>Service Pack; Includes Valve</b>			
EZ-Sensor	33000 A	11.5	1.3		20036	53	6
	33200 A	11.5	1.3	<b>CLS550</b>			
	33500 A, DB	11.5	1.3	<b>2007-2011</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: Mercedes-Benz - 0025407917			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	20094	53	6
<b>2013-2015</b>				<b>Service Pack; Includes Valve</b>			
EZ-Sensor	33200 A	11.5	1.3		20036	53	6
	33500 A, DB	11.5	1.3	<b>2012</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: Mercedes-Benz - 0009054100			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
<b>CLA250</b>				<b>Service Pack; Aluminium Valve</b>			
<b>2014-2016</b>				<b>Service Pack; Rubber Valve</b>			
OE Sensor: Mercedes-Benz - A0009050030				Sensor	28214	58	6.5
EZ-Sensor	33200 A	11.5	1.3	Service Pack; Does Not Include Stem	20016	58	6.5
	33500 A, DB	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Stem Only	20020	58	6.5
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>2013</b>			
Sensor	20213	80	9	OE Sensor: Mercedes-Benz - 0009057200			
Service Pack	20049	80	9	EZ-Sensor	33200 A	11.5	1.3
<b>CLA45 AMG</b>				<b>Service Pack; Aluminium Valve</b>			
<b>2014-2016</b>				<b>Service Pack; Rubber Valve</b>			
OE Sensor: Mercedes-Benz - A0009050030				Sensor	28214	58	6.5
EZ-Sensor	33200 A	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes			
	33500 A, DB	11.5	1.3	Stem Only	20020	58	6.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/O Valve	20016	58	6.5
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>2014-2016</b>			
Sensor	20213	80	9	OE Sensor: Mercedes-Benz - A0009050030			
Service Pack	20049	80	9	EZ-Sensor	33200 A	11.5	1.3
<b>CLK</b>				<b>Service Pack; Aluminium Valve</b>			
<b>2006</b>				<b>Service Pack; Rubber Valve</b>			
OE Sensor: Mercedes-Benz - 0025409017				Sensor	20213	80	9
EZ-Sensor	33200 A	11.5	1.3	Service Pack	20049	80	9
	33500 A, DB	11.5	1.3	<b>2014-2016</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
Sensor	28214	58	6.5		33500 A, DB	11.5	1.3
Service Pack; Does Not Include Stem	20016	58	6.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; Fits Schrader Sensor; Includes				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Stem Only	20020	58	6.5	Sensor	20213	80	9
				Service Pack	20049	80	9

A-Programming Tool Required    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>			
<b>CLS63 AMG S</b>				<b>E350 (cont'd)</b>			
<b>2014-2016</b>				<b>2014-2016</b>			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	20213	80	9	Sensor.....	20213	80	9
Service Pack.....	20049	80	9	Service Pack.....	20049	80	9
<b>E250</b>				<b>E400</b>			
<b>2014-2016</b>				<b>2014-2016</b>			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	20213	80	9	Sensor.....	20213	80	9
Service Pack.....	20049	80	9	Service Pack.....	20049	80	9
<b>E320</b>				<b>E430</b>			
<b>2001-2005</b>				<b>2001-2002</b>			
Service Pack; Does Not Include Valve.....	20023	35	4	Service Pack; Does Not Include Valve.....	20023	35	4
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/51mm Orange Insert.....	20040	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
<b>2006-2009</b>				<b>E500</b>			
OE Sensor: Mercedes-Benz - 0025406817, 0025407917				<b>2003-2005</b>			
Sensor.....	20094	53	6	Service Pack; Does Not Include Valve.....	20023	35	4
Service Pack; Includes Valve.....	20036	53	6	Service Pack; W/43mm Silver Insert.....	20037	35	4
				Service Pack; W/48mm Green Insert.....	20038	35	4
				Service Pack; W/49mm Black Insert.....	20039	35	4
				Service Pack; W/51mm Orange Insert.....	20040	35	4
<b>E350</b>				<b>2006</b>			
<b>2006-2009</b>				OE Sensor: Mercedes-Benz - 0025406817			
OE Sensor: Mercedes-Benz - 0025406817, 0025407917, 0025408017				Sensor.....			
Sensor; W/315 MHz Sensor.....	20094	53	6	Sensor.....	20094	53	6
Sensor; W/433 MHz Sensor.....	20095	53	6	Service Pack; Includes Valve.....	20036	53	6
Service Pack; Includes Valve.....	20036	53	6				
<b>2010-2012</b>				<b>E55 AMG</b>			
OE Sensor: Mercedes-Benz - 0009054100, 0035400217				<b>1999</b>			
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	Service Pack; Does Not Include Valve; Jul. & Newer.....	20023	35	4
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack; W/43mm Silver Insert; Jul. & Newer.....	20037	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/48mm Green Insert; Jul. & Newer.....	20038	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack; W/49mm Black Insert; Jul. & Newer.....	20039	35	4
Sensor.....	28214	58	6.5	Service Pack; W/51mm Orange Insert; Jul. & Newer.....	20040	35	4
Service Pack; Does Not Include Stem.....	20016	58	6.5				
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	<b>2000-2005</b>			
				Service Pack; Does Not Include Valve.....	20023	35	4
<b>2013</b>				Service Pack; W/43mm Silver Insert.....	20037	35	4
OE Sensor: Mercedes-Benz - 0009057200				Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack; W/51mm Orange Insert.....	20040	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3				
Sensor.....	28214	58	6.5				
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5				
Service Pack; W/O Valve.....	20016	58	6.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.		
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>					
<b>E55 AMG (cont'd)</b>				<b>E63 AMG (cont'd)</b>					
<b>2006</b>				<b>2012-2013</b>					
OE Sensor: Mercedes-Benz - 0025406817				OE Sensor: Mercedes-Benz - 0009054100, 0009057200					
Sensor	20094	53	6	EZ-Sensor	33200 A	11.5	1.3		
Service Pack; Includes Valve	20036	53	6		33500 A, DB	11.5	1.3		
<b>E550</b>				EZ-Sensor Service Pack; Aluminium Valve					
<b>2007-2009</b>				EZ-Sensor Service Pack; Rubber Valve					
OE Sensor: Mercedes-Benz - 0025407917, 0025408017				Sensor					
Sensor; W/315 MHz Sensor	20094	53	6	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5		
Sensor; W/433 MHz Sensor	20095	53	6	<b>2014-2016</b>					
Service Pack; Includes Valve	20036	53	6	OE Sensor: Mercedes-Benz - A0009050030					
<b>2010-2011</b>				EZ-Sensor					
OE Sensor: Mercedes-Benz - 0009054100, 0035400217				33200 A				11.5	1.3
EZ-Sensor	33200 A	11.5	1.3		33500 A, DB	11.5	1.3		
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve					
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve					
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor					
Sensor	28214	58	6.5	Service Pack					
Service Pack; Does Not Include Stem	20016	58	6.5	<b>E63 AMG S</b>					
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	<b>2014-2016</b>					
<b>2012-2013</b>				OE Sensor: Mercedes-Benz - A0009050030					
OE Sensor: Mercedes-Benz - 0009054100, 0009057200				EZ-Sensor					
EZ-Sensor	33200 A	11.5	1.3	33200 A				11.5	1.3
	33500 A, DB	11.5	1.3	33500 A, DB				11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve					
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve					
Sensor	28214	58	6.5	Sensor					
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack					
Service Pack; W/O Valve	20016	58	6.5	<b>G500</b>					
<b>2014-2016</b>				<b>2007</b>					
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - 0025408617					
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor					
	33500 A, DB	11.5	1.3	33200 A				11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	33500 A, DB				11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve					
Sensor	20213	80	9	EZ-Sensor Service Pack; Rubber Valve					
Service Pack	20049	80	9	Sensor; Mar. & Newer					
<b>E63 AMG</b>				Service Pack; Fits Schrader Sensor; Includes Stem Only					
<b>2007-2009</b>				Service Pack; Mar. & Newer; Does Not Include Stem					
OE Sensor: Mercedes-Benz - 0025406817, 0025407917				<b>2008</b>					
Sensor	20094	53	6	OE Sensor: Mercedes-Benz - 0025409017					
Service Pack; Includes Valve	20036	53	6	EZ-Sensor					
<b>2010-2011</b>				33200 A				11.5	1.3
OE Sensor: Mercedes-Benz - 0009054100, 0035400217				33500 A, DB				11.5	1.3
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve					
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve					
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor					
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Service Pack; Does Not Include Stem					
Sensor	28214	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only					
Service Pack; Does Not Include Stem	20016	58	6.5	Service Pack; Mar. & Newer; Does Not Include Stem					
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	20016				58	6.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>			
<b>G55 AMG</b>				<b>G550 (cont'd)</b>			
<b>2007</b>				<b>2012-2013</b>			
OE Sensor: Mercedes-Benz - 0025408617				OE Sensor: Mercedes-Benz - 0009057200, 0025409017			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor; Mar. & Newer.....	28214	58	6.5	Sensor.....	28214	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Service Pack; Mar. & Newer; Does Not Include Stem.....	20016	58	6.5	Service Pack; W/O Valve.....	20016	58	6.5
<b>2008-2010</b>				<b>2014-2016</b>			
OE Sensor: Mercedes-Benz - 0025409017				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28214	58	6.5	Sensor.....	20213	80	9
Service Pack; Does Not Include Stem.....	20016	58	6.5	Service Pack.....	20049	80	9
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	<b>G63 AMG</b>			
<b>2011</b>				<b>2014-2016</b>			
OE Sensor: Mercedes-Benz - 0025409017				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28214	58	6.5	Sensor.....	20213	80	9
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack.....	20049	80	9
Service Pack; Mar. & Newer; Does Not Include Stem.....	20016	58	6.5	<b>GL</b>			
<b>G550</b>				<b>2007-2009</b>			
<b>2009-2010</b>				<b>2010</b>			
OE Sensor: Mercedes-Benz - 0025409017				OE Sensor: Mercedes-Benz - 0025408017			
EZ-Sensor.....	33200 A	11.5	1.3	Sensor.....	20095	53	6
	33500 A, DB	11.5	1.3	Service Pack; Includes Valve.....	20036	53	6
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2010</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	OE Sensor: Mercedes-Benz - 0035400217			
Sensor.....	28214	58	6.5	EZ-Sensor.....	33200 A	11.5	1.3
Service Pack; Does Not Include Stem.....	20016	58	6.5		33500 A, DB	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2011</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
OE Sensor: Mercedes-Benz - 0025409017				Sensor.....	28214	58	6.5
EZ-Sensor.....	33200 A	11.5	1.3	Service Pack; Does Not Include Stem.....	20016	58	6.5
	33500 A, DB	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2011</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	OE Sensor: Mercedes-Benz - 0009054100			
Sensor.....	28214	58	6.5	EZ-Sensor.....	33200 A	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5		33500 A, DB	11.5	1.3
Service Pack; Mar. & Newer; Does Not Include Stem.....	20016	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Sensor.....	28214	58	6.5
				Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
				Service Pack; Mar. & Newer; Does Not Include Stem.....	20016	58	6.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>			
<b>GL (cont'd)</b>				<b>GL350 (cont'd)</b>			
<b>2012-2013</b>				<b>2014-2015</b>			
OE Sensor: Mercedes-Benz - 0009054100, 0009057200				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28214	58	6.5	Sensor	20213	80	9
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack	20049	80	9
Service Pack; W/O Valve	20016	58	6.5	<b>2016</b>			
<b>2014-2016</b>				EZ-Sensor Service Pack; Aluminium Valve			
OE Sensor: Mercedes-Benz - A0009050030				EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor	33200 A	11.5	1.3	Sensor	20213	80	9
	33500 A, DB	11.5	1.3	Service Pack	20049	80	9
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>GL63 AMG</b>			
Sensor	20213	80	9	<b>2013</b>			
Service Pack	20049	80	9	OE Sensor: Mercedes-Benz - 0009057200			
				EZ-Sensor			
				EZ-Sensor Service Pack; Aluminium Valve			
				EZ-Sensor Service Pack; Rubber Valve			
				Sensor			
				Service Pack; Fits Schrader Sensor; Includes Stem Only			
				Service Pack; W/O Valve			
				<b>2014-2016</b>			
				OE Sensor: Mercedes-Benz - A0009050030			
				EZ-Sensor			
				EZ-Sensor Service Pack; Aluminium Valve			
				EZ-Sensor Service Pack; Rubber Valve			
				Sensor			
				Service Pack			
				<b>GLK250</b>			
				<b>2014-2016</b>			
				OE Sensor: Mercedes-Benz - A0009050030			
				EZ-Sensor			
				EZ-Sensor Service Pack; Aluminium Valve			
				EZ-Sensor Service Pack; Rubber Valve			
				Sensor			
				Service Pack			
				<b>GLK350</b>			
				<b>2010</b>			
				OE Sensor: Mercedes-Benz - 0035400217			
				EZ-Sensor			
				EZ-Sensor Service Pack; Aluminium Valve			
				EZ-Sensor Service Pack; Rubber Valve			
				Sensor			
				Service Pack; Does Not Include Stem			
				Service Pack; Fits Schrader Sensor; Includes Stem Only			
				Service Pack; Mar. & Newer; Does Not Include Stem			
				<b>2012-2013</b>			
				OE Sensor: Mercedes-Benz - 0009054100, 0009057200			
				EZ-Sensor			
				EZ-Sensor Service Pack; Aluminium Valve			
				EZ-Sensor Service Pack; Rubber Valve			
				Sensor			
				Service Pack; Fits Schrader Sensor; Includes Stem Only			
				Service Pack; W/O Valve			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>			
<b>GLK350 (cont'd)</b>				<b>ML350 (cont'd)</b>			
<b>2011</b>				<b>2010</b>			
OE Sensor: Mercedes-Benz - 0009054100				OE Sensor: Mercedes-Benz - 0035400217			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28214	58	6.5	Sensor.....	28214	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Does Not Include Stem.....	20016	58	6.5
Service Pack; Mar. & Newer; Does Not Include Stem.....	20016	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
<b>2012</b>				<b>2011</b>			
OE Sensor: Mercedes-Benz - 0009054100				OE Sensor: Mercedes-Benz - 0009054100			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28214	58	6.5	Sensor.....	28214	58	6.5
Service Pack; Does Not Include Stem.....	20016	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Mar. & Newer; Does Not Include Stem.....	20016	58	6.5
<b>2013</b>				<b>2012</b>			
OE Sensor: Mercedes-Benz - 0009057200				OE Sensor: Mercedes-Benz - 0009054100			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28214	58	6.5	Sensor.....	28214	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Does Not Include Stem.....	20016	58	6.5
Service Pack; W/O Valve.....	20016	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
<b>2014-2016</b>				<b>2013</b>			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - 0009057200			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	20213	80	9	Sensor.....	28214	58	6.5
Service Pack.....	20049	80	9	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
<b>ML320</b>				Service Pack; W/O Valve.....			
<b>2007-2009</b>				20016			
OE Sensor: Mercedes-Benz - 0025406917, 0025408017				<b>2014</b>			
Sensor.....	20095	53	6	EZ-Sensor.....	33200 A	11.5	1.3
Service Pack; Includes Valve.....	20036	53	6		33500 A, DB	11.5	1.3
<b>ML350</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
<b>2006-2009</b>				34000			
OE Sensor: Mercedes-Benz - 0025406917, 0025408017				EZ-Sensor Service Pack; Rubber Valve.....			
Sensor.....	20095	53	6		20018 C	11.5	1.3
Service Pack; Includes Valve.....	20036	53	6	<b>2015</b>			
				OE Sensor: Mercedes-Benz - 000 905 00 30			
				EZ-Sensor.....			
				33200 A			
				33500 A, DB			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				34000			
				EZ-Sensor Service Pack; Rubber Valve.....			
				20018 C			
				Sensor.....			
				20213			
				Service Pack.....			
				20049			
				80			
				9			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>			
<b>ML350 (cont'd)</b>				<b>ML550 (cont'd)</b>			
<b>2016</b>				<b>2011-2012</b>			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Mercedes-Benz - 0009054100			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.....	20213	80	9	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack.....	20049	80	9	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Sensor.....	28214	58	6.5
<b>ML450</b>				<b>Service Pack; Fits Schrader Sensor; Includes Stem Only.....</b>			
<b>2010</b>				<b>20020</b>			
OE Sensor: Mercedes-Benz - 0035400217				Service Pack; Mar. & Newer; Does Not Include Stem.....	20016	58	6.5
EZ-Sensor.....	33200 A	11.5	1.3				
	33500 A, DB	11.5	1.3	<b>2013-2014</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.....	28214	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Does Not Include Stem.....	20016	58	6.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	<b>2015-2016</b>			
				OE Sensor: Mercedes-Benz - A0009050030			
<b>2011</b>				EZ-Sensor.....	33200 A	11.5	1.3
OE Sensor: Mercedes-Benz - 0009054100					33500 A, DB	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	20213	80	9
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack.....	20049	80	9
Sensor.....	28214	58	6.5	<b>ML63 AMG</b>			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	<b>2007-2009</b>			
Service Pack; Mar. & Newer; Does Not Include Stem.....	20016	58	6.5	OE Sensor: Mercedes-Benz - 0025406917, 0025408017			
				Sensor.....	20095	53	6
<b>ML500</b>				Service Pack; Includes Valve.....	20036	53	6
<b>2006-2007</b>				<b>2010</b>			
OE Sensor: Mercedes-Benz - 0025406917				OE Sensor: Mercedes-Benz - 0035400217			
Sensor.....	20095	53	6	EZ-Sensor.....	33200 A	11.5	1.3
Service Pack; Includes Valve.....	20036	53	6		33500 A, DB	11.5	1.3
<b>ML550</b>				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2008-2009</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
OE Sensor: Mercedes-Benz - 0025406917, 0025408017				Sensor.....	28214	58	6.5
Sensor.....	20095	53	6	Service Pack; Does Not Include Stem.....	20016	58	6.5
Service Pack; Includes Valve.....	20036	53	6	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
<b>2010</b>				<b>2011</b>			
OE Sensor: Mercedes-Benz - 0035400217				OE Sensor: Mercedes-Benz - 0009054100			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28214	58	6.5	Sensor.....	28214	58	6.5
Service Pack; Does Not Include Stem.....	20016	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Mar. & Newer; Does Not Include Stem.....	20016	58	6.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>			
<b>ML63 AMG (cont'd)</b>				<b>R350 (cont'd)</b>			
<b>2012-2013</b>				<b>2012</b>			
OE Sensor: Mercedes-Benz - 0009054100, 0009057200				OE Sensor: Mercedes-Benz - 0009054100			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28214	58	6.5	Sensor.....	28214	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Does Not Include Stem.....	20016	58	6.5
Service Pack; W/O Valve.....	20016	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
<b>2014-2016</b>				<b>2013</b>			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - 0009057200			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	20213	80	9	Sensor.....	28214	58	6.5
Service Pack.....	20049	80	9	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
				Service Pack; W/O Valve.....	20016	58	6.5
<b>R320</b>				<b>R500</b>			
<b>2007-2009</b>				<b>2006-2007</b>			
OE Sensor: Mercedes-Benz - 0025406917, 0025408017				OE Sensor: Mercedes-Benz - 0025406917			
Sensor.....	20095	53	6	Sensor.....	20095	53	6
Service Pack; Includes Valve.....	20036	53	6	Service Pack; Includes Valve.....	20036	53	6
<b>R350</b>				<b>R63 AMG</b>			
<b>2006-2009</b>				<b>2007</b>			
OE Sensor: Mercedes-Benz - 0025406917, 0025408017				OE Sensor: Mercedes-Benz - 0025406917			
Sensor.....	20095	53	6	Sensor.....	20095	53	6
Service Pack; Includes Valve.....	20036	53	6	Service Pack; Includes Valve.....	20036	53	6
<b>2010</b>				<b>S Series</b>			
OE Sensor: Mercedes-Benz - 0035400217				<b>2006</b>			
EZ-Sensor.....	33200 A	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	35	4
	33500 A, DB	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4
Sensor.....	28214	58	6.5	Service Pack; W/51mm Orange Insert.....	20040	35	4
Service Pack; Does Not Include Stem.....	20016	58	6.5	<b>2010</b>			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	OE Sensor: Mercedes-Benz - 0025407917			
				Sensor.....			
				Service Pack; Includes Valve.....			
				2011			
				OE Sensor: Mercedes-Benz - 0009054100			
				EZ-Sensor.....			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				EZ-Sensor Service Pack; Rubber Valve.....			
				Sensor.....			
				Service Pack; Does Not Include Stem.....			
				Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
				Service Pack; Mar. & Newer; Does Not Include Stem.....			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>			
<b>S Series (cont'd)</b>				<b>S500 (cont'd)</b>			
<b>2012</b>				<b>2001</b>			
OE Sensor: Mercedes-Benz - 0009054100				OE Sensor: Mercedes-Benz - 0008223406			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor; Programmable sensor, Rubber Valve	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	28214	58	6.5	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Sensor	20079		
Service Pack; W/O Valve	20016	58	6.5	Service Pack; Does Not Include Valve	20023	35	4
				Service Pack; W/43mm Silver Insert	20037	35	4
<b>2013</b>				Service Pack; W/48mm Green Insert	20038	35	4
OE Sensor: Mercedes-Benz - 0009057200				Service Pack; W/49mm Black Insert	20039	35	4
EZ-Sensor	33200 A	11.5	1.3	Service Pack; W/51mm Orange Insert	20040	35	4
	33500 A, DB	11.5	1.3	<b>2002-2006</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: Mercedes-Benz - 0008223406			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
Sensor	20213	80	9		33500 A, DB	11.5	1.3
	28214	58	6.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack	20049	80	9	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Sensor	20079		
Service Pack; W/O Valve	20016	58	6.5	Service Pack; Does Not Include Valve	20023	35	4
				Service Pack; W/43mm Silver Insert	20037	35	4
<b>2014-2016</b>				Service Pack; W/48mm Green Insert	20038	35	4
OE Sensor: Mercedes-Benz - A0009050030				Service Pack; W/49mm Black Insert	20039	35	4
EZ-Sensor	33200 A	11.5	1.3	Service Pack; W/51mm Orange Insert	20040	35	4
	33500 A, DB	11.5	1.3	<b>S55 AMG</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>2001-2006</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Service Pack; Does Not Include Valve	20023	35	4
Sensor	20213	80	9	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack	20049	80	9	Service Pack; W/48mm Green Insert	20038	35	4
<b>S430</b>				Service Pack; W/49mm Black Insert	20039	35	4
<b>2000-2006</b>				Service Pack; W/51mm Orange Insert	20040	35	4
EZ-Sensor	33000 A	11.5	1.3	<b>S550</b>			
	33100 A	11.5	1.3	<b>2007-2010</b>			
	33200 A	11.5	1.3	OE Sensor: Mercedes-Benz - 0025406817, 0025407917			
	33500 A, DB	11.5	1.3	Sensor	20094	53	6
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; Includes Valve	20036	53	6
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>2011</b>			
Service Pack; Does Not Include Valve	20023	35	4	OE Sensor: Mercedes-Benz - 0009054100			
Service Pack; W/43mm Silver Insert	20037	35	4	EZ-Sensor	33200 A	11.5	1.3
Service Pack; W/48mm Green Insert	20038	35	4		33500 A, DB	11.5	1.3
Service Pack; W/49mm Black Insert	20039	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; W/51mm Orange Insert	20040	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
<b>S500</b>				Sensor	28214	58	6.5
<b>2000</b>				Service Pack; Does Not Include Stem	20016	58	6.5
OE Sensor: Mercedes-Benz - 0008223406				Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
EZ-Sensor	33000 A	11.5	1.3				
	33500 A, DB	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3				
Sensor	20079						
Service Pack; Does Not Include Valve	20023	35	4				
Service Pack; W/43mm Silver Insert	20037	35	4				
Service Pack; W/48mm Green Insert	20038	35	4				
Service Pack; W/49mm Black Insert	20039	35	4				
Service Pack; W/51mm Orange Insert	20040	35	4				

A-Programming Tool Required    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>			
<b>S550 (cont'd)</b>				<b>S600 (cont'd)</b>			
<b>2012-2013</b>				<b>2014-2016</b>			
OE Sensor: Mercedes-Benz - 0009054100, 0009057200				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28214	58	6.5	Sensor.....	20213	80	9
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack.....	20049	80	9
Service Pack; W/O Valve.....	20016	58	6.5				
<b>2014-2016</b>				<b>S63 AMG</b>			
OE Sensor: Mercedes-Benz - A0009050030				<b>2008-2010</b>			
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	OE Sensor: Mercedes-Benz - 0025406817, 0025407917			
	33500 <sup>A, DB</sup>	11.5	1.3	Sensor.....	20094	53	6
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Includes Valve.....	20036	53	6
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>2011</b>			
Sensor.....	20213	80	9	OE Sensor: Mercedes-Benz - 0009054100			
Service Pack.....	20049	80	9	EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3
					33500 <sup>A, DB</sup>	11.5	1.3
<b>S600</b>				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2001-2006</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	35	4	Sensor.....	28214	58	6.5
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; Does Not Include Stem.....	20016	58	6.5
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Service Pack; W/49mm Black Insert.....	20039	35	4				
Service Pack; W/51mm Orange Insert.....	20040	35	4	<b>2012-2013</b>			
<b>2007-2010</b>				OE Sensor: Mercedes-Benz - 0009054100, 0009057200			
OE Sensor: Mercedes-Benz - 0025406817, 0025407917				EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3
Sensor.....	20094	53	6		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; Includes Valve.....	20036	53	6	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2011</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
OE Sensor: Mercedes-Benz - 0009054100				Sensor.....	28214	58	6.5
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack; W/O Valve.....	20016	58	6.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2014-2016</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	OE Sensor: Mercedes-Benz - A0009050030			
Sensor.....	28214	58	6.5	EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3
Service Pack; Does Not Include Stem.....	20016	58	6.5		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
<b>2012-2013</b>				Sensor.....	20213	80	9
OE Sensor: Mercedes-Benz - 0009054100, 0009057200				Service Pack.....	20049	80	9
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	<b>S65 AMG</b>			
	33500 <sup>A, DB</sup>	11.5	1.3	<b>2006</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Does Not Include Valve.....	20023	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4
Sensor.....	28214	58	6.5	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; Does Not Include Stem.....	20016	58	6.5	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; W/51mm Orange Insert.....	20040	35	4
Service Pack; W/O Valve.....	20016	58	6.5	<b>2007-2010</b>			
				OE Sensor: Mercedes-Benz - 0025406817, 0025407917			
				Sensor.....	20094	53	6
				Service Pack; Includes Valve.....	20036	53	6

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>			
<b>S65 AMG (cont'd)</b>				<b>SL55 AMG (cont'd)</b>			
<b>2011</b>				<b>2006-2008</b>			
OE Sensor: Mercedes-Benz - 0009054100				OE Sensor: Mercedes-Benz - 002 540 6817			
EZ-Sensor	33200 A	11.5	1.3	Sensor	20094	53	6
	33500 A, DB	11.5	1.3	Service Pack; Includes Valve	20036	53	6
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>SL550</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>2007-2009</b>			
Sensor	28214	58	6.5	OE Sensor: Mercedes-Benz - 0025406817			
Service Pack; Does Not Include Stem	20016	58	6.5	Sensor	20094	53	6
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack; Includes Valve	20036	53	6
<b>2012-2013</b>				<b>2012</b>			
OE Sensor: Mercedes-Benz - 0009054100, 0009057200				OE Sensor: Mercedes-Benz - 0009054100			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28214	58	6.5	Sensor	28214	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack; Does Not Include Stem	20016	58	6.5
Service Pack; W/O Valve	20016	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
<b>SL500</b>				<b>2013</b>			
<b>2000-2005</b>				OE Sensor: Mercedes-Benz - 0009057200			
EZ-Sensor; Programmable sensor, Rubber Valve	33500 A, DB	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
Service Pack; Does Not Include Valve	20023	35	4		33500 A, DB	11.5	1.3
Service Pack; W/43mm Silver Insert	20037	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; W/48mm Green Insert	20038	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack; W/49mm Black Insert	20039	35	4	Sensor	28214	58	6.5
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
<b>2006</b>				Service Pack; W/O Valve	20016	58	6.5
OE Sensor: Mercedes-Benz - 0025406817				<b>2014-2016</b>			
Sensor	20094	53	6	OE Sensor: Mercedes-Benz - A0009050030			
Service Pack; Includes Valve	20036	53	6	EZ-Sensor	33200 A	11.5	1.3
<b>SL55 AMG</b>					33500 A, DB	11.5	1.3
<b>2003</b>				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminum valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	20213	80	9
Service Pack; Does Not Include Valve	20023	35	4	Service Pack	20049	80	9
Service Pack; W/43mm Silver Insert	20037	35	4	<b>SL600</b>			
Service Pack; W/48mm Green Insert	20038	35	4	<b>2001-2002</b>			
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; Does Not Include Valve			
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; W/43mm Silver Insert			
<b>2004</b>				Service Pack; W/48mm Green Insert			
Service Pack; W/43mm Silver Insert				Service Pack; W/49mm Black Insert			
Service Pack; W/48mm Green Insert				Service Pack; W/51mm Orange Insert			
Service Pack; W/49mm Black Insert				<b>2004-2005</b>			
Service Pack; W/51mm Orange Insert				Service Pack; Does Not Include Valve			
<b>2005</b>				Service Pack; W/43mm Silver Insert			
Service Pack; Does Not Include Valve				Service Pack; W/48mm Green Insert			
Service Pack; W/43mm Silver Insert				Service Pack; W/49mm Black Insert			
Service Pack; W/48mm Green Insert				Service Pack; W/51mm Orange Insert			
Service Pack; W/49mm Black Insert				<b>2006-2009</b>			
Service Pack; W/51mm Orange Insert				OE Sensor: Mercedes-Benz - 0025406817			
				Sensor			
				Service Pack; Includes Valve			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>			
<b>SL63 AMG</b>				<b>SL65 AMG (cont'd)</b>			
<b>2009</b>				<b>2014-2016</b>			
OE Sensor: Mercedes-Benz - 0025406817				OE Sensor: Mercedes-Benz - A0009050030			
Sensor.....	20094	53	6	Sensor.....	20213	80	9
Service Pack; Includes Valve.....	20036	53	6	Service Pack.....	20049	80	9
<b>2011</b>				<b>SLK250</b>			
OE Sensor: Mercedes-Benz - 0025407917				<b>2012</b>			
Sensor.....	20094	53	6	OE Sensor: Mercedes-Benz - 0009054100			
<b>2012</b>				EZ-Sensor.....			
OE Sensor: Mercedes-Benz - 0009054100				33200 <sup>A</sup> 11.5 1.3			
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	33500 <sup>A, DB</sup> 11.5 1.3			
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	34000 62 7			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
Sensor.....	28214	58	6.5	20018 <sup>C</sup> 11.5 1.3			
Service Pack; Does Not Include Stem.....	20016	58	6.5	Sensor.....			
Service Pack; Fits Schrader Sensor; Includes				28214 58 6.5			
Stem Only.....	20020	58	6.5	Service Pack; Does Not Include Stem.....			
				20016 58 6.5			
				Service Pack; Fits Schrader Sensor; Includes			
				Stem Only.....			
				20020 58 6.5			
<b>2013</b>				<b>2013</b>			
OE Sensor: Mercedes-Benz - 0009057200				OE Sensor: Mercedes-Benz - 0009057200			
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	EZ-Sensor.....			
	33500 <sup>A, DB</sup>	11.5	1.3	33200 <sup>A</sup> 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	33500 <sup>A, DB</sup> 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
Sensor.....	28214	58	6.5	34000 62 7			
Service Pack; Fits Schrader Sensor; Includes				EZ-Sensor Service Pack; Rubber Valve.....			
Stem Only.....	20020	58	6.5	20018 <sup>C</sup> 11.5 1.3			
Service Pack; W/O Valve.....	20016	58	6.5	Sensor.....			
				28214 58 6.5			
				Service Pack; Fits Schrader Sensor; Includes			
				Stem Only.....			
				20020 58 6.5			
				Service Pack; W/O Valve.....			
				20016 58 6.5			
<b>2014-2015</b>				<b>2014-2016</b>			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	EZ-Sensor.....			
	33500 <sup>A, DB</sup>	11.5	1.3	33200 <sup>A</sup> 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	33500 <sup>A, DB</sup> 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
Sensor.....	20213	80	9	34000 62 7			
Service Pack.....	20049	80	9	EZ-Sensor Service Pack; Rubber Valve.....			
				20018 <sup>C</sup> 11.5 1.3			
				Sensor.....			
				20213 80 9			
				Service Pack.....			
				20049 80 9			
<b>2016</b>				<b>SLK280</b>			
OE Sensor: Mercedes-Benz - A0009050030				<b>2007</b>			
EZ-Sensor.....	33200 <sup>A</sup>	11.5	1.3	OE Sensor: Mercedes-Benz - 0045421518			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	33200 <sup>A</sup> 11.5 1.3			
Sensor.....	20213	80	9	33500 <sup>A, DB</sup> 11.5 1.3			
Service Pack.....	20049	80	9	EZ-Sensor Service Pack; Aluminium Valve.....			
				34000 62 7			
				EZ-Sensor Service Pack; Rubber Valve.....			
				20018 <sup>C</sup> 11.5 1.3			
				Sensor; May & Newer.....			
				28214 58 6.5			
				Service Pack; Fits Schrader Sensor; Includes			
				Stem Only.....			
				20020 58 6.5			
				Service Pack; May & Newer; Does Not Include			
				Stem.....			
				20016 58 6.5			
<b>SL65 AMG</b>				<b>2008</b>			
<b>2005</b>				OE Sensor: Mercedes-Benz - 0025409017			
Service Pack; Does Not Include Valve.....	20023	35	4	EZ-Sensor.....			
Service Pack; W/43mm Silver Insert.....	20037	35	4	33200 <sup>A</sup> 11.5 1.3			
Service Pack; W/48mm Green Insert.....	20038	35	4	33500 <sup>A, DB</sup> 11.5 1.3			
Service Pack; W/49mm Black Insert.....	20039	35	4	EZ-Sensor Service Pack; Aluminium Valve.....			
Service Pack; W/51mm Orange Insert.....	20040	35	4	34000 62 7			
<b>2006-2009</b>				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Mercedes-Benz - 0025406817				20018 <sup>C</sup> 11.5 1.3			
Sensor.....	20094	53	6	Sensor.....			
Service Pack; Includes Valve.....	20036	53	6	28214 58 6.5			
<b>2011</b>				Service Pack; Does Not Include Stem.....			
OE Sensor: Mercedes-Benz - 0025407917				20016 58 6.5			
Sensor.....	20094	53	6	Service Pack; Fits Schrader Sensor; Includes			
				Stem Only.....			
				20020 58 6.5			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>			
<b>SLK300</b>				<b>SLK55 AMG</b>			
<b>2009-2011</b>				<b>2007</b>			
OE Sensor: Mercedes-Benz - 0025409017, 0035400217				OE Sensor: Mercedes-Benz - 0045421518			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28214	58	6.5	Sensor; May & Newer	28214	58	6.5
Service Pack; Does Not Include Stem	20016	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack; May & Newer; Does Not Include Stem	20016	58	6.5
<b>SLK350</b>				<b>2008-2010</b>			
<b>2007</b>				OE Sensor: Mercedes-Benz - 0025409017, 0035400217			
OE Sensor: Mercedes-Benz - 0045421518				EZ-Sensor			
EZ-Sensor	33200 A	11.5	1.3		33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor; May & Newer	28214	58	6.5	Sensor	28214	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack; Does Not Include Stem	20016	58	6.5
Service Pack; May & Newer; Does Not Include Stem	20016	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
<b>2008-2012</b>				<b>2014</b>			
OE Sensor: Mercedes-Benz - 0009054100, 0025409017, 0035400217				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28214	58	6.5	Sensor	20213	80	9
Service Pack; Does Not Include Stem	20016	58	6.5	Service Pack	20049	80	9
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	<b>2015-2016</b>			
Service Pack; W/O Valve	20016	58	6.5	OE Sensor: Mercedes-Benz - A0009050030			
<b>2013</b>				Sensor			
OE Sensor: Mercedes-Benz - 0009057200				Service Pack			
EZ-Sensor	33200 A	11.5	1.3		20213	80	9
	33500 A, DB	11.5	1.3		20049	80	9
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>SLR McLaren</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>2004</b>			
Sensor	28214	58	6.5	EZ-Sensor; Programmable sensor, Rubber Valve			
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	EZ-Sensor; Programmable sensor, Rubber Valve			
Service Pack; W/O Valve	20016	58	6.5	EZ-Sensor Service Pack; Aluminum valve			
<b>2014-2016</b>				EZ-Sensor Service Pack; Rubber Valve			
OE Sensor: Mercedes-Benz - A0009050030				Service Pack; Does Not Include Valve			
EZ-Sensor	33200 A	11.5	1.3	Service Pack; W/43mm Silver Insert			
	33500 A, DB	11.5	1.3	Service Pack; W/48mm Green Insert			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/49mm Black Insert			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Service Pack; W/51mm Orange Insert			
Sensor	20213	80	9	<b>2005</b>			
Service Pack	20049	80	9	EZ-Sensor; Programmable sensor, Rubber Valve			
				EZ-Sensor Service Pack; Aluminum valve			
				EZ-Sensor Service Pack; Rubber Valve			
				Service Pack; Does Not Include Valve			
				Service Pack; W/43mm Silver Insert			
				Service Pack; W/48mm Green Insert			
				Service Pack; W/49mm Black Insert			
				Service Pack; W/51mm Orange Insert			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercedes-Benz (cont'd)</b>				<b>Mercedes-Benz (cont'd)</b>			
<b>SLR McLaren (cont'd)</b>				<b>SLS AMG (cont'd)</b>			
<b>2006</b>				<b>2016</b>			
EZ-Sensor; Programmable sensor, Rubber Valve.	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor; Programmable sensor, Rubber Valve.	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	35	4	<b>Sprinter 2500</b>			
Service Pack; W/43mm Silver Insert.....	20037	35	4	<b>2010</b>			
Service Pack; W/48mm Green Insert.....	20038	35	4	OE Sensor: Mercedes-Benz - 68006771AA			
Service Pack; W/49mm Black Insert.....	20039	35	4	EZ-Sensor.....	33000 A		
Service Pack; W/51mm Orange Insert.....	20040	35	4		33500 A, DB	11.5	1.3
<b>2007</b>				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor; Programmable sensor, Rubber Valve.	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor; Programmable sensor, Rubber Valve.	33200 A	11.5	1.3	Sensor.....	20089		
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	Service Pack.....	20036		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2011-2012</b>			
Service Pack; Does Not Include Valve.....	20023	53	6	OE Sensor: Mercedes-Benz - 68006771AA			
Service Pack; W/43mm Silver Insert.....	20037	53	6	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	53	6	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/49mm Black Insert.....	20039	53	6	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	53	6	Sensor.....	20089		
<b>2008-2009</b>				Service Pack.....	20036		
OE Sensor: Mercedes-Benz - 0025407917				<b>2013</b>			
Sensor.....	20094	53	6	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; Includes Valve.....	20036	53	6	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>SLS AMG</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
<b>2011-2012</b>				<b>2014-2016</b>			
OE Sensor: Mercedes-Benz - 0009054100				EZ-Sensor.....	33200 A		
EZ-Sensor.....	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	20213	80	9
Sensor.....	28214	58	6.5	Service Pack.....	20016		
Service Pack; Does Not Include Stem.....	20016	58	6.5	<b>Sprinter 3500</b>			
Service Pack; Fits Schrader Sensor; Includes				<b>2010-2012</b>			
Stem Only.....	20020	58	6.5	OE Sensor: Mercedes-Benz - 68006771AA			
<b>2013</b>				EZ-Sensor.....	33000 A	11.5	1.3
OE Sensor: Mercedes-Benz - 0009057200				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor.....	20089		
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Includes Valve.....	20036	53	6
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2012</b>			
Sensor.....	28214	58	6.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes				<b>2013</b>			
Stem Only.....	20020	58	6.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; W/O Valve.....	20016	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2014-2015</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
OE Sensor: Mercedes-Benz - A0009050030				<b>2014-2016</b>			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	20213	80	9	Sensor.....	20213	80	9
Service Pack.....	20049	80	9	Service Pack.....	20016		

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercury</b>				<b>Mercury (cont'd)</b>			
<b>Grand Marquis</b>				<b>Milan (cont'd)</b>			
2006-2011				2010-2011			
OE Sensor: Ford Motor Company - 6F2Z1A189A				OE Sensor: Ford Motor Company - 9L3Z1A189A			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28385	27	3	Sensor	20315	13	1.5
Sensor Clip	22100			Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor Cradle	22101						
Universal Band	22102						
<b>Mariner</b>				<b>Montego</b>			
2005				2006-2007			
OE Sensor: Ford Motor Company - 6F2Z1A189A				OE Sensor: Ford Motor Company - 7L1Z1A189A			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor; Oct. 3, 2005 & Newer	28385	27	3	Sensor	28390	27	3
Sensor Clip	22100			Sensor Clip	22100		
Sensor Cradle	22101			Sensor Cradle	22101		
Universal Band	22102			Universal Band	22102		
2006-2008				<b>Monterey</b>			
OE Sensor: Ford Motor Company - 6F2Z1A189A				2004-2005			
EZ-Sensor	33000 A	11.5	1.3	OE Sensor: Ford Motor Company - 5L1Z 1A150 AA			
	33500 A, DB	11.5	1.3	Sensor			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	20135 B			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	44			
Sensor	28385	27	3	Service Pack			
Sensor Clip	22100			20002			
Sensor Cradle	22101			44			
Universal Band	22102			5			
2009-2011				2006-2007			
OE Sensor: Ford Motor Company - 9L3Z1A189A				OE Sensor: Ford Motor Company - 6F2Z1A189A			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	20315	13	1.5	Sensor	28385	27	3
Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor Clip	22100		
				Sensor Cradle	22101		
				Universal Band	22102		
<b>Milan</b>				<b>Mountaineer</b>			
2007-2009				2002-2005			
OE Sensor: Ford Motor Company - 6F2Z1A189A				OE Sensor: Ford Motor Company - 4L2Z 1A150 BA			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33100 A	11.5	1.3
	33500 A, DB	11.5	1.3		33200 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	28385	27	3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor Clip	22100			Sensor	20096 B	44	5
Sensor Cradle	22101			Service Pack	20002	44	5
Universal Band	22102			2006-2010			
				OE Sensor: Ford Motor Company - 6F2Z1A189A			
				EZ-Sensor			
				33000 A			
				11.5			
				1.3			
				33500 A, DB			
				11.5			
				1.3			
				EZ-Sensor Service Pack; Aluminium Valve			
				34000			
				62			
				7			
				EZ-Sensor Service Pack; Rubber Valve			
				20018 C			
				11.5			
				1.3			
				Sensor			
				28385			
				27			
				3			
				Sensor Clip			
				22100			
				Sensor Cradle			
				22101			
				Universal Band			
				22102			

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mercury (cont'd)</b>				<b>Mitsubishi</b>			
<b>Sable</b>				<b>Eclipse</b>			
<b>2008-2009</b>				<b>2006-2007</b>			
OE Sensor: Ford Motor Company - 7L1Z1A189A				OE Sensor: Mitsubishi - 4250A030, MN103081			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28390	27	3	Sensor; W/Alloy Wheels.....	20034 <sup>B</sup>	45-53	5-6
Sensor Clip.....	22100			Sensor; W/Steel Wheels.....	28129	45-53	5-6
Sensor Cradle.....	22101			Service Pack; W/Alloy Wheels.....	20003	45-53	5-6
Universal Band.....	22102			Service Pack; W/Steel Wheels.....	20010	45-53	5-6
<b>Mini</b>				<b>2008-2010</b>			
<b>Cooper</b>				OE Sensor: Mitsubishi - MN103081			
<b>2008-2009</b>				EZ-Sensor.....			
OE Sensor: BMW - 36236781847					33000 <sup>A</sup>	11.5	1.3
Sensor; Includes Transmitter Only.....	20083	35	4		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/43mm Silver Insert.....	20037	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	35	4	Sensor.....	20034 <sup>B</sup>	45-53	5-6
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack.....	20003	45-53	5-6
Service Pack; W/51mm Orange Insert.....	20040	35	4	<b>2011</b>			
<b>2009</b>				OE Sensor: Mitsubishi - 4250B877			
OE Sensor: BMW - 36 10 6 790 054				EZ-Sensor.....			
Sensor; Includes Transmitter Only.....	28081	40	4.5		33000 <sup>A</sup>	11.5	1.3
<b>2010-2013</b>					33500 <sup>A, DB</sup>	11.5	1.3
OE Sensor: BMW - 36 10 6 790 054				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; Includes Transmitter Only.....	28081	40	4.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	35	4	Sensor.....	20034 <sup>B</sup>	49	5.5
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack.....	20003	45-53	5-6
Service Pack; W/48mm Green Insert.....	20038	35	4	<b>2012</b>			
Service Pack; W/49mm Black Insert.....	20039	35	4	OE Sensor: Mitsubishi - 42508875			
Service Pack; W/51mm Orange Insert.....	20040	35	4	EZ-Sensor.....			
<b>2014</b>					33500 <sup>A, DB</sup>	11.5	1.3
OE Sensor: BMW - 36 10 6 790 054, 36 10 6 798 872				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	20034 <sup>B</sup>	45-53	5-6
	34000	62	7	Service Pack.....	20003	45-53	5-6
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2013</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	OE Sensor: Mitsubishi - MN103033			
Sensor; Includes Transmitter Only.....	28126	40	4.5	EZ-Sensor.....			
Sensor; Transmitter only.....	28081	40	4.5		33100 <sup>A</sup>	11.5	1.3
Sensor; Transmitter only.....	28126	40	4.5		33200 <sup>A</sup>	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	35	4		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; W/43mm Silver Insert.....	20037	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/48mm Green Insert.....	20038	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	35	4	Sensor.....	20028 <sup>B</sup>	45-53	5-6
Service Pack; W/51mm Orange Insert.....	20040	35	4	Service Pack.....	20003	45-53	5-6
<b>2015</b>				<b>2006</b>			
OE Sensor: BMW - 36 10 6 798 872				OE Sensor: Mitsubishi - MN103033, MN103081			
Sensor.....	28126	40	4.5	EZ-Sensor.....			
Service Pack; Does Not Include Valve.....	20023	35	4		33100 <sup>A</sup>	11.5	1.3
Service Pack; W/43mm Silver Insert.....	20037	35	4		33200 <sup>A</sup>	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	35	4	EZ-Sensor; Sept. 1 & Newer.....	33000 <sup>A</sup>	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	35	4		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
				Sensor; Aug. & Older.....	20028 <sup>B</sup>	45-53	5-6
				Sensor; Sept. 1 & Newer.....	20034 <sup>B</sup>	45-53	5-6
				Service Pack.....	20003	45-53	5-6

A-Programming Tool Required    B-Magnet may be Required to Activate Sensor    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mitsubishi (cont'd)</b>				<b>Mitsubishi (cont'd)</b>			
<b>Endeavor (cont'd)</b>				<b>Galant (cont'd)</b>			
<b>2007</b>				<b>2007</b>			
OE Sensor: Mitsubishi - MN103081				OE Sensor: Mitsubishi - 4250A030, MN103081			
EZ-Sensor	33100 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33200 A	11.5	1.3		33500 A, DB		
EZ-Sensor; W/315 MHz Sensor	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor; W/Alloy Wheels	20034 B	45-53	5-6
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor; W/Steel Wheels	28129	45-53	5-6
Sensor	20034 B	45-53	5-6	Service Pack; W/Alloy Wheels	20003	45-53	5-6
Service Pack	20003	45-53	5-6	Service Pack; W/Steel Wheels	20010	45-53	5-6
<b>2008</b>				<b>2008-2009</b>			
OE Sensor: Mitsubishi - MN103081				OE Sensor: Mitsubishi - 4250A030, MN103081			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	20034 B	45-53	5-6	Sensor; W/Alloy Wheels	20034 B	45-53	5-6
Service Pack	20003	45-53	5-6	Sensor; W/Steel Wheels	28129	45-53	5-6
<b>2010</b>				<b>2010-2012</b>			
OE Sensor: Mitsubishi - MN103081				OE Sensor: Mitsubishi - 4250B875, 4250B877			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	20034 B	45-53	5-6	Sensor; W/Alloy Wheels	20034 B	49	5.5
Service Pack	20003	45-53	5-6	Sensor; W/Steel Wheels	28129	45-53	5-6
<b>2011</b>				<b>2010-2012</b>			
OE Sensor: Mitsubishi - 4250B875, 4250B877				OE Sensor: Mitsubishi - 4250B875, 4250B877			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor; W/Alloy Wheels	20034 B	49	5.5	Sensor; W/Alloy Wheels	20034 B	49	5.5
Sensor; W/Steel Wheels	28129	45-53	5-6	Sensor; W/Steel Wheels	28129	45-53	5-6
Service Pack; W/Alloy Wheels	20003	45-53	5-6	Service Pack; W/Alloy Wheels	20003	45-53	5-6
Service Pack; W/Steel Wheels	20010	45-53	5-6	Service Pack; W/Steel Wheels	20010	45-53	5-6
<b>2012</b>				<b>2013</b>			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
<b>Galant</b>				<b>i-MiEV</b>			
<b>2004-2006</b>				<b>2012</b>			
OE Sensor: Mitsubishi - MN103033				OE Sensor: Mercedes-Benz - 4250B668			
EZ-Sensor	33100 A	11.5	1.3	EZ-Sensor	33500 A, DB		
	33200 A	11.5	1.3	EZ-Sensor Service Pack	20018 C	11.5	1.3
	33500 A, DB	11.5	1.3		34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor	28096	71	8
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Service Pack	20030	71	8
Sensor	20028 B	45-53	5-6	<b>Lancer</b>			
Service Pack	20003	45-53	5-6	<b>2008-2010</b>			
				OE Sensor: Mitsubishi - 4250A225			
				EZ-Sensor			
				EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators			
				EZ-Sensor Service Pack; Aluminium Valve			
				EZ-Sensor Service Pack; Rubber Valve			
				Sensor			
				Service Pack			

A-Programming Tool Required    B-Magnet may be Required to Activate Sensor    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mitsubishi (cont'd)</b>				<b>Mitsubishi (cont'd)</b>			
<b>Lancer (cont'd)</b>				<b>Montero Sport</b>			
<b>2011</b>				<b>2003-2004</b>			
OE Sensor: Mitsubishi - 4250A225				OE Sensor: Mitsubishi - MN103081			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28096	71	8	Sensor.....	20034 <sup>B</sup>	45-53	5-6
Service Pack.....	20030	71	8	Service Pack.....	20003	45-53	5-6
<b>2012</b>				<b>Outlander</b>			
OE Sensor: Mitsubishi - 4250A225				<b>2007-2010</b>			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	OE Sensor: Mitsubishi - 4250A225			
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28096	71	8	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack.....	20030	71	8	Sensor.....	28096	71	8
Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack.....	20030	71	8
<b>2013-2014</b>				<b>2011-2015</b>			
OE Sensor: Mitsubishi - 4250B8975, 4250B975				OE Sensor: Mitsubishi - 4250A225, 4250B8975			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28096	71	8	Sensor.....	28096	71	8
Service Pack.....	20030	71	8	Service Pack.....	20030	71	8
<b>2015</b>				<b>Outlander Sport</b>			
OE Sensor: Mitsubishi - 4250B8975				<b>2011-2015</b>			
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	OE Sensor: Mitsubishi - 4250A225, 4250B8975			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
Sensor.....	28096	71	8	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack.....	20030	71	8	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
<b>Mirage</b>				<b>Raider</b>			
<b>2014</b>				<b>2008-2009</b>			
OE Sensor: Mitsubishi - 4250B8975				OE Sensor: Chrysler - 56029319AA, 56029319AB			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28096	71	8	Sensor.....	28461 <sup>G</sup>	11.5	1.3
Service Pack.....	20030	71	8	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013	58	6.5
<b>Montero</b>				<b>Service Pack; Fits Schrader Sensor; Includes Stem Only.....</b>			
<b>2003-2006</b>				<b>20020</b>			
OE Sensor: Mitsubishi - MN103081							
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3				
	33500 <sup>A, DB</sup>	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3				
Sensor.....	20034 <sup>B</sup>	45-53	5-6				
Service Pack.....	20003	45-53	5-6				

A-Programming Tool Required    B-Magnet may be Required to Activate Sensor    C-20018 and 20008 are interchangeable.    DB-Replaces 33000,33100 & 33200  
G-Supercedes the 28154

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Mitsubishi (cont'd)</b>				<b>Nissan (cont'd)</b>			
<b>RVR</b>				<b>Altima</b>			
<b>2011-2014</b>				<b>2006</b>			
OE Sensor: Mitsubishi - 4250B8975				OE Sensor: Nissan - 40700-JA01B			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28096	71	8	Sensor; Oct. 1 & Newer.....	28204	71	8
Service Pack.....	20030	71	8	Service Pack; Oct. 1 & Newer.....	20014	71	8
<b>2015</b>				<b>2007-2010</b>			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Nissan - 40700-JA01B, 40700-JA02B			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3		33500 A, DB	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Sensor.....	28204	71	8
				Service Pack.....	20014	71	8
<b>Nissan</b>				<b>2011-2012</b>			
<b>350Z</b>				<b>Armada</b>			
<b>2003-2006</b>				<b>2005-2006</b>			
OE Sensor: Nissan - 40700-CD001				OE Sensor: Nissan - 40700-1AA0D, 40700-JA01B			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	20064	49	5.5	Sensor.....	28204	49	5.5
Service Pack.....	20007	49	5.5	Service Pack.....	20014	71	8
<b>2007-2009</b>				<b>2007</b>			
OE Sensor: Nissan - 40700-JA01B, 40700-JA01C				OE Sensor: Nissan - 40700-CK001, 40700-CK002			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28204	71	8	Sensor; W/Alloy Wheels.....	20161	49	5.5
Service Pack.....	20014	71	8	Sensor; W/Steel Wheels.....	20069	49	5.5
				Service Pack; W/Alloy Wheels.....	20007	49	5.5
				Service Pack; W/Steel Wheels.....	20005	49	5.5
<b>370Z</b>				<b>2007</b>			
<b>2009-2010</b>				<b>2007</b>			
OE Sensor: Nissan - 40700-JK00B				OE Sensor: Nissan - 40700-CK001			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28210	71	8	Sensor.....	20161	49	5.5
Service Pack.....	20014	71	8	Service Pack.....	20007	49	5.5
<b>2010</b>				<b>2008</b>			
Service Pack.....	20032	50-60	5.6 - 7.	OE Sensor: Nissan - 40700-CK001, 40700-JA02B			
<b>2011-2013</b>				<b>2008</b>			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Service Pack.....	20032	50-60	5.6 - 7.	Sensor; LE.....	28204	49	5.5
<b>2014-2016</b>				<b>2008</b>			
EZ-Sensor.....	33000 A	11.5	1.3	Sensor; SE.....	20161	49	5.5
	33500 A, DB	11.5	1.3	Service Pack; LE.....	20014	49	5.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; SE.....	20007	49	5.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Nissan (cont'd)</b>				<b>Nissan (cont'd)</b>			
<b>Armada (cont'd)</b>				<b>Frontier</b>			
<b>2009-2011</b>				<b>2003-2004</b>			
OE Sensor: Nissan - 40700-JA01B				OE Sensor: Nissan - 40700-CD001			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28204	49	5.5	Sensor.....	20064	36-60	4.1-6.8
Service Pack.....	20014	49	5.5	Service Pack.....	20007	36-60	4.1-6.8
<b>2012-2015</b>				<b>2005-2007</b>			
OE Sensor: Nissan - 40700-1AA0D, 407001AA0D				OE Sensor: Nissan - 40700-CK001, 40700-CK002			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28204	49	5.5	Sensor; W/Alloy Wheels.....	20161	49	5.5
Service Pack.....	20014	71	8	Sensor; W/Steel Wheels.....	20069	49	5.5
<b>2016</b>				<b>2008</b>			
Sensor.....	28204	49	5.5	OE Sensor: Nissan - 40700-CK001, 40700-JA01B			
Service Pack.....	20014	71	8	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
<b>Cube</b>							
<b>2009-2010</b>							
OE Sensor: Nissan - 40700-JA01C				EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor; W/Alloy Wheels.....	20161	49	5.5
Sensor.....	28204	71	8	Sensor; W/Steel Wheels.....	28204	49	5.5
Service Pack.....	20014	71	8	Service Pack; W/Alloy Wheels.....	20007	49	5.5
<b>2011-2012</b>				<b>2009-2011</b>			
OE Sensor: Nissan - 40700-1AA0B, 40700-1AA0D				OE Sensor: Nissan - 40700-1AA0B, 40700-JA01B			
EZ-Sensor; Ikey.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
EZ-Sensor; non-Ikey.....	33000 <sup>A</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Ikey; Aluminium Valve...	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Ikey; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	28204	49	5.5
EZ-Sensor Service Pack; non-Ikey; Aluminium Valve.....	34000	62	7	Service Pack.....	20014	49	5.5
EZ-Sensor Service Pack; non-Ikey; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>2012-2015</b>			
Sensor; non-Ikey.....	28204	49	5.5	OE Sensor: Nissan - 40700-1AA0D, 407001AA0D			
Service Pack; non-Ikey.....	20014	49	5.5	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
<b>2013</b>							
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor.....	28204	49	5.5
<b>2014</b>				<b>2016</b>			
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	OE Sensor: Nissan - 407001AA0D			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28204	49	5.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack.....	20014	71	8

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Nissan (cont'd)</b>				<b>Nissan (cont'd)</b>			
<b>GT-R</b>				<b>Leaf</b>			
<b>2009</b>				<b>2011-2013</b>			
OE Sensor: Nissan - 40700-JA01C				EZ-Sensor: . . . . .	33000 A	11.5	1.3
EZ-Sensor: . . . . .	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3				
Sensor. . . . .	28204	71	8	<b>Maxima</b>			
Service Pack. . . . .	20014	71	8	<b>2006</b>			
<b>2010</b>				OE Sensor: Nissan - 40700-CK001			
OE Sensor: Nissan - 40700-JA01C				EZ-Sensor: . . . . .			
EZ-Sensor; When installing EZ-Sensor the				33000 A			
rubber valve MUST be removed and replaced				11.5			
with Schrader Aluminium valve kit 34000. . . . .				1.3			
	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	Sensor; Jun. & Newer. . . . .	20161	49	5.5
Sensor. . . . .	28204	71	8	Service Pack; Jun. & Newer. . . . .	20007	49	5.5
Service Pack. . . . .	20014	71	8	<b>2007</b>			
<b>2011-2016</b>				OE Sensor: Nissan - 40700-CK001, 40700-JA01B			
OE Sensor: Nissan - 40700-1AA0B, 40700-1AA0D, 40700-JA01B,				EZ-Sensor: . . . . .			
407001AA0B				33000 A			
EZ-Sensor; When installing EZ-Sensor the				11.5			
rubber valve MUST be removed and replaced				1.3			
with Schrader Aluminium valve kit 34000. . . . .				33500 A, DB			
	33000 A	11.5	1.3		34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve. . . . .	34000	62	7	EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve. . . . .	20018 C	11.5	1.3	Sensor; Apr. 1 & Newer. . . . .	28204	68	7.7
Sensor. . . . .	28204	49	5.5	Sensor; Mar. & Older. . . . .	20161	49	5.5
Service Pack. . . . .	20014	71	8	Service Pack; Apr. 1 & Newer. . . . .	20014	68	7.7
				Service Pack; Mar. & Older. . . . .			
				20007			
				49			
				5.5			
				<b>2008-2010</b>			
				OE Sensor: Nissan - 40700-JA01B, 40700-JA02B			
				EZ-Sensor: . . . . .			
				33000 A			
				11.5			
				1.3			
				33500 A, DB			
				11.5			
				1.3			
				EZ-Sensor Service Pack; Aluminium Valve. . . . .			
				34000			
				62			
				7			
				EZ-Sensor Service Pack; Rubber Valve. . . . .			
				20018 C			
				11.5			
				1.3			
				Sensor. . . . .			
				28204			
				68			
				7.7			
				Service Pack. . . . .			
				20014			
				68			
				7.7			
				<b>2011-2012</b>			
				OE Sensor: Nissan - 40700-1AA0D, 40700-JA01B			
				EZ-Sensor: . . . . .			
				33000 A			
				11.5			
				1.3			
				33500 A, DB			
				11.5			
				1.3			
				EZ-Sensor Service Pack; Aluminium Valve. . . . .			
				34000			
				62			
				7			
				EZ-Sensor Service Pack; Rubber Valve. . . . .			
				20018 C			
				11.5			
				1.3			
				Sensor. . . . .			
				28204			
				49			
				5.5			
				Service Pack. . . . .			
				20014			
				71			
				8			
				<b>2013</b>			
				EZ-Sensor: . . . . .			
				33100 A			
				11.5			
				1.3			
				33200 A			
				11.5			
				1.3			
				EZ-Sensor; exc GCC. . . . .			
				33000 A			
				11.5			
				1.3			
				33500 A, DB			
				11.5			
				1.3			
				EZ-Sensor Service Pack; exc GCC; Aluminium			
				Valve. . . . .			
				34000			
				62			
				7			
				EZ-Sensor Service Pack; exc GCC; Rubber Valve. . . . .			
				20018 C			
				11.5			
				1.3			
				<b>2014-2015</b>			
				EZ-Sensor; exc GCC. . . . .			
				33000 A			
				11.5			
				1.3			
				33500 A, DB			
				11.5			
				1.3			
				EZ-Sensor Service Pack; exc GCC; Aluminium			
				Valve. . . . .			
				34000			
				62			
				7			
				EZ-Sensor Service Pack; exc GCC; Rubber Valve. . . . .			
				20018 C			
				11.5			
				1.3			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Nissan (cont'd)</b>				<b>Nissan (cont'd)</b>			
<b>Murano</b>				<b>NV (cont'd)</b>			
<b>2003-2006</b>				<b>2013-2015</b>			
OE Sensor: Nissan - 40700-CD001				OE Sensor: Nissan - 40700-1A00D, 40700-1PA0A, 407001PA0A			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	20064	66	7.5	Sensor.....	28342	68	7.7
Service Pack.....	20007	66	7.5	Service Pack.....	20014	71	8
<b>2007</b>				<b>2014-2015</b>			
OE Sensor: Nissan - 40700-JA01B				Sensor.....	28204	49	5.5
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	<b>2016</b>			
	33500 <sup>A, DB</sup>	11.5	1.3	OE Sensor: Nissan - 407001PA0A			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28204	49	5.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3		28342	68	7.7
Sensor.....	28204	71	8	Service Pack.....	20014	71	8
Service Pack.....	20014	71	8	<b>Pathfinder</b>			
<b>2009</b>				<b>2003</b>			
OE Sensor: Nissan - 40700-JA01B				OE Sensor: Nissan - 40700-CD001			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28204	68	7.7	Sensor.....	20064	49	5.5
Service Pack.....	20014	68	7.7	Service Pack.....	20007	49	5.5
<b>2010</b>				<b>2004</b>			
OE Sensor: Nissan - 40700-1AA0B				OE Sensor: Nissan - 40700-CD001, 40700-CK002			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28204	35	4	Sensor; Armada.....	20069	49	5.5
Service Pack.....	20014	49	5.5	Sensor; Exc. Armada; Aug. & Newer.....	20069	49	5.5
<b>2011</b>				<b>2005-2006</b>			
OE Sensor: Nissan - 40700-1AA0B				OE Sensor: Nissan - 40700-CK001			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28204	49	5.5	Sensor.....	20161	49	5.5
Service Pack.....	20014	49	5.5	Service Pack.....	20007	49	5.5
<b>2012-2014</b>				<b>2007</b>			
OE Sensor: Nissan - 40700-1AA0D				OE Sensor: Nissan - 40700-JA01A, 40700-JA01B			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28204	49	5.5	Sensor; OEM Part No. 40700JA01A.....	28167	49	5.5
Service Pack.....	20014	71	8	Sensor; OEM Part No. 40700JA01B.....	28204	49	5.5
<b>NV</b>				<b>Service Pack.....</b>			
<b>2012</b>				<b>20014</b>			
OE Sensor: Nissan - 40700-1PA0A							
Sensor.....	28342	68	7.7				
Service Pack.....	20014	71	8				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Nissan (cont'd)</b>				<b>Nissan (cont'd)</b>			
<b>Pathfinder (cont'd)</b>				<b>Rogue</b>			
<b>2008-2011</b>				<b>2008-2009</b>			
OE Sensor: Nissan - 40700-1AA0B, 40700-JA01B, 40700-JA02B				OE Sensor: Nissan - 40700-JA01B, 40700-JA01C			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28204	49	5.5	Sensor	28204	68	7.7
Service Pack	20014	49	5.5	Service Pack	20014	68	7.7
<b>2012</b>				<b>2011</b>			
OE Sensor: Nissan - 40700-1AA0D				OE Sensor: Nissan - 40700-1AA0B			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28204	49	5.5	Sensor	28204	49	5.5
Service Pack	20014	71	8	Service Pack	20014	49	5.5
<b>Quest</b>				<b>2012</b>			
<b>2004</b>				OE Sensor: Nissan - 40700-1AA0D			
OE Sensor: Nissan - 40700-CK002				EZ-Sensor			
EZ-Sensor	33000 A	11.5	1.3		33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	20069	78	8.8	Sensor	28204	49	5.5
Service Pack	20005	78	8.8	Service Pack	20014	71	8
<b>2005-2006</b>				<b>2013</b>			
OE Sensor: Nissan - 40700-CK001, 40700-CK002				EZ-Sensor			
EZ-Sensor	33000 A	11.5	1.3		33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor; W/Alloy Wheels	20161	78	8.8		33500 A, DB	11.5	1.3
Sensor; W/Steel Wheels	20069	78	8.8		34000	62	7
Service Pack; W/Alloy Wheels	20007	78	8.8		20018 C	11.5	1.3
Service Pack; W/Steel Wheels	20005	78	8.8	<b>2015</b>			
<b>2007-2009</b>				EZ-Sensor			
OE Sensor: Nissan - 40700-JA01B, 40700-JA02B							
EZ-Sensor	33000 A	11.5	1.3		33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28204	49	5.5	Sensor; W/Alloy Wheels	20161	78	8.8
Service Pack	20014	49	5.5	Sensor; W/Steel Wheels	28204	71	8
<b>2011-2016</b>				Service Pack; W/Alloy Wheels			
EZ-Sensor	33000 A	11.5	1.3		20007	78	8.8
	33500 A, DB	11.5	1.3	Service Pack; W/Steel Wheels	20014	71	8
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>2008</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	OE Sensor: Nissan - 40700-JA01B			
				EZ-Sensor			
					33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
				Sensor	28204	71	8
				Sensor	28204	71	8
				Service Pack	20014	71	8

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Nissan (cont'd)</b>				<b>Nissan (cont'd)</b>			
<b>Sentra (cont'd)</b>				<b>Titan (cont'd)</b>			
<b>2009-2010</b>				<b>2008-2011</b>			
OE Sensor: Nissan - 40700-JA01B				OE Sensor: Nissan - 40700-1AA0B, 40700-JA02B			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28204	68	7.7	Sensor.....	28204	49	5.5
Service Pack.....	20014	68	7.7	Service Pack.....	20014	49	5.5
<b>2011-2013</b>				<b>2012-2015</b>			
OE Sensor: Nissan - 40700-1AA0B, 40700-1AA0D				OE Sensor: Nissan - 40700-1AA0D			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28204	49	5.5	Sensor.....	28204	49	5.5
Service Pack.....	20014	71	8	Service Pack.....	20014	71	8
<b>Titan</b>				<b>Versa</b>			
<b>2004</b>				<b>2007</b>			
OE Sensor: Nissan - 40700-CK002				OE Sensor: Nissan - 40700-JA01A, 40700-JA01B			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	20069	49	5.5	Sensor; OEM Part No. 40700JA01A.....	28167	71	8
Service Pack.....	20005	49	5.5	Sensor; OEM Part No. 40700JA01B.....	28204	71	8
<b>2005</b>				<b>2008-2010</b>			
OE Sensor: Nissan - 40700-CK001, 40700-CK002				OE Sensor: Nissan - 40700-JA01B			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor; Apr. 1 & Newer.....	20161	49	5.5	Sensor.....	28204	71	8
Sensor; Mar. & Older.....	20069	49	5.5	Service Pack.....	20014	71	8
Service Pack; Apr. 1 & Newer.....	20007	49	5.5	<b>2011-2012</b>			
Service Pack; Mar. & Older.....	20005	49	5.5	OE Sensor: Nissan - 40700-1AA0D, 40700-JA01B			
<b>2006</b>				EZ-Sensor.....			
OE Sensor: Nissan - 40700-CK001				EZ-Sensor.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3		33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	20161	49	5.5	Sensor.....	28204	49	5.5
Service Pack.....	20007	49	5.5	Service Pack.....	20014	71	8
<b>2007</b>				<b>Xterra</b>			
OE Sensor: Nissan - 40700-CK001, 40700-JA02B				<b>2003-2004</b>			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	OE Sensor: Nissan - 40700-CD001			
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
Sensor; Apr. 1 & Newer.....	28204	49	5.5	EZ-Sensor Service Pack; Rubber Valve.....			
Sensor; Mar. & Older.....	20161	49	5.5	Sensor.....			
Service Pack; Apr. 1 & Newer.....	20014	49	5.5	Service Pack.....			
Service Pack; Mar. & Older.....	20007	49	5.5	Service Pack.....			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Nissan (cont'd)</b>				<b>Plymouth</b>			
<b>Xterra (cont'd)</b>				<b>Prowler</b>			
<b>2005</b>				<b>1997</b>			
OE Sensor: Nissan - 40700-CK001				OE Sensor: Chrysler - 4815132			
EZ-Sensor	33000 A	11.5	1.3	Sensor	28004	35	4
	33500 A, DB	11.5	1.3	Service Pack; W/Black Sensor Body	20012	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/Red Sensor Body	20003	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>1999-2001</b>			
Sensor	20161	36-60	4.1-6.8	OE Sensor: Chrysler - 4815132, 4815132AB			
Service Pack	20007	36-60	4.1-6.8	Sensor	28004	35	4
<b>2006</b>				Service Pack; W/Black Sensor Body	20012	35	4
OE Sensor: Nissan - 40700-CK001, 40700-CK002				Service Pack; W/Red Sensor Body	20003	35	4
EZ-Sensor	33000 A	11.5	1.3	<b>Pontiac</b>			
	33500 A, DB	11.5	1.3	<b>Aztek</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>2003-2005</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	INDIRECT D		
Sensor; Exc. Submodel X	20161	49	5.5	<b>Bonneville</b>			
Sensor; Submodel X	20069	49	5.5	<b>2000-2005</b>			
Service Pack; Exc. Submodel X	20007	49	5.5	Sensor	INDIRECT D		
Service Pack; Submodel X	20005	49	5.5	<b>G Series</b>			
<b>2007</b>				<b>2008</b>			
OE Sensor: Nissan - 40700-JA01A, 40700-JA01B				OE Sensor: General Motors - 15921013, 15922396			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor; OEM Part No. 40700JA01A	28167	49	5.5	Sensor	20153	62	7
Sensor; OEM Part No. 40700JA01B	28204	49	5.5		20158	62	7
Service Pack	20014	49	5.5	Service Pack	20008 C	11.5	1.3
<b>2008-2011</b>				Service Pack; W/Schrader Sensor	20004	62	7
OE Sensor: Nissan - 40700-1AA0B, 40700-JA01B				Service Pack; W/Siemens Sensor	20030	80	9
EZ-Sensor	33000 A	11.5	1.3	<b>2009-2010</b>			
	33500 A, DB	11.5	1.3	OE Sensor: General Motors - 15922396, 25920615			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3		33500 A, DB	11.5	1.3
Sensor	28204	49	5.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack	20014	49	5.5	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
<b>2012-2015</b>				Sensor	20153	11.5	1.3
OE Sensor: Nissan - 40700-1AA0D				Service Pack	20008 C	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3	<b>Grand Am</b>			
	33500 A, DB	11.5	1.3	<b>1999-2002</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor	INDIRECT D		
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>Grand Prix</b>			
Sensor	28204	49	5.5	<b>2004-2006</b>			
Service Pack	20014	71	8	Sensor	INDIRECT D		
<b>2016</b>				<b>Oldsmobile</b>			
Sensor	28204	49	5.5	<b>Alero</b>			
Service Pack	20014	71	8	<b>1999-2000</b>			
<b>Oldsmobile</b>				<b>Aurora</b>			
<b>Alero</b>				<b>2001-2003</b>			
<b>1999-2000</b>				Sensor			
Sensor				INDIRECT D			
<b>Aurora</b>				Sensor			
<b>2001-2003</b>				INDIRECT D			
Sensor				INDIRECT D			

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Pontiac (cont'd)</b>				<b>Pontiac (cont'd)</b>			
<b>Grand Prix (cont'd)</b>				<b>Torrent</b>			
<b>2007</b>				<b>2007-2009</b>			
OE Sensor: General Motors - 10394110				OE Sensor: General Motors - 10394110, 15921013			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	20158	62	7	Sensor.....	20158	62	7
Service Pack; W/Schrader Sensor.....	20004	62	7	Service Pack; W/Schrader Sensor.....	20004	62	7
Service Pack; W/Siemens Sensor.....	20030	80	9	Service Pack; W/Siemens Sensor.....	20030	80	9
<b>2008</b>				<b>Vibe</b>			
OE Sensor: General Motors - 15921013, 15922396				<b>2005-2007</b>			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Sensor.....	INDIRECT <sup>D</sup>		
	33500 <sup>A, DB</sup>	11.5	1.3	<b>2008-2010</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: General Motors - 88974915			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
Sensor; Clamp-In Style Only; W/Aluminium Valve Stem.....	20158	62	7		33500 <sup>A, DB</sup>	11.5	1.3
Sensor; Snap-In Style Only; W/Rubber Valve Stem.....	20153	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Clamp-In Style Only; W/Aluminium Valve Stem.....	20004	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; Snap-In Style Only; W/Rubber Valve Stem.....	20008 <sup>C</sup>	11.5	1.3	Sensor.....	28360	35	4
				Service Pack.....	20032	35	4
<b>Montana</b>				<b>Wave</b>			
<b>2008</b>				<b>2008</b>			
OE Sensor: General Motors - 15268606				OE Sensor: General Motors - 15922396			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	20158	62	7	Sensor.....	20153	11.5	1.3
Service Pack; W/Schrader Sensor.....	20004	62	7	Service Pack.....	20008 <sup>C</sup>	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	80	9	<b>2009</b>			
<b>2009</b>				EZ-Sensor.....			
Sensor.....	20131	62	7		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack.....	20006	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
<b>Solstice</b>				<b>Porsche</b>			
<b>2008-2009</b>				<b>911</b>			
OE Sensor: General Motors - 15921013				<b>2005-2006</b>			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	OE Sensor: Porsche - 99760602120			
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33200 <sup>A</sup>	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3		33500 <sup>A, DB</sup>		
Sensor.....	20158	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/Schrader Sensor.....	20004	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	80	9	Sensor; Includes Transmitter Only.....	28087	31-40	3.5-4.5
<b>2010</b>				Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4
				Service Pack; W/51mm Orange Insert.....	20040	35	4

A-Programming Tool Required    C-20018 and 20008 are interchangeable.    D-Indirect TPMS system. No sensor in wheel    DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Porsche (cont'd)</b>				<b>Porsche (cont'd)</b>			
<b>911 (cont'd)</b>				<b>911 (cont'd)</b>			
<b>2007-2009</b>				<b>2013-2014</b>			
OE Sensor: Porsche - 997 606 021 00, 99760602120				EZ-Sensor: . . . . . 33100 A 11.5 1.3			
EZ-Sensor: . . . . . 33200 A 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7			
. . . . . 33500 A, DB				EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 C 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7				Sensor; Includes Transmitter Only. . . . . 20103 35 4			
EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 C 11.5 1.3				Service Pack; Does Not Include Valve. . . . . 20023 31-40 3.5-4.5			
Sensor; Includes Transmitter Only. . . . . 20077 35 4				Service Pack; W/43mm Silver Insert. . . . . 20037 35 4			
Sensor; Includes Transmitter Only. . . . . 28087 31-40 3.5-4.5				Service Pack; W/48mm Green Insert. . . . . 20038 35 4			
Service Pack; Does Not Include Valve. . . . . 20023 31-40 3.5-4.5				Service Pack; W/49mm Black Insert. . . . . 20039 35 4			
Service Pack; W/43mm Silver Insert. . . . . 20037 35 4				Service Pack; W/51mm Orange Insert. . . . . 20040 35 4			
Service Pack; W/48mm Green Insert. . . . . 20038 35 4				<b>2015</b>			
Service Pack; W/49mm Black Insert. . . . . 20039 35 4				Sensor. . . . . 20103 35 4			
Service Pack; W/51mm Orange Insert. . . . . 20040 35 4				Service Pack; Does Not Include Valve. . . . . 20023 31-40 3.5-4.5			
<b>2010</b>				Service Pack; W/43mm Silver Insert. . . . . 20037 35 4			
OE Sensor: Porsche - 958 361 661 00, 99760602120				Service Pack; W/48mm Green Insert. . . . . 20038 35 4			
EZ-Sensor: . . . . . 33500 A, DB				Service Pack; W/49mm Black Insert. . . . . 20039 35 4			
EZ-Sensor; Excluding GT3. . . . . 33100 A 11.5 1.3				Service Pack; W/51mm Orange Insert. . . . . 20040 35 4			
. . . . . 33200 A 11.5 1.3				<b>Boxster</b>			
EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7				<b>2005-2007</b>			
EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 C 11.5 1.3				OE Sensor: Porsche - 99760602120			
Sensor; Includes Transmitter Only. . . . . 20103 35 4				EZ-Sensor: . . . . . 33100 A 11.5 1.3			
. . . . . 28087 31-40 3.5-4.5				. . . . . 33200 A 11.5 1.3			
Service Pack; Does Not Include Valve. . . . . 20023 31-40 3.5-4.5				. . . . . 33500 A, DB			
Service Pack; W/43mm Silver Insert. . . . . 20037 35 4				EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7			
Service Pack; W/48mm Green Insert. . . . . 20038 35 4				EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 C 11.5 1.3			
Service Pack; W/49mm Black Insert. . . . . 20039 35 4				Sensor; Includes Transmitter Only. . . . . 28087 31-40 3.5-4.5			
Service Pack; W/51mm Orange Insert. . . . . 20040 35 4				Service Pack; Does Not Include Valve. . . . . 20023 31-40 3.5-4.5			
<b>2011</b>				Service Pack; W/43mm Silver Insert. . . . . 20037 35 4			
OE Sensor: Porsche - 95536105300				Service Pack; W/48mm Green Insert. . . . . 20038 35 4			
EZ-Sensor: . . . . . 33100 A 11.5 1.3				Service Pack; W/49mm Black Insert. . . . . 20039 35 4			
. . . . . 33200 A 11.5 1.3				Service Pack; W/51mm Orange Insert. . . . . 20040 35 4			
. . . . . 33500 A, DB				<b>2008-2010</b>			
EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7				OE Sensor: Porsche - 99760602120			
EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 C 11.5 1.3				EZ-Sensor: . . . . . 33100 A 11.5 1.3			
Sensor; Includes Transmitter Only. . . . . 20077 35 4				. . . . . 33200 A 11.5 1.3			
Service Pack; Does Not Include Valve. . . . . 20023 35 4				. . . . . 33500 A, DB			
. . . . . 20023 31-40 3.5-4.5				EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7			
Service Pack; W/43mm Silver Insert. . . . . 20037 35 4				EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 C 11.5 1.3			
Service Pack; W/48mm Green Insert. . . . . 20038 35 4				Sensor; Includes Transmitter Only. . . . . 28087 31-40 3.5-4.5			
Service Pack; W/49mm Black Insert. . . . . 20039 35 4				Service Pack; Does Not Include Valve. . . . . 20023 31-40 3.5-4.5			
Service Pack; W/51mm Orange Insert. . . . . 20040 35 4				Service Pack; W/43mm Silver Insert. . . . . 20037 35 4			
<b>2012</b>				Service Pack; W/48mm Green Insert. . . . . 20038 35 4			
OE Sensor: Porsche - 99760602120				Service Pack; W/49mm Black Insert. . . . . 20039 35 4			
EZ-Sensor: . . . . . 33100 A 11.5 1.3				Service Pack; W/51mm Orange Insert. . . . . 20040 35 4			
. . . . . 33200 A 11.5 1.3				<b>2011</b>			
. . . . . 33500 A, DB				OE Sensor: Porsche - 95536105300			
EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7				EZ-Sensor: . . . . . 33100 A 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 C 11.5 1.3				. . . . . 33200 A 11.5 1.3			
Sensor. . . . . 20103 35 4				. . . . . 33500 A, DB			
Sensor; Includes Transmitter Only. . . . . 28087 31-40 3.5-4.5				EZ-Sensor Service Pack; Aluminium Valve. . . . . 34000 62 7			
Service Pack. . . . . 20009 88 10				EZ-Sensor Service Pack; Rubber Valve. . . . . 20018 C 11.5 1.3			
Service Pack; Does Not Include Valve. . . . . 20023 31-40 3.5-4.5				Sensor; Includes Transmitter Only. . . . . 20077 35 4			
Service Pack; W/43mm Silver Insert. . . . . 20037 35 4				Service Pack; Does Not Include Valve. . . . . 20023 35 4			
Service Pack; W/48mm Green Insert. . . . . 20038 35 4				Service Pack; W/43mm Silver Insert. . . . . 20037 35 4			
Service Pack; W/49mm Black Insert. . . . . 20039 35 4				Service Pack; W/48mm Green Insert. . . . . 20038 35 4			
Service Pack; W/51mm Orange Insert. . . . . 20040 35 4				Service Pack; W/49mm Black Insert. . . . . 20039 35 4			
				Service Pack; W/51mm Orange Insert. . . . . 20040 35 4			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Porsche (cont'd)</b>				<b>Porsche (cont'd)</b>			
<b>Boxster (cont'd)</b>				<b>Cayenne (cont'd)</b>			
<b>2012-2013</b>				<b>2008-2010</b>			
Service Pack; Does Not Include Valve.....	20023	35	4	Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/51mm Orange Insert.....	20040	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
<b>2014-2016</b>				<b>2011-2013</b>			
Sensor.....	20103	35	4	OE Sensor: Porsche - 95836166100			
Service Pack; Does Not Include Valve.....	20023	35	4	Sensor; Includes Transmitter Only.....	20103	35	4
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/51mm Orange Insert.....	20040	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
<b>Carrera GT</b>				<b>2014</b>			
<b>2004-2005</b>				OE Sensor: Porsche - 95836166100			
OE Sensor: Porsche - 99760602120				Sensor.....	20103	35	4
EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4
	33200 <sup>A</sup>	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	35	4
	33500 <sup>A, DB</sup>			Service Pack; W/49mm Black Insert.....	20039	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/51mm Orange Insert.....	20040	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>Cayman</b>			
Sensor; Includes Transmitter Only.....	28087	31-40	3.5-4.5	<b>2006-2007</b>			
Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5	OE Sensor: Porsche - 99760602120			
Service Pack; W/43mm Silver Insert.....	20037	35	4	EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	35	4		33200 <sup>A</sup>	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	35	4		33500 <sup>A, DB</sup>		
Service Pack; W/51mm Orange Insert.....	20040	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2006-2011</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3	Sensor; Includes Transmitter Only.....	28087	31-40	3.5-4.5
	33200 <sup>A</sup>	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5
	33500 <sup>A, DB</sup>			Service Pack; W/43mm Silver Insert.....	20037	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4
<b>Cayenne</b>				Service Pack; W/51mm Orange Insert.....	20040	35	4
<b>2002</b>				<b>2008-2010</b>			
EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3	OE Sensor: Porsche - 99760602120			
	33500 <sup>A, DB</sup>			EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3
<b>2003-2006</b>				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: Porsche - 99760602120				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor.....	33100 <sup>A</sup>	11.5	1.3	Sensor; Includes Transmitter Only.....	28087	31-40	3.5-4.5
	33200 <sup>A</sup>	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5
	33500 <sup>A, DB</sup>			Service Pack; W/43mm Silver Insert.....	20037	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4
Sensor; Includes Transmitter Only.....	28087	31-40	3.5-4.5	Service Pack; W/51mm Orange Insert.....	20040	35	4
Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5	<b>2009-2010</b>			
Service Pack; W/43mm Silver Insert.....	20037	35	4	EZ-Sensor.....			
Service Pack; W/48mm Green Insert.....	20038	35	4		33200 <sup>A</sup>	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	35	4				
Service Pack; W/51mm Orange Insert.....	20040	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Porsche (cont'd)</b>				<b>Ram (cont'd)</b>			
<b>Cayman (cont'd)</b>				<b>C/V</b>			
<b>2011</b>				<b>2012</b>			
OE Sensor: Porsche - 95536105300, 99760602120				OE Sensor: Chrysler - 68241067AB			
EZ-Sensor	33100 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor; Includes Transmitter Only	20077	35	4	Sensor; Rubber Valve	20398	11.5	1.3
	28087	31-40	3.5-4.5	Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack; Does Not Include Valve	20023	35	4	<b>2013-2015</b>			
Service Pack; W/43mm Silver Insert	20037	35	4	OE Sensor: Chrysler - 68241067AB			
Service Pack; W/48mm Green Insert	20038	35	4	EZ-Sensor			
Service Pack; W/49mm Black Insert	20039	35	4		33200 A	11.5	1.3
Service Pack; W/51mm Orange Insert	20040	35	4		33500 A, DB	11.5	1.3
<b>2012-2016</b>				EZ-Sensor Service Pack; Aluminium Valve			
Sensor	20103				34000	62	7
Service Pack; Does Not Include Valve	20023	35	4	EZ-Sensor Service Pack; Rubber Valve			
Service Pack; W/43mm Silver Insert	20037	35	4		20018 C	11.5	1.3
Service Pack; W/48mm Green Insert	20038	35	4	Sensor			
Service Pack; W/49mm Black Insert	20039	35	4		20398	11.5	1.3
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; Rubber Valve			
					20018 C	11.5	1.3
<b>Panamera</b>				<b>ProMaster</b>			
<b>2010</b>				<b>2014-2015</b>			
OE Sensor: Porsche - 99760602120				OE Sensor: Chrysler - 5154876AA			
Sensor; Includes Transmitter Only	28087	31-40	3.5-4.5	EZ-Sensor	33200 A	11.5	1.3
Service Pack; Does Not Include Valve	20023	31-40	3.5-4.5		33500 A, DB	11.5	1.3
Service Pack; W/43mm Silver Insert	20037	35	4	EZ-Sensor Service Pack; Aluminium Valve			
Service Pack; W/48mm Green Insert	20038	35	4		34000	62	7
Service Pack; W/49mm Black Insert	20039	35	4	EZ-Sensor Service Pack; exc Hybrid; Rubber Valve			
Service Pack; W/51mm Orange Insert	20040	35	4		20018 C	11.5	1.3
<b>2011</b>				Sensor			
OE Sensor: Porsche - 99760602120					20398	11.5	1.3
Sensor; Includes Transmitter Only	28087	31-40	3.5-4.5	Service Pack; Rubber Valve			
Service Pack; W/43mm Silver Insert	20037	35	4		20018 C	11.5	1.3
Service Pack; W/48mm Green Insert	20038	35	4	<b>2016</b>			
Service Pack; W/49mm Black Insert	20039	35	4	OE Sensor: Chrysler - 5154876AA			
Service Pack; W/51mm Orange Insert	20040	35	4	Sensor			
					20398	11.5	1.3
				Service Pack; Rubber Valve			
					20018 C	11.5	1.3
<b>Ram</b>				<b>Ram Series</b>			
<b>4500</b>				<b>2011</b>			
<b>2012</b>				OE Sensor: Chrysler - 56029398AB			
OE Sensor: Chrysler - 56029398AB				EZ-Sensor			
EZ-Sensor	33200 A	11.5	1.3		33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3		34000	62	7
Sensor	20398	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve			
Service Pack; Rubber Valve	20018 C	11.5	1.3		20018 C	11.5	1.3
				Sensor; W/Rubber Stem Snap-in Sensor			
					20398	11.5	1.3
				Service Pack; W/Rubber Stem Snap-in Sensor			
					20018 C	11.5	1.3
				<b>2012-2013</b>			
				OE Sensor: Chrysler - 56029398AB			
				EZ-Sensor			
					33200 A	11.5	1.3
					33500 A, DB	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve			
					34000	62	7
				EZ-Sensor Service Pack; Rubber Valve			
					20018 C	11.5	1.3
				Sensor			
					20398	11.5	1.3
				Service Pack; Rubber Valve			
					20018 C	11.5	1.3
				<b>2014-2015</b>			
				OE Sensor: Chrysler - 68157568AA, 68239720AA, 68249197AA			
				Sensor			
					28984	35	4
				Service Pack			
					20635	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Rolls Royce</b>				<b>Saturn</b>			
<b>Phantom</b>				<b>Astra</b>			
<b>2007-2010</b>				<b>2008-2009</b>			
Service Pack; Does Not Include Valve. . . . .	20023	31-40	3.5-4.5	OE Sensor: General Motors - 13172567; Saab - 13172567			
Service Pack; W/43mm Silver Insert. . . . .	20037	35	4	Sensor. . . . .	28078	80	9
Service Pack; W/48mm Green Insert. . . . .	20038	35	4	Service Pack. . . . .	20009	80	9
Service Pack; W/49mm Black Insert. . . . .	20039	35	4				
Service Pack; W/51mm Orange Insert. . . . .	20040	35	4	<b>Aura</b>			
				<b>2007</b>			
<b>Saab</b>				OE Sensor: General Motors - 10394110			
<b>9-3</b>				EZ-Sensor. . . . .			
<b>2003-2007</b>				33000 <sup>A</sup> 11.5 1.3			
OE Sensor: Saab - 13172567, 24437708				33500 <sup>A, DB</sup> 11.5 1.3			
Sensor. . . . .	28078	62	7	EZ-Sensor Service Pack; Aluminium Valve. . . . .			
Service Pack. . . . .	20009	62	7	34000 62 7			
				EZ-Sensor Service Pack; Rubber Valve. . . . .			
<b>2008-2011</b>				20018 <sup>C</sup> 11.5 1.3			
OE Sensor: Saab - 13227143				Sensor. . . . .			
Sensor. . . . .	20159	88	10	20158 62 7			
Service Pack. . . . .	20009	88	10	Service Pack; W/Schrader Sensor. . . . .			
				20004 62 7			
				Service Pack; W/Siemens Sensor. . . . .			
				20030 62 7			
<b>9-3X</b>				<b>2008-2009</b>			
<b>2010-2011</b>				OE Sensor: General Motors - 15922396, 25920615			
OE Sensor: Saab - 13227143				EZ-Sensor. . . . .			
Sensor. . . . .	20159	88	10	33000 <sup>A</sup> 11.5 1.3			
Service Pack. . . . .	20009	88	10	33500 <sup>A, DB</sup> 11.5 1.3			
				EZ-Sensor Service Pack; Aluminium Valve. . . . .			
				34000 62 7			
				EZ-Sensor Service Pack; Rubber Valve. . . . .			
				20018 <sup>C</sup> 11.5 1.3			
				Sensor. . . . .			
				20153 11.5 1.3			
				Service Pack. . . . .			
				20008 <sup>C</sup> 11.5 1.3			
				<b>2010</b>			
				EZ-Sensor. . . . .			
				33500 <sup>A, DB</sup> 11.5 1.3			
				EZ-Sensor Service Pack; Aluminium Valve. . . . .			
				34000 62 7			
				EZ-Sensor Service Pack; Rubber Valve. . . . .			
				20018 <sup>C</sup> 11.5 1.3			
				<b>Outlook</b>			
				<b>2007-2008</b>			
				OE Sensor: General Motors - 10394110, 15921013			
				EZ-Sensor. . . . .			
				33000 <sup>A</sup> 11.5 1.3			
				33500 <sup>A, DB</sup> 11.5 1.3			
				EZ-Sensor Service Pack; Aluminium Valve. . . . .			
				34000 62 7			
				EZ-Sensor Service Pack; Rubber Valve. . . . .			
				20018 <sup>C</sup> 11.5 1.3			
				Sensor. . . . .			
				20158 62 7			
				Service Pack; W/Schrader Sensor. . . . .			
				20004 62 7			
				Service Pack; W/Siemens Sensor. . . . .			
				20030 62 7			
				<b>2009-2010</b>			
				OE Sensor: General Motors - 25920615			
				EZ-Sensor. . . . .			
				33000 <sup>A</sup> 11.5 1.3			
				33500 <sup>A, DB</sup> 11.5 1.3			
				EZ-Sensor Service Pack; Aluminium Valve. . . . .			
				34000 62 7			
				EZ-Sensor Service Pack; Rubber Valve. . . . .			
				20018 <sup>C</sup> 11.5 1.3			
				Sensor. . . . .			
				20153 11.5 1.3			
				Service Pack. . . . .			
				20008 <sup>C</sup> 11.5 1.3			
<b>9-5</b>				<b>Sky</b>			
<b>2003-2007</b>				<b>2008-2010</b>			
OE Sensor: Saab - 13172567, 24437708				OE Sensor: General Motors - 15921013			
Sensor. . . . .	28078	62	7	EZ-Sensor. . . . .			
Service Pack. . . . .	20009	62	7	33000 <sup>A</sup> 11.5 1.3			
				33500 <sup>A, DB</sup> 11.5 1.3			
<b>2008-2011</b>				EZ-Sensor Service Pack; Aluminium Valve. . . . .			
OE Sensor: Saab - 13227143				34000 62 7			
Sensor. . . . .	20159	88	10	EZ-Sensor Service Pack; Rubber Valve. . . . .			
Service Pack. . . . .	20009	88	10	20018 <sup>C</sup> 11.5 1.3			
				Sensor. . . . .			
				20153 11.5 1.3			
				Service Pack. . . . .			
				20008 <sup>C</sup> 11.5 1.3			
<b>9-7x</b>							
<b>2005-2009</b>							
OE Sensor: General Motors - 25774006							
Sensor. . . . .	20116	62	7				
Service Pack. . . . .	20004	62	7				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Saturn (cont'd)</b>				<b>Scion (cont'd)</b>			
<b>Vue</b>				<b>tC (cont'd)</b>			
<b>2007-2010</b>				<b>2015</b>			
OE Sensor: General Motors - 15922396, 25920615				OE Sensor: Toyota - 4260733011			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor	28365	35	4
Sensor	20153	11.5	1.3	Service Pack	20032	35	4
Service Pack	20008 C	11.5	1.3	<b>xB</b>			
<b>Scion</b>				<b>2008-2014</b>			
<b>FR-S</b>				OE Sensor: Toyota - 4260733011			
<b>2013</b>				EZ-Sensor			
OE Sensor: Toyota - 4260706020				33000 A			
EZ-Sensor	33000 A	11.5	1.3	33500 A, DB			
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor			
Sensor	28360	35	4	Service Pack			
Service Pack	20032	35	4	<b>2015</b>			
<b>iQ</b>				OE Sensor: Toyota - 4260733011			
<b>2012-2014</b>				EZ-Sensor			
OE Sensor: Toyota - 4260733011				33000 A			
EZ-Sensor	33000 A	11.5	1.3	33500 A, DB			
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor			
Sensor	28365	35	4	Service Pack			
Service Pack	20032	35	4	<b>2015</b>			
<b>2015</b>				OE Sensor: Toyota - 4260733011			
OE Sensor: Toyota - 4260733011				EZ-Sensor			
EZ-Sensor	33500 A, DB	11.5	1.3	33000 A			
	33500 A, DB	11.5	1.3	33500 A, DB			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve			
Sensor	28365	35	4	Sensor			
Service Pack	20032	35	4	Service Pack			
<b>tC</b>				<b>2008-2014</b>			
<b>2006</b>				OE Sensor: Toyota - 4260733011			
OE Sensor: Toyota - 4260733011				EZ-Sensor			
EZ-Sensor	33000 A	11.5	1.3	33000 A			
	33500 A, DB	11.5	1.3	33500 A, DB			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve			
Sensor; May & Newer	28365	35	4	Sensor			
Service Pack; May & Newer	20032	35	4	Service Pack			
<b>2007-2014</b>				<b>2015</b>			
OE Sensor: Toyota - 4260733011				OE Sensor: Toyota - 4260733011			
EZ-Sensor				EZ-Sensor			
	33000 A	11.5	1.3	33500 A, DB			
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor			
Sensor	28365	35	4	Service Pack			
Service Pack	20032	35	4	<b>2015</b>			
<b>Smart</b>				<b>2008-2012</b>			
<b>Fortwo</b>				OE Sensor: Mercedes-Benz - 0025409017, 0045421518			
<b>2008-2012</b>				EZ-Sensor			
OE Sensor: Mercedes-Benz - 0025409017, 0045421518				33200 A			
EZ-Sensor	33200 A	11.5	1.3	33500 A, DB			
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Sensor			
Sensor	28214	58	6.5	Service Pack; Does Not Include Stem			
Service Pack; Does Not Include Stem	20016	53	6	Service Pack; Fits Schrader Sensor; Includes Stem Only			
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	53	6				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Smart (cont'd)</b>				<b>Subaru (cont'd)</b>			
<b>Fortwo (cont'd)</b>				<b>Forester</b>			
<b>2013</b>				<b>2008-2015</b>			
OE Sensor: Mercedes-Benz - 0009057200				OE Sensor: Subaru - 28103AG01B, 28103AG01C, 28103SA001, 28103SG000, 28103SG010			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28214	58	6.5	Sensor.....	28203	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack.....	20008 C	11.5	1.3
Service Pack; W/O Valve.....	20016	58	6.5	<b>2016</b>			
<b>2014</b>				Sensor.....			
OE Sensor: Mercedes-Benz - A0009050030				28203			
Sensor.....	20213			Service Pack.....	20008 C	11.5	1.3
Service Pack.....	20049	80	9	<b>Impreza</b>			
<b>2015</b>				<b>2008-2015</b>			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Subaru - 28103AG01A, 28103AG01B, 28103AG01C, 28103SA002, 28103SG000			
Sensor.....	20213	80	9	EZ-Sensor.....	33000 A	11.5	1.3
Service Pack.....	20049	80	9		33500 A, DB	11.5	1.3
<b>Subaru</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
<b>B9 Tribeca</b>				34000			
<b>2006-2007</b>				62			
OE Sensor: Subaru - 28103AG00A				EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor.....	33000 A	11.5	1.3	20018 C			
	33500 A, DB	11.5	1.3	Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	20081			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack.....			
Sensor.....	20081	66	7.5	20011			
Service Pack.....	20011	66	7.5	<b>2016</b>			
<b>2008-2011</b>				Sensor.....			
EZ-Sensor.....				28203			
33500 A, DB				Service Pack.....			
11.5				20008 C			
1.3				11.5			
EZ-Sensor Service Pack; Aluminium Valve.....				1.3			
34000				62			
62				7			
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
20018 C				20018 C			
11.5				11.5			
1.3				1.3			
<b>BRZ</b>				<b>Legacy</b>			
<b>2013-2014</b>				<b>2004-2007</b>			
OE Sensor: Subaru - 4260706020				OE Sensor: Subaru - 28103AG00A			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28360	35	4	Sensor.....	20081	66	7.5
Service Pack.....	20032	35	4	Service Pack.....	20011	66	7.5
<b>2015</b>				<b>2008</b>			
OE Sensor: Subaru - 28103AG00A, 28103AG01A				OE Sensor: Subaru - 28103AG00A, 28103AG01A			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28360	35	4	Sensor; W/16" Or 17" Wheels.....	20081	66	7.5
Service Pack.....	20032	35	4	Sensor; W/18" Wheels.....	28203	11.5	1.3
<b>2015</b>				Service Pack; W/16" Or 17" Wheels.....			
EZ-Sensor.....				20011			
33500 A, DB				Service Pack; W/18" Wheels.....			
11.5				20008 C			
1.3				11.5			
EZ-Sensor Service Pack; Aluminium Valve.....				1.3			
34000				62			
62				7			
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
20018 C				20018 C			
11.5				11.5			
1.3				1.3			
<b>2009-2015</b>				OE Sensor: Subaru - 28103AG01B, 28103AG01C, 28103AJ00A			
EZ-Sensor.....				EZ-Sensor.....			
33000 A				33000 A			
11.5				11.5			
1.3				1.3			
EZ-Sensor Service Pack; Aluminium Valve.....				EZ-Sensor Service Pack; Aluminium Valve.....			
34000				34000			
62				62			
7				7			
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
20018 C				20018 C			
11.5				11.5			
1.3				1.3			
Sensor.....				Sensor.....			
28203				28203			
11.5				11.5			
1.3				1.3			
Service Pack.....				Service Pack.....			
20008 C				20008 C			
11.5				11.5			
1.3				1.3			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Subaru (cont'd)</b>				<b>Subaru (cont'd)</b>			
<b>Legacy (cont'd)</b>				<b>Tribeca (cont'd)</b>			
<b>2016</b>				<b>2010</b>			
OE Sensor: Subaru - 28103AJ00A				OE Sensor: Subaru - 28103AG00A, 28103AG01C			
Sensor.....	28203	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
Service Pack.....	20008 C	11.5	1.3		33500 A, DB	11.5	1.3
<b>Outback</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
<b>2004-2007</b>				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Subaru - 28103AG00A				Sensor; W/Metal Stem Clamp-in Sensor.....	20081	66	7.5
EZ-Sensor.....	33000 A	11.5	1.3	Sensor; W/Rubber Stem Snap-in Sensor.....	28203	11.5	1.3
	33500 A, DB	11.5	1.3	Service Pack.....	20008 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/Metal Stem Clamp-in Sensor....	20011	66	7.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	<b>2011</b>			
Sensor.....	20081	66	7.5	OE Sensor: Subaru - 28103AG00A, 28103AG01C			
Service Pack.....	20011	66	7.5	EZ-Sensor.....	33000 A	11.5	1.3
<b>2008-2015</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: Subaru - 28103AG01A, 28103AG01B, 28103AG01C, 28103AJ00A				EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	Sensor; W/Metal Stem Clamp-in Sensor.....	20081	66	7.5
	33500 A, DB	11.5	1.3	Sensor; W/Rubber Stem Snap-in Sensor.....	28203	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Rubber Valve.....	20008 C	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; W/Metal Stem Clamp-in Sensor....	20011	66	7.5
Sensor.....	28203	11.5	1.3	<b>2012-2014</b>			
Service Pack.....	20008 C	11.5	1.3	OE Sensor: Subaru - 28103AG01C			
<b>2016</b>				EZ-Sensor.....			
OE Sensor: Subaru - 28103AJ00A					33000 A	11.5	1.3
Sensor.....	28203	11.5	1.3		33500 A, DB	11.5	1.3
Service Pack.....	20008 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>Tribeca</b>				<b>WRX</b>			
<b>2008</b>				<b>2013-2015</b>			
OE Sensor: Subaru - 28103AG00A, 28103AG01A				OE Sensor: Subaru - 28103SA002, 28103SG000			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor; W/Metal Stem Clamp-in Sensor.....	20081	66	7.5	Sensor.....	28203	11.5	1.3
Sensor; W/Rubber Stem Snap-in Sensor.....	28203	11.5	1.3	Service Pack.....	20008 C	11.5	1.3
Service Pack.....	20008 C	11.5	1.3	<b>2016</b>			
Service Pack; W/Metal Stem Clamp-in Sensor....	20011	66	7.5	OE Sensor: Subaru - 28103AJ00A			
<b>2009</b>				Sensor.....			
OE Sensor: Subaru - 28103AG00A, 28103AG01B				Service Pack.....	28203	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		20008 C	11.5	1.3
	33500 A, DB	11.5	1.3	<b>XV Crosstrek</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2013-2015</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	OE Sensor: Subaru - 28103AG01C, 28103SG000			
Sensor; W/Metal Stem Clamp-in Sensor.....	20081	66	7.5	EZ-Sensor.....	33000 A	11.5	1.3
Sensor; W/Rubber Stem Snap-in Sensor.....	28203	11.5	1.3		33500 A, DB	11.5	1.3
Service Pack; Rubber Valve.....	20008 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/Metal Stem Clamp-in Sensor....	20011	66	7.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
				Sensor.....			
				Service Pack.....			
				2016			
				OE Sensor: Subaru - 28103AJ00A			
				Sensor.....			
				Service Pack.....			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Suzuki</b>				<b>Suzuki (cont'd)</b>			
<b>Equator</b>				<b>SX4</b>			
2009-2012				2007-2013			
OE Sensor: Suzuki - 4321182Z10				OE Sensor: Suzuki - 4313054J20, 4313054J21, 4313054J22			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor.....	28204	49	5.5	Sensor.....	20087	80	9
Service Pack.....	20014	49	5.5	Service Pack.....	20009	80	9
2013				<b>SX4 Crossover</b>			
EZ-Sensor.....	33500 <sup>A, DB</sup>	11.5	1.3	2012			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Suzuki - 4313054J21			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
<b>Foreza</b>					33500 <sup>A, DB</sup>	11.5	1.3
2007-2008				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: Suzuki - 4313085Z00				EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Sensor.....			
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>Verona</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	2005-2006			
Sensor.....	20153	11.5	1.3	OE Sensor: Suzuki - 4313086Z20			
Service Pack.....	20008 <sup>C</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
<b>Grand Vitara</b>					33500 <sup>A, DB</sup>	11.5	1.3
2007-2013				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: Suzuki - 4313054J20, 4313054J21, 4313054J22				EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Sensor.....			
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>XL-7</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	2005-2006			
Sensor.....	20087	80	9	OE Sensor: Suzuki - 4313054J20			
Service Pack.....	20009	80	9	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
<b>Kizashi</b>					33500 <sup>A, DB</sup>	11.5	1.3
2010-2012				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: Original Equipment Manufacturer - 43130-57L00				EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Sensor.....			
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2007-2009			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	OE Sensor: Suzuki - 4313078J10			
Sensor.....	28308 <sup>F</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor.					33500 <sup>A, DB</sup>	11.5	1.3
Does not include stem.....	20013	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Fits Schrader Sensor; Includes				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Stem Only.....	20020	58	6.5	Sensor.....			
Service Pack; W/Siemens Sensor.....	20030	71	8	Service Pack; W/Schrader Sensor.....			
<b>Reno</b>				Service Pack; W/Siemens Sensor.....			
2007-2008				2010-2011			
OE Sensor: Suzuki - 4313085Z00				EZ-Sensor.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3				
Sensor.....	20153	11.5	1.3				
Service Pack.....	20008 <sup>C</sup>	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200 F-Supercedes the 20066

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Toyota</b>				<b>Toyota (cont'd)</b>			
<b>4Runner</b>				<b>Avalon</b>			
<b>2003-2005</b>				<b>2006</b>			
OE Sensor: Toyota - 4260735010				OE Sensor: Toyota - 4260706011			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28345	35	4	Sensor; Aug. & Newer	28360	35	4
Service Pack	20031	35	4	Service Pack; Aug. & Newer	20032	35	4
<b>2006</b>				<b>2007-2014</b>			
OE Sensor: Toyota - 4260730030, 4260733011, 4260733021, 4260735010				OE Sensor: Toyota - 4260706011, 4260706020			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor; OEM Part No. 4260730030	28335	35	4	Sensor	28360	35	4
Sensor; OEM Part No. 4260733011	28365	35	4	Service Pack	20032	35	4
Sensor; OEM Part No. 4260733021	28370	35	4	<b>2015</b>			
Sensor; OEM Part No. 4260735010	28345	35	4	OE Sensor: Toyota - 4260706020			
Service Pack; Jun. & Newer	20032	35	4	Sensor	28360	35	4
Service Pack; May & Older	20031	35	4	Service Pack	20032	35	4
<b>2007</b>				<b>Camry</b>			
OE Sensor: Toyota - 4260733011, 4260733021				<b>2007-2011</b>			
EZ-Sensor	33000 A	11.5	1.3	OE Sensor: Toyota - 42607-06011, 42607-33011			
	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor; W/O Valve Cap	28370	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor; W/Valve Cap	28365	35	4	Sensor; Models made in Japan: OEM Part No.			
Service Pack	20032	35	4	4260733011	28365	35	4
<b>2008</b>				Sensor; Models made in USA: OEM Part No.			
OE Sensor: Toyota - 4260733011, 4260733021				4260706011	28360	35	4
EZ-Sensor	33000 A	11.5	1.3	Service Pack	20032	35	4
	33500 A, DB	11.5	1.3	<b>2012-2014</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: Toyota - 42607-06011			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
Sensor; W/O Valve Cap; OEM Part No.					33500 A, DB	11.5	1.3
4260733021	28370	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor; W/Valve Cap; OEM Part No. 4260733011	28365	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack	20032	35	4	Sensor	28360	35	4
<b>2009</b>				Service Pack	20032	35	4
OE Sensor: Toyota - 4260733011, 4260733021				<b>2015</b>			
EZ-Sensor	33000 A	11.5	1.3	OE Sensor: Toyota - 42607-06020			
	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor; W/O Valve Cap	28370	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor; W/Valve Cap	28365	35	4	Sensor	28360	35	4
Service Pack	20032	35	4	Service Pack	20032	35	4
<b>2010-2016</b>				<b>2015</b>			
OE Sensor: Toyota - 4260733021				OE Sensor: Toyota - 42607-06020			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor	28370	35	4	Sensor; Lo Line Sensor	28360	35	4
Service Pack	20032	35	4	Service Pack	20032	35	4

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Toyota (cont'd)</b>				<b>Toyota (cont'd)</b>			
<b>Corolla</b>				<b>Corolla (cont'd)</b>			
<b>2007</b>				<b>2015</b>			
OE Sensor: Toyota - 4260706011, 4260733011				OE Sensor: Toyota - 4260706011			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Sensor; Models made in USA; W/16" Or 17"			
	33500 <sup>A, DB</sup>	11.5	1.3	Wheels.....	28360	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20032	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>FJ Cruiser</b>			
Sensor; Models made in Japan; OEM Part No.				<b>2008-2014</b>			
4260733011; Jun. & Newer.....	28365	35	4	OE Sensor: Toyota - 4260733011			
Sensor; Models made in USA; OEM Part No.				EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
4260706011; Jun. & Newer.....	28360	35	4		33500 <sup>A, DB</sup>	11.5	1.3
Service Pack; Jun. & Newer.....	20032	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
<b>2008</b>				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
OE Sensor: Toyota - 4260706011, 4260733011				Sensor.....	28365	35	4
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Service Pack.....	20032	35	4
	33500 <sup>A, DB</sup>	11.5	1.3	<b>2015</b>			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Toyota - 4260706011			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Sensor; Models made in USA; W/16" Or 17"			
Sensor; Models made in Japan; OEM Part No.				Wheels.....	28360	35	4
4260733011.....	28365	35	4	Service Pack.....	20032	35	4
Sensor; Models made in USA; OEM Part No.				<b>Highlander</b>			
4260706011.....	28360	35	4	<b>2007</b>			
Service Pack.....	20032	35	4	OE Sensor: Toyota - 4260733011			
<b>2009-2012</b>				EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
OE Sensor: Toyota - 4260702010, 4260706011, 4260733011, 4260733021					33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 <sup>A, DB</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; May & Newer.....	28365	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	Service Pack; May & Newer.....	20032	35	4
Sensor; Models made in Japan; OEM Part No.				<b>2008-2010</b>			
4260733011.....	28365	35	4	OE Sensor: Toyota - 4260733011			
Sensor; Models made in Japan; OEM Part No.				EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
4260733021.....	28370	35	4		33500 <sup>A, DB</sup>	11.5	1.3
Sensor; Models made in USA; W/15" Wheels.....	28365	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; Models made in USA; W/16" Or 17"				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Wheels.....	28360	35	4	Sensor.....	28365	35	4
Service Pack.....	20032	35	4	Service Pack.....	20032	35	4
<b>2013</b>				<b>2011-2014</b>			
OE Sensor: Toyota - 4260706011, 4260733011				OE Sensor: Toyota - 4260706011			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor; Models made in Japan.....	28365	35	4	Sensor.....	28365	35	4
Sensor; Models made in USA; W/16" Or 17"				Service Pack.....	20032	35	4
Wheels.....	28360	35	4	<b>2015</b>			
Service Pack.....	20032	35	4	OE Sensor: Toyota - 4260706011			
<b>2014</b>				EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
OE Sensor: Toyota - 4260706011					33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	Sensor.....	28360	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20032	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	<b>2015</b>			
Sensor; Models made in USA; W/16" Or 17"				OE Sensor: Toyota - 4260706011			
Wheels.....	28360	35	4	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
Service Pack.....	20032	35	4		33500 <sup>A, DB</sup>	11.5	1.3
				EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
				Sensor.....	28360	35	4
				Service Pack.....	20032	35	4

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Toyota (cont'd)</b>				<b>Toyota (cont'd)</b>			
<b>Land Cruiser</b>				<b>Matrix (cont'd)</b>			
<b>2005</b>				<b>2008-2013</b>			
OE Sensor: Toyota - 4260733011				OE Sensor: Toyota - 4260706011, 4260733011			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor; May & Newer	28365	35	4	Sensor; Models made in Japan; OEM Part No. 4260733011	28365	35	4
Service Pack; May & Newer	20031	35	4	Sensor; Models made in USA; OEM Part No. 4260706011	28360	35	4
<b>2006</b>				Service Pack	20032	35	4
OE Sensor: Toyota - 4260733011				<b>Prius</b>			
EZ-Sensor	33000 A	11.5	1.3	<b>2005-2013</b>			
	33500 A, DB	11.5	1.3	OE Sensor: Toyota - 4260733011			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3		33500 A, DB	11.5	1.3
Sensor	28365	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; Apr. 1 & Newer	20032	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Service Pack; Mar. & Older	20031	35	4	Sensor	28365	35	4
<b>2007-2011</b>				Service Pack	20032	35	4
OE Sensor: Toyota - 4260733011				<b>2013</b>			
EZ-Sensor	33000 A	11.5	1.3	Sensor	28360	35	4
	33500 A, DB	11.5	1.3	<b>2014-2016</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: Toyota - 4260733011			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
Sensor	28365	35	4		33500 A, DB	11.5	1.3
Service Pack	20032	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
<b>2013-2014</b>				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
OE Sensor: Toyota - 4260733011				Sensor	28365	35	4
EZ-Sensor	33000 A	11.5	1.3	Service Pack	20032	35	4
	33500 A, DB	11.5	1.3	<b>RAV4</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>2006</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	OE Sensor: Toyota - 4260733011			
Sensor	28365	35	4	EZ-Sensor; exc Electric	33000 A	11.5	1.3
Service Pack	20032	35	4		33500 A, DB	11.5	1.3
<b>2015</b>				EZ-Sensor Service Pack; exc Electric; Aluminium Valve	34000	62	7
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; exc Electric; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor; exc Electric	28365	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Service Pack; exc Electric	20032	35	4
Sensor	28365	35	4	<b>2007-2011</b>			
Service Pack	20032	35	4	OE Sensor: Toyota - 4260733021			
<b>Matrix</b>				EZ-Sensor; exc Electric	33000 A	11.5	1.3
<b>2007</b>					33500 A, DB	11.5	1.3
OE Sensor: Toyota - 4260706011, 4260733011				EZ-Sensor Service Pack; exc Electric; Aluminium Valve	34000	62	7
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor Service Pack; exc Electric; Rubber Valve	20018 C	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor; exc Electric	28370	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; exc Electric	20032	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3				
Sensor; Models made in Japan; OEM Part No. 4260733011; Jun. & Newer	28365	35	4				
Sensor; Models made in USA; OEM Part No. 4260706011; Jun. & Newer	28360	35	4				
Service Pack; Jun. & Newer	20032	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200



## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Toyota (cont'd)</b>				<b>Toyota (cont'd)</b>			
<b>RAV4 (cont'd)</b>				<b>Solara</b>			
<b>2012</b>				<b>2006</b>			
OE Sensor: Toyota - 4260706011, 4260733021				OE Sensor: Toyota - 4260706011			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3
Sensor; Electric.....	28360	35	4	Sensor; May & Newer.....	28360	35	4
Sensor; exc Electric.....	28370	35	4	Service Pack; May & Newer.....	20032	35	4
Service Pack.....	20032	35	4	<b>2007-2008</b>			
<b>2013</b>				OE Sensor: Toyota - 4260706011			
OE Sensor: Toyota - 4260733021				EZ-Sensor.....			
Sensor; exc Electric.....	28370	35	4		33000 <sup>A</sup>	11.5	1.3
Service Pack; exc Electric.....	20032	35	4		33500 <sup>A, DB</sup>	11.5	1.3
<b>Sequoia</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
<b>2004-2007</b>				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Toyota - 426070C010, 426070C020				Sensor.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3		28360	35	4
	33500 <sup>A, DB</sup>	11.5	1.3	Service Pack.....	20032	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2009-2011</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	EZ-Sensor.....			
Sensor; W/Alloy Wheels.....	28305	35	4	EZ-Sensor Service Pack; Aluminium Valve.....			
Sensor; W/Steel Wheels; W/20 Deg. Angled				EZ-Sensor Service Pack; Rubber Valve.....			
Valve Sensor.....	28305	35	4	Sensor.....			
Sensor; W/Steel Wheels; W/40 Deg. Angled				Service Pack.....			
Valve Sensor.....	28300	35	4	2009-2011			
Service Pack.....	20031	35	4	EZ-Sensor.....			
<b>2008-2013</b>				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: Toyota - 4260708010, 426070C050				EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3	Sensor; W/20 Deg. Angled Valve Sensor; Dec. 1			
	33500 <sup>A, DB</sup>	11.5	1.3	& Older.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; W/20 Deg. Angled Valve Sensor; Nov. 30			
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3	& Older.....			
Sensor.....	28670	35	4	Sensor; W/40 Deg. Angled Valve Sensor; Dec. 1			
Service Pack.....	20022	35	4	& Older.....			
<b>2014</b>				Sensor; W/40 Deg. Angled Valve Sensor; Nov. 30			
EZ-Sensor.....				& Older.....			
EZ-Sensor Service Pack; Aluminium Valve.....				Service Pack.....			
EZ-Sensor Service Pack; Rubber Valve.....				<b>2006</b>			
<b>Sienna</b>				OE Sensor: Toyota - 4260704010, 426070C010, 426070C020,			
<b>2005</b>				42607AD020			
Sensor.....				EZ-Sensor.....			
INDIRECT <sup>D</sup>							
<b>2006-2014</b>							
OE Sensor: Toyota - 4260708010, 426070C030, 426070C050							
EZ-Sensor.....	33000 <sup>A</sup>	11.5	1.3				
	33500 <sup>A, DB</sup>	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 <sup>C</sup>	11.5	1.3				
Sensor.....	28670	35	4				
Service Pack.....	20022	35	4				
<b>2015</b>							
EZ-Sensor.....							
EZ-Sensor Service Pack; Aluminium Valve.....							
EZ-Sensor Service Pack; Rubber Valve.....							

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Toyota (cont'd)</b>				<b>Toyota (cont'd)</b>			
<b>Tacoma (cont'd)</b>				<b>Tundra (cont'd)</b>			
<b>2007-2013</b>				<b>2007</b>			
OE Sensor: Toyota - 4260704010, 4260706011				OE Sensor: Toyota - 426070C050			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Sensor; W/Alloy Wheels; W/20 Deg. Angled				Sensor; W/Alloy Wheels; W/TRW Sensor	28670	35	4
Valve Sensor	28360	35	4	Service Pack; W/Alloy Wheels; W/TRW Sensor	20022	35	4
Sensor; W/Steel Wheels; W/40 Deg. Angled				<b>2008-2011</b>			
Valve Sensor	28380	35	4	OE Sensor: Toyota - 4260708010, 426070C050			
Service Pack	20032	35	4	EZ-Sensor	33000 A	11.5	1.3
<b>2014</b>				EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor; W/Alloy Wheels; W/TRW Sensor	28670	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	Service Pack	20022	35	4
Sensor; W/Alloy Wheels; W/20 Deg. Angled				<b>2012</b>			
Valve Sensor	28360	35	4	OE Sensor: Toyota - 4260708010			
Service Pack	20032	35	4	EZ-Sensor	33000 A	11.5	1.3
<b>2015</b>				EZ-Sensor	33500 A, DB	11.5	1.3
OE Sensor: Toyota - 4260704010, 4260706011				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor; W/Alloy Wheels; W/20 Deg. Angled				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Valve Sensor	28360	35	4	Sensor	28670	35	4
Sensor; W/Steel Wheels; W/20 Deg. Angled				Service Pack	20022	35	4
Valve Sensor	28380	35	4	<b>2013</b>			
Service Pack	20032	35	4	OE Sensor: Toyota - 4260708010			
<b>Tundra</b>				EZ-Sensor	33000 A	11.5	1.3
<b>2005</b>				EZ-Sensor	33500 A, DB	11.5	1.3
OE Sensor: Toyota - 426070C010, 426070C020				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor; W/Alloy Wheels; W/TRW Sensor	28670	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack	20022	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	<b>2014</b>			
Sensor; W/Alloy Wheels; W/20 Deg. Angled				OE Sensor: Toyota - 426070C030, 426070C040			
Valve Sensor	28305	35	4	EZ-Sensor	33000 A	11.5	1.3
Sensor; W/Steel Wheels; W/40 Deg. Angled					33500 A, DB	11.5	1.3
Valve Sensor	28300	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack	20031	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
<b>2006</b>				Sensor; W/Alloy Wheels	28670	35	4
OE Sensor: Toyota - 4260708010, 426070C010, 426070C020				Sensor; W/Steel Wheels	28380	35	4
EZ-Sensor	33000 A	11.5	1.3	Service Pack	20022	35	4
	33500 A, DB	11.5	1.3	<b>Venza</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	<b>2009-2014</b>			
EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3	OE Sensor: Toyota - 42607-06011			
Sensor; W/Alloy Wheels; W/20 Deg. Angled				EZ-Sensor	33000 A	11.5	1.3
Valve Sensor	28305	35	4		33500 A, DB	11.5	1.3
Sensor; W/Alloy Wheels; W/TRW Sensor	28670	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor; W/Steel Wheels; W/40 Deg. Angled				EZ-Sensor Service Pack; Rubber Valve	20018 C	11.5	1.3
Valve Sensor	28300	35	4	Sensor	28360	35	4
Service Pack; Nov. 1 & Newer	20022	35	4	Service Pack	20032	35	4
Service Pack; Oct. 31 & Older	20031	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Toyota (cont'd)</b>				<b>Volkswagen (cont'd)</b>			
<b>Venza (cont'd)</b>				<b>CC (cont'd)</b>			
<b>2015-2016</b>				<b>2012-2014</b>			
OE Sensor: Toyota - 42607-06011				OE Sensor: Volkswagen - 3AA-907-275			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3
Sensor.....	28360	35	4	Sensor.....	20088	71	8
Service Pack.....	20032	35	4	Service Pack.....	20017	71	8
<b>Yaris</b>				<b>Eos</b>			
<b>2007</b>				<b>2007-2014</b>			
OE Sensor: Toyota - 4260733011				OE Sensor: Volkswagen - 1K0907253D			
EZ-Sensor.....	33000 A	11.5	1.3	Sensor.....	20088	71	8
	33500 A, DB	11.5	1.3	Service Pack.....	20017	71	8
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2015</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	INDIRECT D		
Sensor; Aug. & Newer.....	28365	35	4	<b>Golf</b>			
Service Pack; Aug. & Newer.....	20032	35	4	<b>2006</b>			
<b>2008-2012</b>				<b>2010</b>			
OE Sensor: Toyota - 4260733011				OE Sensor: Volkswagen - 1K0907253D			
EZ-Sensor.....	33000 A	11.5	1.3	Sensor.....	20088	71	8
	33500 A, DB	11.5	1.3	Service Pack.....	20017	71	8
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2013-2015</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	INDIRECT D		
Sensor.....	28365	35	4	<b>GTI</b>			
Service Pack.....	20032	35	4	<b>2006-2007</b>			
<b>2013</b>				<b>2008-2010</b>			
OE Sensor: Toyota - 4260706011				OE Sensor: Volkswagen - 1K0907253D			
EZ-Sensor.....	33000 A	11.5	1.3	Sensor.....	20088	71	8
	33500 A, DB	11.5	1.3	Service Pack.....	20017	71	8
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	<b>2013-2015</b>			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Sensor.....	INDIRECT D		
Sensor.....	28360	35	4	<b>Jetta</b>			
Service Pack.....	20032	35	4	<b>2006-2007</b>			
<b>2014</b>				<b>2008-2009</b>			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Volkswagen - 1K0907253D			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	20088	71	8
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack.....	20017	71	8
<b>2015</b>				OE Sensor: Volkswagen - 1K0907253D			
Sensor.....	INDIRECT D			Sensor.....	20088	71	8
<b>Volkswagen</b>				<b>2010</b>			
<b>Beetle</b>				<b>2013-2015</b>			
<b>2008-2010</b>				<b>2006-2007</b>			
OE Sensor: Volkswagen - 1K0907253D				OE Sensor: Volkswagen - 1K0907253D			
Sensor.....	20088	71	8	Sensor.....	20088	71	8
Service Pack.....	20017	71	8	Service Pack.....	20017	71	8
<b>2013-2014</b>				<b>2008-2009</b>			
Sensor.....	INDIRECT D			OE Sensor: Volkswagen - 1K0907253D			
<b>CC</b>				<b>2010</b>			
<b>2009-2011</b>				<b>2006-2007</b>			
OE Sensor: Volkswagen - 1K0907253D				OE Sensor: Volkswagen - 1K0907253D			
Sensor.....	20088	71	8	Sensor.....	20088	71	8
Service Pack.....	20017	71	8	Service Pack.....	20017	71	8

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Volkswagen (cont'd)</b>				<b>Volkswagen (cont'd)</b>			
<b>Jetta (cont'd)</b>				<b>Routan</b>			
2013-2015				2009-2010			
Sensor	INDIRECT <sup>D</sup>			OE Sensor: Volkswagen - 7B0-907-253, 7B0-907-253A			
<b>Passat</b>				Sensor	28434 <sup>E</sup>		
2006-2008				Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3
OE Sensor: Volkswagen - 1K0907253D				2011-2012			
Sensor; W/16" Or 17" Wheels	20088	71	8	OE Sensor: Volkswagen - 7B0-907-253B, 7B0-907-253C			
Service Pack; W/16" Or 17" Wheels	20017	71	8	EZ-Sensor	33500 <sup>A, DB</sup>	11.5	1.3
2009-2010				EZ-Sensor Service Pack; Aluminum valve	34000	62	7
OE Sensor: Volkswagen - 1K0907253D				EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3
Sensor	20088	71	8	Sensor	20398		
Service Pack	20017	71	8	Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3
2013-2015				2012			
Sensor	INDIRECT <sup>D</sup>			EZ-Sensor	33200 <sup>A</sup>		
<b>Phaeton</b>				2013			
2002-2003				EZ-Sensor	33200 <sup>A</sup>		
EZ-Sensor	33100 <sup>A</sup>	11.5	1.3		33500 <sup>A, DB</sup>	11.5	1.3
	33500 <sup>A, DB</sup>	11.5	1.3	2014			
2004-2006				EZ-Sensor Service Pack; Aluminum valve	34000	62	7
OE Sensor: Volkswagen - 4D0907275C, 4F0907275B				EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3
EZ-Sensor	33100 <sup>A</sup>	11.5	1.3	2015			
	33200 <sup>A</sup>	11.5	1.3	Service Pack	INDIRECT <sup>D</sup>		
	33500 <sup>A, DB</sup>	11.5	1.3	<b>Tiguan</b>			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2009-2011			
EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3	OE Sensor: Volkswagen - 1K0907253D			
Sensor; Includes Transmitter Only; W/315 MHz				Sensor	20088	71	8
Sensor	20077	35	4	Service Pack	20017	71	8
Sensor; Includes Transmitter Only; W/433 MHz				2012			
Sensor	20078	35	4	OE Sensor: Volkswagen - 1K0907253D			
Service Pack; Does Not Include Valve; W/315				EZ-Sensor	33500 <sup>A, DB</sup>	11.5	1.3
MHz Sensor	20023	35	4	EZ-Sensor Service Pack; Aluminum valve	34000	62	7
Service Pack; W/43mm Silver Insert; W/315 MHz				EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3
Sensor	20037	35	4	Sensor	20088	71	8
Service Pack; W/48mm Green Insert; W/315 MHz				Service Pack	20017	71	8
Sensor	20038	35	4	2013			
Service Pack; W/49mm Black Insert; W/315 MHz				EZ-Sensor	33500 <sup>A, DB</sup>	11.5	1.3
Sensor	20039	35	4	EZ-Sensor Service Pack; Aluminum valve	34000	62	7
Service Pack; W/51mm Orange Insert; W/315				EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3
MHz Sensor	20040	35	4	2014			
<b>R32</b>				EZ-Sensor	33500 <sup>A, DB</sup>	11.5	1.3
2008				EZ-Sensor Service Pack; Aluminum valve	34000	62	7
OE Sensor: Volkswagen - 1K0907253D				EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3
Sensor	20088	71	8	2015			
Service Pack	20017	71	8	Sensor	INDIRECT <sup>D</sup>		
<b>Rabbit</b>				2015			
2006-2007				Sensor	INDIRECT <sup>D</sup>		
OE Sensor: Volkswagen - 1K0907253D				<b>Touareg</b>			
Sensor; W/15" Wheels	20088	71	8	2001-2003			
Service Pack; W/15" Wheels	20017	71	8	EZ-Sensor	33100 <sup>A</sup>	11.5	1.3
2008-2009					33500 <sup>A, DB</sup>	11.5	1.3
OE Sensor: Volkswagen - 1K0907253D							
Sensor	20088	71	8				
Service Pack	20017	71	8				

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200  
E-Supercedes the 28155

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Volkswagen (cont'd)</b>				<b>Volkswagen (cont'd)</b>			
<b>Touareg (cont'd)</b>				<b>Touareg (cont'd)</b>			
<b>2004-2006</b>				<b>2014</b>			
OE Sensor: Volkswagen - 4F0907275B				OE Sensor: Volkswagen - 7P0907275			
EZ-Sensor.....	33100 A	11.5	1.3	Sensor; W/433 MHz Sensor; Includes			
	33200 A	11.5	1.3	Transmitter Only.....	20103	35	4
	33500 A, DB	11.5	1.3	Service Pack; Does Not Include Valve; W/315			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	MHz Sensor.....	20023	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C	11.5	1.3	Service Pack; W/43mm Silver Insert; W/315 MHz			
Sensor; Includes Transmitter Only; W/433 MHz				Sensor.....	20037	35	4
Sensor.....	20078	35	4	Service Pack; W/48mm Green Insert; W/315 MHz			
Service Pack; Does Not Include Valve.....	20023	62	7	Sensor.....	20038	35	4
Service Pack; W/43mm Silver Insert.....	20037	62	7	Service Pack; W/49mm Black Insert; W/315 MHz			
Service Pack; W/48mm Green Insert.....	20038	62	7	Sensor.....	20039	35	4
Service Pack; W/49mm Black Insert.....	20039	62	7	Service Pack; W/51mm Orange Insert; W/315			
Service Pack; W/51mm Orange Insert.....	20040	62	7	MHz Sensor.....	20040	35	4
<b>2007</b>				<b>2015</b>			
Service Pack; Does Not Include Valve.....	20023	62	7	OE Sensor: Volkswagen - 7P0907275			
Service Pack; W/43mm Silver Insert.....	20037	62	7	Sensor; W/433 MHz Sensor; Includes			
Service Pack; W/48mm Green Insert.....	20038	62	7	Transmitter Only.....	20103	35	4
Service Pack; W/49mm Black Insert.....	20039	62	7				
Service Pack; W/51mm Orange Insert.....	20040	62	7				
<b>2008-2009</b>							
OE Sensor: Volkswagen - 4F0907275B							
Sensor; Includes Transmitter Only.....	20078	35	4				
Service Pack; Does Not Include Valve.....	20023	35	4				
Service Pack; W/43mm Silver Insert.....	20037	35	4				
Service Pack; W/48mm Green Insert.....	20038	35	4				
Service Pack; W/49mm Black Insert.....	20039	35	4				
Service Pack; W/51mm Orange Insert.....	20040	35	4				
<b>2010</b>							
OE Sensor: Volkswagen - 4F0907275D							
Sensor; Includes Transmitter Only.....	20103	35	4				
Service Pack; Does Not Include Valve.....	20023	35	4				
Service Pack; W/43mm Silver Insert.....	20037	35	4				
Service Pack; W/48mm Green Insert.....	20038	35	4				
Service Pack; W/49mm Black Insert.....	20039	35	4				
Service Pack; W/51mm Orange Insert.....	20040	35	4				
<b>2011-2013</b>							
OE Sensor: Volkswagen - 7P0907275, 7P0907275A							
Sensor; W/315 MHz Sensor; Includes							
Transmitter Only.....	20077	35	4				
Sensor; W/433 MHz Sensor; Includes							
Transmitter Only.....	20103	35	4				
Service Pack; Does Not Include Valve; W/315							
MHz Sensor.....	20023	35	4				
Service Pack; W/43mm Silver Insert; W/315 MHz							
Sensor.....	20037	35	4				
Service Pack; W/48mm Green Insert; W/315 MHz							
Sensor.....	20038	35	4				
Service Pack; W/49mm Black Insert; W/315 MHz							
Sensor.....	20039	35	4				
Service Pack; W/51mm Orange Insert; W/315							
MHz Sensor.....	20040	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-Replaces 33000,33100 & 33200

## Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
<b>Volvo (cont'd)</b>							
<b>XC60</b>							
2010-2014							
OE Sensor: Volvo - 313020960							
Sensor	20097	71	8				
2015							
Sensor	INDIRECT <sup>D</sup>						
<b>XC70</b>							
2004-2007							
OE Sensor: Volvo - 307489910, 86517000							
Sensor; W/315 MHz Sensor	20156	44	5				
Service Pack; W/315 MHz Sensor	20010	44	5				
2008-2014							
OE Sensor: Volvo - 312802970, 313020960							
Sensor	20097	71	8				
<b>XC90</b>							
2004							
OE Sensor: Volvo - 86517000							
Sensor	20156	44	5				
Service Pack	20010	44	5				
2005-2007							
OE Sensor: Volvo - 307489910, 86517000							
Sensor; W/315 MHz Sensor	20156	44	5				
Service Pack; W/315 MHz Sensor	20010	44	5				
2008-2011							
OE Sensor: Volvo - 31200923							
Sensor; W/315 MHz Sensor	20156	44	5				
Service Pack	20010	44	5				
2012-2015							
OE Sensor: Volvo - 31200923							
Sensor	28362	11.5	1.3				
Service Pack	20008 <sup>C</sup>	11.5	1.3				
<b>VPG</b>							
<b>MV-1</b>							
2012							
OE Sensor: Ford Motor Company - 9L3Z1A189A							
EZ-Sensor	33000 <sup>A</sup>	11.5	1.3				
	33500 <sup>A, DB</sup>	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3				
Sensor	20315	11.5	1.3				
Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3				
2013-2014							
EZ-Sensor	33500 <sup>A, DB</sup>	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve	20018 <sup>C</sup>	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-Replaces 33000,33100 & 33200



# Numerical Listing

## Sensor 20028 (433 MHz)



Chrysler; 300M; 2002-2004  
 Chrysler; Concorde; 2002-2004  
 Chrysler; Crossfire; 2004  
 Chrysler; Crossfire; 2005  
 Chrysler; Crossfire; 2006-2008  
 Chrysler; Intrepid; 2002  
 Chrysler; Intrepid; 2003-2004  
 Chrysler; Pacifica; 2004; OEM Part No. 52088990AC  
 Chrysler; Prowler; 2002  
 Chrysler; Town & Country; 2002-2003  
 Chrysler; Voyager; 2002-2003  
 Dodge; Caravan; 2002-2003  
 Dodge; Grand Caravan; 2002-2003  
 Dodge; Intrepid; 2002-2004  
 Dodge; Viper; 2003-2006  
 Dodge; Viper; 2008-2010  
 Isuzu; Rodeo; 2004  
 Jeep; Grand Cherokee; 2002-2004  
 Jeep; Liberty; 2002-2004  
 Mitsubishi; Endeavor; 2004-2005  
 Mitsubishi; Endeavor; 2006; Aug. & Older  
 Mitsubishi; Galant; 2004-2006

## 20034 (315 MHz)



Mitsubishi; Eclipse; 2006-2007; W/Alloy Wheels  
 Mitsubishi; Eclipse; 2008-2010  
 Mitsubishi; Eclipse; 2011  
 Mitsubishi; Endeavor; 2006; Sept. 1 & Newer  
 Mitsubishi; Endeavor; 2007  
 Mitsubishi; Endeavor; 2008  
 Mitsubishi; Endeavor; 2010  
 Mitsubishi; Endeavor; 2011; W/Alloy Wheels  
 Mitsubishi; Galant; 2007; W/Alloy Wheels  
 Mitsubishi; Galant; 2008-2009; W/Alloy Wheels  
 Mitsubishi; Galant; 2010-2012; W/Alloy Wheels  
 Mitsubishi; Montero; 2003-2006  
 Mitsubishi; Montero Sport; 2003-2004

## Sensor 20064 (315 MHz)



Infiniti; FX35; 2003-2006  
 Infiniti; FX35; 2007; Jun. & Older  
 Infiniti; FX45; 2003-2006  
 Infiniti; FX45; 2007; Jun. & Older  
 Infiniti; G35; 2003; Jun. & Newer  
 Infiniti; G35; 2004-2006  
 Infiniti; M35; 2006-2007  
 Infiniti; M45; 2003-2004  
 Infiniti; M45; 2006-2007  
 Infiniti; Q45; 2003-2005  
 Infiniti; Q45; 2006; Jul. & Older  
 Infiniti; QX4; 2003  
 Nissan; 350Z; 2003-2006  
 Nissan; Frontier; 2003-2004  
 Nissan; Murano; 2003-2006  
 Nissan; Pathfinder; 2003  
 Nissan; Pathfinder; 2004; Exc. Armada; Jul. & Older  
 Nissan; Xterra; 2003-2004

## 20069 (315 MHz)



Infiniti; QX56; 2004  
 Infiniti; QX56; 2005-2006; W/Steel Wheels  
 Nissan; Armada; 2005-2006; W/Steel Wheels  
 Nissan; Frontier; 2005-2007; W/Steel Wheels  
 Nissan; Pathfinder; 2004; Armada  
 Nissan; Pathfinder; 2004; Exc. Armada; Aug. & Newer  
 Nissan; Quest; 2004  
 Nissan; Quest; 2005-2006; W/Steel Wheels  
 Nissan; Titan; 2004  
 Nissan; Titan; 2005; Mar. & Older  
 Nissan; Xterra; 2006; Submodel X

## 20076 (315 MHz)



Cadillac; STS; 2005; OEM Part No. 25758220  
 Cadillac; STS; 2006-2008  
 Cadillac; XLR; 2004; OEM Part No. 25758220  
 Cadillac; XLR; 2005-2009  
 Chevrolet; Corvette; 2005-2009

# Numerical Listing

## Sensor

### 20077 (433 MHz)



Audi; A6; 2011; Includes Transmitter Only  
 Audi; A6 Quattro; 2011; Includes Transmitter Only  
 Audi; A8; 2006-2011  
 Audi; A8 Quattro; 2003; Includes Transmitter Only; Chassis No. 4E3000001 & After  
 Audi; A8 Quattro; 2004-2011; Includes Transmitter Only  
 Audi; Q7; 2011; Includes Transmitter Only  
 Audi; RS6; 2003; Includes Transmitter Only  
 Audi; S6; 2011; Includes Transmitter Only  
 Audi; S8; 2003; Includes Transmitter Only; Chassis No. 4E3000001 & After  
 Audi; S8; 2004-2006; Includes Transmitter Only; Chassis No. 4E3000001 & After  
 Audi; S8; 2007-2008; Includes Transmitter Only  
 Audi; S8; 2009; Includes Transmitter Only; Chassis No. 4E3000001 & After  
 Audi; S8; 2015; Includes Transmitter Only; Chassis No. 4E3000001 & After  
 Bentley; Continental; 2003-2005; Includes Transmitter Only  
 Ferrari; 612 Scaglietti; 2005-2009; Includes Transmitter Only  
 Ferrari; F430; 2006-2009; Includes Transmitter Only  
 Ferrari; Maranello; 2001-2005; Includes Transmitter Only  
 Maserati; Quattroporte; 2004-2008; Includes Transmitter Only  
 Porsche; 911; 2007-2009; Includes Transmitter Only  
 Porsche; 911; 2011; Includes Transmitter Only  
 Porsche; Boxster; 2011; Includes Transmitter Only  
 Porsche; Cayman; 2011; Includes Transmitter Only  
 Volkswagen; Phaeton; 2004-2006; Includes Transmitter Only; W/315 MHz Sensor  
 Volkswagen; Touareg; 2011-2013; W/315 MHz Sensor; Includes Transmitter Only

### 20078 (433 MHz)



Audi; A3, A4, A5 & Quattro; 2002-2007; Includes Transmitter Only  
 Audi; A3, A4, A5 & Quattro; 2008; Includes Transmitter Only  
 Audi; A6; 2006-2008; Includes Transmitter Only  
 Audi; A6 Quattro; 2006-2008; Includes Transmitter Only  
 Audi; Q7; 2007-2009; Includes Transmitter Only  
 Audi; R8; 2008-2009; Includes Transmitter Only  
 Audi; RS4; 2007-2008; Includes Transmitter Only  
 Audi; S4; 2004-2009; Includes Transmitter Only  
 Audi; S6; 2007-2009; Includes Transmitter Only  
 Bentley; Arnage; 2008  
 Bentley; Brooklands; 2008  
 Bentley; Continental; 2006-2010; Includes Transmitter Only  
 Bentley; Mulsanne; 2009  
 Ferrari; FF; 2011  
 Ferrari; LaFerrari; 2014  
 Lamborghini; Aventador; 2011  
 Maserati; GranTurismo; 2014; Does Not Include Valve  
 Maserati; GranTurismo; 2015  
 Volkswagen; Phaeton; 2004-2006; Includes Transmitter Only; W/433 MHz Sensor  
 Volkswagen; Touareg; 2004-2006; Includes Transmitter Only; W/433 MHz Sensor  
 Volkswagen; Touareg; 2008-2009; Includes Transmitter Only

## Sensor

### 20079 (315 MHz)



Audi; A6; 2002-2004; Includes Transmitter Only  
 Audi; A8; 2000  
 Audi; A8; 2001-2003  
 Audi; A8 Quattro; 2000-2002; Includes Transmitter Only  
 Audi; A8 Quattro; 2003; Includes Transmitter Only; Chassis No. 4D3004999 & Before  
 Audi; Allroad Quattro; 2001-2005; Includes Transmitter Only  
 Audi; S4; 2002; Includes Transmitter Only  
 Audi; S4; 2003; Includes Transmitter Only  
 Audi; S8; 2000; Includes Transmitter Only  
 Audi; S8; 2001-2002; Includes Transmitter Only  
 Audi; S8; 2003; Includes Transmitter Only; Chassis No. 4D3004999 & Before  
 Maybach; 57,62; 2003-2011; Includes Transmitter Only  
 Mercedes-Benz; S500; 2000  
 Mercedes-Benz; S500; 2001  
 Mercedes-Benz; S500; 2002-2006

### 20080 (433 MHz)



BMW; 320i; 2001-2002; Includes Transmitter Only; W/433 MHz Sensor  
 BMW; 320i; 2003-2005; Includes Transmitter Only  
 BMW; 323Ci; 2000; Includes Transmitter Only  
 BMW; 323i; 2000; Includes Transmitter Only  
 BMW; 325; 2001-2002; Includes Transmitter Only; W/433 MHz Sensor  
 BMW; 325; 2003-2006; Includes Transmitter Only  
 BMW; 328Ci; 2000; Includes Transmitter Only  
 BMW; 328i; 2000; Includes Transmitter Only; W/433 MHz Sensor  
 BMW; 330; 2001-2002; Includes Transmitter Only; W/433 MHz Sensor  
 BMW; 330i; 2003-2006; Includes Transmitter Only  
 BMW; 525i; 2002; Includes Transmitter Only; W/433 MHz Sensor  
 BMW; 525i; 2003-2005; Includes Transmitter Only  
 BMW; 530; 2002; Includes Transmitter Only; W/433 MHz Sensor  
 BMW; 530i; 2003-2005; Includes Transmitter Only  
 BMW; 540i; 2002; Includes Transmitter Only; W/433 MHz Sensor  
 BMW; 540i; 2003; Includes Transmitter Only  
 BMW; 545i; 2004-2005; Includes Transmitter Only  
 BMW; 645Ci; 2004-2005; Includes Transmitter Only  
 BMW; 745; 2002; Includes Transmitter Only; W/433 MHz Sensor  
 BMW; 745; 2003; Includes Transmitter Only  
 BMW; 745; 2004-2005; Includes Transmitter Only  
 BMW; 760i; 2004-2005; Includes Transmitter Only  
 BMW; 760Li; 2003; Includes Transmitter Only  
 BMW; Alpina B7; 2011; Includes Transmitter Only  
 BMW; Alpina B7 xDrive; 2011; Includes Transmitter Only  
 BMW; Alpina B7L; 2011; Includes Transmitter Only  
 BMW; Alpina B7L xDrive; 2011; Includes Transmitter Only  
 BMW; M; 2000-2001; Includes Transmitter Only; W/433 MHz Sensor  
 BMW; M; 2002; Includes Transmitter Only; W/433 MHz Sensor  
 BMW; M; 2003; Includes Transmitter Only  
 BMW; M; 2003; Includes Transmitter Only; W/433 MHz Sensor  
 BMW; Z8; 2003; Includes Transmitter Only; W/433 MHz Sensor

# Numerical Listing

Sensor 20081 (315 MHz)	Sensor 20083 (315 MHz)
 <p>Subaru; B9 Tribeca; 2006-2007            Subaru; Legacy; 2004-2007            Subaru; Legacy; 2008; W/16" Or 17" Wheels            Subaru; Outback; 2004-2007            Subaru; Tribeca; 2008; W/Metal Stem Clamp-in Sensor            Subaru; Tribeca; 2009; W/Metal Stem Clamp-in Sensor            Subaru; Tribeca; 2010; W/Metal Stem Clamp-in Sensor            Subaru; Tribeca; 2011; W/Metal Stem Clamp-in Sensor</p>	 <p>BMW; 1 Series; 2008-2011; Includes Transmitter Only            BMW; 323i; 2006; Includes Transmitter Only; Jun. &amp; Newer            BMW; 323i; 2007-2010; Includes Transmitter Only            BMW; 328i; 2007-2009; Includes Transmitter Only            BMW; 328i xDrive; 2009; Includes Transmitter Only            BMW; 328xi; 2007-2008; Includes Transmitter Only            BMW; 335d; 2009; Includes Transmitter Only            BMW; 335i; 2007-2009; Includes Transmitter Only            BMW; 335i xDrive; 2009; Includes Transmitter Only            BMW; 335xi; 2007-2008; Includes Transmitter Only            BMW; 525i; 2006-2007; Includes Transmitter Only            BMW; 525xi; 2006-2007; Includes Transmitter Only            BMW; 528; 2008-2011; Includes Transmitter Only            BMW; 528xi; 2008; Includes Transmitter Only            BMW; 530; 2006-2007; Includes Transmitter Only            BMW; 535; 2008-2011; Includes Transmitter Only            BMW; 535xi; 2008; Includes Transmitter Only            BMW; 550; 2006-2011; Includes Transmitter Only            BMW; 650; 2006-2010; Includes Transmitter Only            BMW; 740i; 2011; Includes Transmitter Only            BMW; 740Li; 2011; Includes Transmitter Only            BMW; 750; 2006-2011; Includes Transmitter Only            BMW; 760i; 2006; Includes Transmitter Only            BMW; 760Li; 2004-2008; Includes Transmitter Only            BMW; 760Li; 2010-2011; Includes Transmitter Only            BMW; Alpina B7; 2007-2008; Includes Transmitter Only            BMW; M; 2004-2010; Includes Transmitter Only            BMW; X; 2005-2011; Includes Transmitter Only            BMW; Z4; 2003-2011; Includes Transmitter Only            Mini; Cooper; 2008-2009; Includes Transmitter Only</p>
20082 (315 MHz)	20084 (433 MHz)
 <p>Suzuki; Verona; 2005-2006</p>	 <p>Ferrari; Enzo; 2003-2004; Includes Transmitter Only</p>

# Numerical Listing

## Sensor

### 20085 (315 MHz)



Hyundai; Entourage; 2007-2009; Includes Transmitter Only  
 Hyundai; Santa Fe; 2007; Includes Transmitter Only  
 Hyundai; Santa Fe; 2008; Includes Transmitter Only  
 Hyundai; Veracruz; 2006-2007; Includes Transmitter Only  
 Hyundai; Veracruz; 2008; Includes Transmitter Only  
 Kia; Sedona; 2006-2008; Includes Transmitter Only

### 20086 (315 MHz)



Hyundai; Azera; 2006; Includes Transmitter Only  
 Hyundai; Azera; 2007-2012; Includes Transmitter Only  
 Hyundai; Azera; 2013  
 Hyundai; Elantra; 2007-2009; Includes Transmitter Only  
 Hyundai; Elantra; 2010; exc Touring; Includes Transmitter Only  
 Hyundai; Elantra; 2011; exc Touring; Includes Transmitter Only  
 Hyundai; Elantra; 2012; exc Touring; W/Transmitter Only  
 Hyundai; Elantra; 2013; W/Transmitter Only  
 Hyundai; Elantra Coupe; 2013; W/Transmitter Only  
 Hyundai; Santa Fe; 2008; Includes Transmitter Only  
 Hyundai; Santa Fe; 2009; Includes Transmitter Only  
 Hyundai; Veracruz; 2008  
 Hyundai; Veracruz; 2009-2012; Includes Transmitter Only  
 Kia; Magentis; 2008; Includes Transmitter Only  
 Kia; Magentis; 2009; Includes Transmitter Only  
 Kia; Magentis; 2010; Includes Transmitter Only  
 Kia; Optima; 2006-2010; Includes Transmitter Only  
 Kia; Rondo; 2007-2011; Includes Transmitter Only  
 Kia; Sedona; 2009-2012; Includes Transmitter Only

### 20087 (315 MHz)



Suzuki; Grand Vitara; 2007-2013  
 Suzuki; SX4; 2007-2013  
 Suzuki; SX4 Crossover; 2012  
 Suzuki; XL-7; 2005-2006

## Sensor

### 20088 (315 MHz)



Audi; A3, A4,A5 & Quattro; 2008  
 Audi; A3, A4,A5 & Quattro; 2009-2012  
 Audi; Q5; 2009-2012  
 Audi; S4; 2010-2011  
 Audi; S5; 2008-2012  
 Audi; TT; 2008-2009  
 Audi; TT Quattro; 2008-2009  
 Volkswagen; Beetle; 2008-2010  
 Volkswagen; CC; 2009-2011  
 Volkswagen; CC; 2012-2014  
 Volkswagen; Eos; 2007-2014  
 Volkswagen; Golf; 2006  
 Volkswagen; Golf; 2010  
 Volkswagen; GTI; 2006-2007; W/16" Or 17" Wheels  
 Volkswagen; GTI; 2008-2010  
 Volkswagen; Jetta; 2006-2007  
 Volkswagen; Jetta; 2008  
 Volkswagen; Jetta; 2008; exc GLI  
 Volkswagen; Jetta; 2009  
 Volkswagen; Jetta; 2009; exc GLI  
 Volkswagen; Jetta; 2010  
 Volkswagen; Passat; 2006-2008; W/16" Or 17" Wheels  
 Volkswagen; Passat; 2009-2010  
 Volkswagen; R32; 2008  
 Volkswagen; Rabbit; 2006-2007; W/15" Wheels  
 Volkswagen; Rabbit; 2008-2009  
 Volkswagen; Tiguan; 2009-2011  
 Volkswagen; Tiguan; 2012

### 20089 (315 MHz)



Dodge; Sprinter; 2007-2009  
 Freightliner; Sprinter; 2007-2008  
 Freightliner; Sprinter; 2013  
 Mercedes-Benz; Sprinter 2500; 2010  
 Mercedes-Benz; Sprinter 2500; 2011-2012  
 Mercedes-Benz; Sprinter 3500; 2010-2012

# Numerical Listing

## Sensor

### 20090 (315 MHz)



Jaguar; Jaguar; 2004-2012; W/315 MHz Sensor  
 Land Rover; LR2; 2008-2015  
 Land Rover; LR3; 2006-2009; W/315 MHz Sensor  
 Land Rover; LR4; 2010-2011; W/315 MHz Sensor  
 Land Rover; LR4; 2012-2014  
 Land Rover; Range Rover; 2006-2011; W/315 MHz Sensor  
 Land Rover; Range Rover; 2012-2014  
 Land Rover; Range Rover Evoque; 2012-2015  
 Land Rover; Range Rover Sport; 2006-2011; W/315 MHz Sensor  
 Land Rover; Range Rover Sport; 2012-2014

### 20091 (433 MHz)



Jaguar; Jaguar; 2004-2012; W/433 MHz Sensor  
 Land Rover; LR3; 2006-2009; W/433 MHz Sensor  
 Land Rover; LR4; 2010-2011; W/433 MHz Sensor  
 Land Rover; Range Rover; 2006-2011; W/433 MHz Sensor  
 Land Rover; Range Rover Sport; 2006-2011; W/433 MHz Sensor

## Sensor

### 20092 (315 MHz)



Hyundai; Accent; 2012-2014  
 Hyundai; Elantra; 2010; Touring; Includes Transmitter Only  
 Hyundai; Elantra; 2011; Touring; Includes Transmitter Only  
 Hyundai; Elantra; 2012; Touring; W/Transmitter Only  
 Hyundai; Elantra; 2014  
 Hyundai; Elantra GT; 2013-2015  
 Hyundai; Equus; 2014-2015  
 Hyundai; Genesis Coupe; 2010-2012  
 Hyundai; Genesis Coupe; 2013  
 Hyundai; Genesis Coupe; 2014-2015  
 Hyundai; Santa Fe; 2013  
 Hyundai; Santa Fe; 2014-2015  
 Hyundai; Sonata; 2011-2013  
 Hyundai; Sonata; 2014  
 Kia; Cadenza; 2014-2015  
 Kia; Forte; 2010-2013  
 Kia; Forte Koup; 2010-2013  
 Kia; Forte Koup; 2014  
 Kia; Forte5; 2012-2013  
 Kia; Optima; 2011-2015  
 Kia; Rio5; 2012  
 Kia; Sorento; 2011-2014  
 Kia; Sorento; 2015  
 Kia; Soul; 2010-2013

### 20093 (315 MHz)



Mazda; 2; 2011-2013  
 Mazda; 3; 2004  
 Mazda; 3; 2005-2012  
 Mazda; 3; 2013  
 Mazda; 5; 2006-2010  
 Mazda; 5; 2012-2013  
 Mazda; 6; 2008-2013  
 Mazda; CX-7; 2007-2011  
 Mazda; CX-9; 2007-2012  
 Mazda; CX-9; 2013  
 Mazda; MX-5 Miata; 2006-2015  
 Mazda; RX-8; 2004  
 Mazda; RX-8; 2005-2011

# Numerical Listing

## Sensor

### 20094 (433 MHz)



Mercedes-Benz; C Series; 2007  
 Mercedes-Benz; C Series; 2008-2009  
 Mercedes-Benz; CL; 2008-2009  
 Mercedes-Benz; CLS; 2006  
 Mercedes-Benz; CLS550; 2007-2011  
 Mercedes-Benz; E320; 2006-2009  
 Mercedes-Benz; E350; 2006-2009; W/315 MHz Sensor  
 Mercedes-Benz; E500; 2006  
 Mercedes-Benz; E55 AMG; 2006  
 Mercedes-Benz; E550; 2007-2009; W/315 MHz Sensor  
 Mercedes-Benz; E63 AMG; 2007-2009  
 Mercedes-Benz; S Series; 2010  
 Mercedes-Benz; S550; 2007-2010  
 Mercedes-Benz; S600; 2007-2010  
 Mercedes-Benz; S63 AMG; 2008-2010  
 Mercedes-Benz; S65 AMG; 2007-2010  
 Mercedes-Benz; SL500; 2006  
 Mercedes-Benz; SL55 AMG; 2006-2008  
 Mercedes-Benz; SL550; 2007-2009  
 Mercedes-Benz; SL600; 2006-2009  
 Mercedes-Benz; SL63 AMG; 2009  
 Mercedes-Benz; SL63 AMG; 2011  
 Mercedes-Benz; SL65 AMG; 2006-2009  
 Mercedes-Benz; SL65 AMG; 2011  
 Mercedes-Benz; SLR McLaren; 2008-2009

### 20095 (433 MHz)



Mercedes-Benz; E350; 2006-2009; W/433 MHz Sensor  
 Mercedes-Benz; E550; 2007-2009; W/433 MHz Sensor  
 Mercedes-Benz; GL; 2007-2009  
 Mercedes-Benz; GL320; 2007-2009  
 Mercedes-Benz; ML320; 2007-2009  
 Mercedes-Benz; ML350; 2006-2009  
 Mercedes-Benz; ML500; 2006-2007  
 Mercedes-Benz; ML550; 2008-2009  
 Mercedes-Benz; ML63 AMG; 2007-2009  
 Mercedes-Benz; R320; 2007-2009  
 Mercedes-Benz; R350; 2006-2009  
 Mercedes-Benz; R500; 2006-2007  
 Mercedes-Benz; R63 AMG; 2007

## Sensor

### 20096 (433 MHz)



Ford; Expedition; 2003-2004  
 Ford; Explorer; 2002-2003; Exc. Sport  
 Ford; Explorer; 2004-2005  
 Lincoln; Aviator; 2003-2005  
 Lincoln; Navigator; 2003-2004  
 Mercury; Mountaineer; 2002-2005

### 20097 (433 MHz)



Volvo; C30,C70,S40; 2007-2013  
 Volvo; S60,S80; 2007-2009  
 Volvo; S60,S80; 2010-2014  
 Volvo; V50; 2005-2011  
 Volvo; V70; 2008-2010  
 Volvo; XC60; 2010-2014  
 Volvo; XC70; 2008-2014

### 20098 (315 MHz)



Acura; MDX, RDX; 2007-2013  
 Acura; TSX; 2007-2014  
 Honda; Pilot; 2009; W/Alloy Wheels  
 Honda; Pilot; 2010-2011; Exc. LX  
 Honda; Pilot; 2012-2015; W/Alloy Wheels

### 20099 (315 MHz)



Honda; Accord; 2008-2012  
 Honda; CR-V; 2007-2011  
 Honda; Fit; 2008



# Numerical Listing

## Sensor

### 20100 (315 MHz)



Honda; Accord Crosstour; 2010-2015  
 Honda; Crosstour; 2010-2015  
 Honda; CR-V; 2012-2013

### 20103 (433 MHz)



Audi; A6; 2009; Includes Transmitter Only; Quattro  
 Audi; A6; 2010; Includes Transmitter Only  
 Audi; A6 Quattro; 2010; Includes Transmitter Only  
 Audi; Q7; 2010; Includes Transmitter Only  
 Audi; Q7; 2012; Includes Transmitter Only  
 Audi; R8; 2010; Includes Transmitter Only  
 Audi; R8; 2011  
 Audi; R8; 2012; Includes Transmitter Only  
 Audi; R8; 2014-2015; Includes Transmitter Only  
 Audi; RS7; 2014-2016  
 Audi; S6; 2010; Includes Transmitter Only  
 Bentley; Azure; 2007-2009; Includes Transmitter Only  
 Bentley; Continental; 2012-2014; Includes Transmitter Only  
 Bentley; Continental; 2015; Includes Transmitter Only  
 Bentley; Mulsanne; 2011-2015; Includes Transmitter Only  
 Porsche; 911; 2010; Includes Transmitter Only  
 Porsche; 911; 2012  
 Porsche; 911; 2013-2014  
 Porsche; 911; 2015  
 Porsche; Boxster; 2014-2016  
 Porsche; Cayenne; 2011-2013; Includes Transmitter Only  
 Porsche; Cayenne; 2014  
 Porsche; Cayman; 2012-2016  
 Volkswagen; Touareg; 2010; Includes Transmitter Only  
 Volkswagen; Touareg; 2011-2013; W/433 MHz Sensor; Includes Transmitter Only  
 Volkswagen; Touareg; 2014; W/433 MHz Sensor; Includes Transmitter Only  
 Volkswagen; Touareg; 2015; W/433 MHz Sensor; Includes Transmitter Only

## Sensor

### 20107 (315 MHz)



Cadillac; Escalade; 2005-2006  
 Chevrolet; Silverado Series; 2005-2006  
 Chevrolet; Silverado Series; 2007; Classic  
 Chevrolet; Suburban; 2005-2006  
 Chevrolet; Tahoe; 2005-2006  
 GMC; Sierra Series; 2005-2006  
 GMC; Sierra Series; 2007; Classic  
 GMC; Yukon; 2005-2006

### 20115 (315 MHz)



Cadillac; Escalade; 2004  
 Chevrolet; Silverado Series; 2004  
 Chevrolet; Suburban; 2004  
 Chevrolet; Tahoe; 2004  
 GMC; Sierra Series; 2004  
 GMC; Yukon; 2004

### 20116 (315 MHz)



Buick; Rainier; 2006; OEM Part No. 25774006  
 Buick; Rainier; 2007; OEM Part No. 25774006  
 Cadillac; CTS; 2004-2007  
 Cadillac; SRX; 2004-2006  
 Chevrolet; SSR; 2006; OEM Part No. 25774006  
 Chevrolet; Trailblazer; 2006-2009; OEM Part No. 25774006  
 GMC; Envoy; 2006  
 GMC; Envoy; 2007-2009  
 Isuzu; Ascender; 2006-2008  
 Saab; 9-7x; 2005-2009

# Numerical Listing

## Sensor

### 20117 (315 MHz)



Cadillac; DeVille; 2001-2005  
 Cadillac; Seville; 2001-2004  
 Chevrolet; Corvette; 2001-2004

### 20131 (315 MHz)



Chevrolet; Colorado; 2007-2012  
 GMC; Canyon; 2007-2012  
 Hummer; H3; 2006-2010  
 Hummer; H3T; 2009-2010  
 Isuzu; i-290; 2007-2008  
 Isuzu; i-370; 2007-2008  
 Pontiac; Montana; 2009

### 20135 (315 MHz)



Ford; Expedition; 2005-2006  
 Ford; Freestar; 2004-2005; W/Aluminium Valve Stem  
 Lincoln; Navigator; 2005-2006  
 Mercury; Monterey; 2004-2005

## Sensor

### 20153 (315 MHz)



Buick; Allure; 2009  
 Buick; Enclave; 2009-2015  
 Buick; Enclave; 2016  
 Buick; LaCrosse; 2009  
 Buick; Lucerne; 2007-2011  
 Cadillac; CTS; 2008  
 Cadillac; CTS; 2009-2011; OEM Part No. 25920615; Exc. CTS V  
 Cadillac; CTS; 2012; OEM Part No. 25920615; Exc. CTS V  
 Cadillac; CTS; 2013; OEM Part No. 25920615; Exc. CTS V  
 Cadillac; DTS; 2007-2011  
 Cadillac; Escalade; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem  
 Cadillac; Escalade; 2008; OEM Part No. 25799331; OEM Part No. 15922396  
 Cadillac; Escalade; 2009-2011  
 Cadillac; Escalade; 2012-2013  
 Cadillac; SRX; 2007-2009  
 Cadillac; STS; 2009; OEM Part No. 25920615; Exc. STS V  
 Cadillac; STS; 2010; OEM Part No. 15922396; OEM Part No. 25920615  
 Cadillac; STS; 2011  
 Chevrolet; Avalanche; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem  
 Chevrolet; Avalanche; 2008; OEM Part No. 25799331; OEM Part No. 15922396  
 Chevrolet; Avalanche; 2009-2013  
 Chevrolet; Aveo; 2007; Hatchback  
 Chevrolet; Aveo; 2008-2011  
 Chevrolet; Aveo5; 2007; Hatchback  
 Chevrolet; Aveo5; 2008-2011  
 Chevrolet; Captiva Sport; 2012-2013  
 Chevrolet; Cobalt; 2008; Snap-In Style Only; W/Rubber Valve Stem  
 Chevrolet; Cobalt; 2009; Snap-In Style Only; W/Rubber Valve Stem  
 Chevrolet; Express; 2010-2015  
 Chevrolet; Express; 2016  
 Chevrolet; HHR; 2008-2009; Snap-In Style Only; W/Rubber Valve Stem  
 Chevrolet; HHR; 2011  
 Chevrolet; Impala; 2007; Snap-In Style Only; W/Rubber Valve Stem  
 Chevrolet; Impala; 2008-2013  
 Chevrolet; Malibu; 2008; Snap-In Style Only; W/Rubber Valve Stem  
 Chevrolet; Malibu; 2009  
 Chevrolet; Malibu; 2011-2012  
 Chevrolet; Monte Carlo; 2007; Snap-In Style Only; W/Rubber Valve Stem  
 Chevrolet; Silverado Series; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic  
 Chevrolet; Silverado Series; 2008-2013; W/Single Rear Wheels  
 Chevrolet; Suburban; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem  
 Chevrolet; Suburban; 2008-2014  
 Chevrolet; Tahoe; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem  
 Chevrolet; Tahoe; 2008-2013  
 Chevrolet; Traverse; 2009-2015  
 Chevrolet; Traverse; 2016  
 GMC; Acadia; 2009-2015  
 GMC; Acadia; 2016  
 GMC; Savana Series; 2010-2015  
 GMC; Savana Series; 2016  
 GMC; Sierra Series; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic  
 GMC; Sierra Series; 2008-2013; W/Single Rear Wheels  
 GMC; Yukon; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem  
 GMC; Yukon; 2008-2013

# Numerical Listing

Hummer; H2; 2008-2009  
 Pontiac; G Series; 2008  
 Pontiac; G Series; 2009-2010  
 Pontiac; Grand Prix; 2008; Snap-In Style Only; W/Rubber Valve Stem  
 Pontiac; Wave; 2008  
 Saturn; Aura; 2008-2009  
 Saturn; Outlook; 2009-2010  
 Saturn; Vue; 2007-2010  
 Suzuki; Forenza; 2007-2008  
 Suzuki; Reno; 2007-2008

## 20154 (433)

Chevrolet; Camaro; 2016; Exc. ZL1  
 Chevrolet; Malibu; 2016

## 20156 (315 MHz)



Volvo; S60,S80; 2004  
 Volvo; S60,S80; 2004; W/315 MHz Sensor  
 Volvo; S60,S80; 2005  
 Volvo; S60,S80; 2005; W/315 MHz Sensor  
 Volvo; S60,S80; 2006-2009  
 Volvo; V70; 2004-2007; W/315 MHz Sensor  
 Volvo; XC70; 2004-2007; W/315 MHz Sensor  
 Volvo; XC90; 2004  
 Volvo; XC90; 2005-2007; W/315 MHz Sensor  
 Volvo; XC90; 2008-2011; W/315 MHz Sensor

## Sensor

## 20158 (315 MHz)



Buick; Allure; 2007-2008  
 Buick; Enclave; 2008  
 Buick; LaCrosse; 2006  
 Buick; LaCrosse; 2007-2008  
 Cadillac; CTS; 2009-2011; OEM Part No. 15268606; CTS V; W/315 MHz Sensor  
 Cadillac; CTS; 2012; OEM Part No. 15268606; CTS V; W/315 MHz Sensor  
 Cadillac; CTS; 2013; OEM Part No. 15268606; CTS V; W/315 MHz Sensor  
 Cadillac; DTS; 2006  
 Cadillac; Escalade; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem  
 Chevrolet; Avalanche; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem  
 Chevrolet; Caprice; 2011-2013  
 Chevrolet; Cobalt; 2008; Clamp-In Style Only; W/Aluminium Valve Stem  
 Chevrolet; Corvette; 2010-2011  
 Chevrolet; Corvette; 2012; Z06; Base  
 Chevrolet; Corvette; 2013  
 Chevrolet; Equinox; 2007-2009  
 Chevrolet; Express; 2008-2009  
 Chevrolet; HHR; 2008-2009; Clamp-In Style Only; W/Aluminium Valve Stem  
 Chevrolet; Impala; 2006; W/Alloy Wheels  
 Chevrolet; Impala; 2007; Clamp-In Style Only; W/Aluminium Valve Stem  
 Chevrolet; Malibu; 2008; Clamp-In Style Only; W/Aluminium Valve Stem  
 Chevrolet; Monte Carlo; 2006; W/Alloy Wheels  
 Chevrolet; Monte Carlo; 2007; Clamp-In Style Only; W/Aluminium Valve Stem  
 Chevrolet; Silverado Series; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic  
 Chevrolet; Suburban; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem  
 Chevrolet; Tahoe; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem  
 Chevrolet; Uplander; 2008-2009  
 GMC; Acadia; 2007-2008  
 GMC; Savana Series; 2008-2009  
 GMC; Sierra Series; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic  
 GMC; Yukon; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem  
 Pontiac; G Series; 2008  
 Pontiac; Grand Prix; 2007  
 Pontiac; Grand Prix; 2008; Clamp-In Style Only; W/Aluminium Valve Stem  
 Pontiac; Montana; 2008  
 Pontiac; Solstice; 2008-2009  
 Pontiac; Torrent; 2007-2009  
 Saturn; Aura; 2007  
 Saturn; Outlook; 2007-2008  
 Saturn; Sky; 2008-2010  
 Suzuki; XL-7; 2007-2009

# Numerical Listing

## Sensor

20159 (433 MHz)



Lotus; Elise; 2008  
 Lotus; Elise; 2009  
 Lotus; Elise; 2010-2015  
 Lotus; Evora; 2010  
 Lotus; Evora; 2011-2013  
 Lotus; Evora; 2015  
 Lotus; Exige; 2008-2015  
 Saab; 9-3; 2008-2011  
 Saab; 9-3X; 2010-2011  
 Saab; 9-5; 2008-2011

20161 (315 MHz)



Infiniti; QX56; 2005-2006; W/Alloy Wheels  
 Infiniti; QX56; 2007; Mar. & Older  
 Nissan; Armada; 2005-2006; W/Alloy Wheels  
 Nissan; Armada; 2007  
 Nissan; Armada; 2008; SE  
 Nissan; Frontier; 2005-2007; W/Alloy Wheels  
 Nissan; Frontier; 2008; W/Alloy Wheels  
 Nissan; Maxima; 2006; Jun. & Newer  
 Nissan; Maxima; 2007; Mar. & Older  
 Nissan; Pathfinder; 2005-2006  
 Nissan; Quest; 2005-2006; W/Alloy Wheels  
 Nissan; Sentra; 2007; W/Alloy Wheels  
 Nissan; Titan; 2005; Apr. 1 & Newer  
 Nissan; Titan; 2006  
 Nissan; Titan; 2007; Mar. & Older  
 Nissan; Xterra; 2005  
 Nissan; Xterra; 2006; Exc. Submodel X

## Sensor

20213 (433 MHz)



Mercedes-Benz; B200; 2014  
 Mercedes-Benz; B200; 2015-2016  
 Mercedes-Benz; B250; 2015  
 Mercedes-Benz; B250; 2016  
 Mercedes-Benz; C Series; 2014-2015  
 Mercedes-Benz; C Series; 2016  
 Mercedes-Benz; C250; 2014-2016  
 Mercedes-Benz; CLA250; 2014-2016  
 Mercedes-Benz; CLA45 AMG; 2014-2016  
 Mercedes-Benz; CLS550; 2014-2016  
 Mercedes-Benz; CLS63 AMG S; 2014-2016  
 Mercedes-Benz; E250; 2014-2016  
 Mercedes-Benz; E350; 2014-2016  
 Mercedes-Benz; E400; 2014-2016  
 Mercedes-Benz; E550; 2014-2016  
 Mercedes-Benz; E63 AMG; 2014-2016  
 Mercedes-Benz; E63 AMG S; 2014-2016  
 Mercedes-Benz; G550; 2014-2016  
 Mercedes-Benz; G63 AMG; 2014-2016  
 Mercedes-Benz; GL; 2014-2016  
 Mercedes-Benz; GL350; 2014-2015  
 Mercedes-Benz; GL350; 2016  
 Mercedes-Benz; GL63 AMG; 2014-2016  
 Mercedes-Benz; GLK250; 2014-2016  
 Mercedes-Benz; GLK350; 2014-2016  
 Mercedes-Benz; ML350; 2015  
 Mercedes-Benz; ML350; 2016  
 Mercedes-Benz; ML550; 2015-2016  
 Mercedes-Benz; ML63 AMG; 2014-2016  
 Mercedes-Benz; S Series; 2013  
 Mercedes-Benz; S Series; 2014-2016  
 Mercedes-Benz; S550; 2014-2016  
 Mercedes-Benz; S600; 2014-2016  
 Mercedes-Benz; S63 AMG; 2014-2016  
 Mercedes-Benz; SL550; 2014-2016  
 Mercedes-Benz; SL63 AMG; 2014-2015  
 Mercedes-Benz; SL63 AMG; 2016  
 Mercedes-Benz; SL65 AMG; 2014-2016  
 Mercedes-Benz; SLK250; 2014-2016  
 Mercedes-Benz; SLK350; 2014-2016  
 Mercedes-Benz; SLK55 AMG; 2014  
 Mercedes-Benz; SLK55 AMG; 2015-2016  
 Mercedes-Benz; SLS AMG; 2014-2015  
 Mercedes-Benz; Sprinter 2500; 2014-2016  
 Mercedes-Benz; Sprinter 3500; 2014-2016  
 Smart; Fortwo; 2014  
 Smart; Fortwo; 2015

# Numerical Listing

## Sensor 20218 (433 MHz)



Kia: Sedona; 2015-2016  
 Kia: Soul; 2014  
 Kia: Soul; 2015  
 Kia: Soul; 2016

## Sensor 20281 (433 MHz)



Hyundai: Sonata; 2015-2016  
 Hyundai: Tucson; 2015-2016

## 20223 (433 MHz WAL)



Chevrolet: Corvette; 2014-2015  
 Chevrolet: Corvette; 2016

## 20284 (433 MHz)



Maserati: Ghibli; 2014-2015  
 Maserati: Quattroporte; 2014-2015

## 20228 (314.9 MHz)



Chevrolet: Caprice; 2014  
 Chevrolet: Caprice; 2015

## 20280 (315 MHz)



Ford: Edge; 2015-2016  
 Ford: Explorer; 2016  
 Ford: F-150; 2015-2016  
 Ford: Mustang; 2015-2016  
 Lincoln: Mark LT; 2015-2016  
 Lincoln: MKS; 2016  
 Lincoln: MKX; 2015-2016

# Numerical Listing

## Sensor

20315 (315 MHz)



Ford; C-Max; 2012-2015  
 Ford; C-Max; 2016  
 Ford; Edge; 2011-2014  
 Ford; Escape; 2009-2010  
 Ford; Escape; 2011  
 Ford; Escape; 2012-2015  
 Ford; Escape; 2016  
 Ford; E-Series Van; 2010  
 Ford; E-Series Van; 2010; W/Steel Wheels  
 Ford; E-Series Van; 2011-2013  
 Ford; E-Series Van; 2014-2015  
 Ford; E-Series Van; 2016  
 Ford; Expedition; 2011-2015  
 Ford; Expedition; 2016  
 Ford; Explorer; 2011-2014  
 Ford; Explorer; 2015  
 Ford; F-150; 2009-2014  
 Ford; F-250 Super Duty; 2011-2015  
 Ford; F-250 Super Duty; 2016  
 Ford; F-350 Super Duty; 2011-2015  
 Ford; F-350 Super Duty; 2016  
 Ford; Fiesta; 2011-2015  
 Ford; Fiesta; 2016  
 Ford; Flex; 2011-2015  
 Ford; Flex; 2016  
 Ford; Focus; 2010  
 Ford; Focus; 2011  
 Ford; Focus; 2012-2015  
 Ford; Focus; 2016  
 Ford; Fusion; 2010-2015  
 Ford; Fusion; 2016  
 Ford; Mustang; 2010-2011  
 Ford; Mustang; 2012; exc Shelby GT500  
 Ford; Mustang; 2013; exc Shelby GT500  
 Ford; Mustang; 2014; exc Shelby GT500  
 Ford; Taurus; 2010; May & Newer  
 Ford; Taurus; 2011-2015  
 Ford; Taurus; 2016  
 Ford; Transit; 2014-2015  
 Ford; Transit; 2016  
 Ford; Transit Connect; 2010-2015  
 Ford; Transit Connect; 2016  
 Lincoln; Mark LT; 2013-2014  
 Lincoln; MKC; 2015  
 Lincoln; MKS; 2011-2015  
 Lincoln; MKT; 2011-2016  
 Lincoln; MKX; 2011-2014  
 Lincoln; MKZ; 2010-2015  
 Lincoln; MKZ; 2016  
 Lincoln; Navigator; 2011-2015  
 Lincoln; Navigator; 2016  
 Lincoln; Town Car; 2011  
 Mazda; Tribute; 2009-2011  
 Mercury; Mariner; 2009-2011  
 Mercury; Milan; 2010-2011  
 VPG; MV-1; 2012

## Sensor

20335 (315 MHz)



Chrysler; Pacifica; 2004; OEM Part No. 04727392AD  
 Chrysler; Pacifica; 2005  
 Chrysler; Town & Country; 2004-2005  
 Dodge; Caravan; 2004-2005  
 Dodge; Grand Caravan; 2004-2005







20398 (433 MHz)



Chrysler; 300; 2010  
 Chrysler; 300; 2011  
 Chrysler; 300; 2012; W/Rubber Stem Snap-in Sensor  
 Chrysler; 300; 2013-2015  
 Chrysler; 300; 2016  
 Chrysler; Town & Country; 2011-2014  
 Chrysler; Town & Country; 2015  
 Chrysler; Town & Country; 2016  
 Dodge; Challenger; 2010-2012; W/Rubber Stem Snap-in Sensor  
 Dodge; Challenger; 2013-2015; W/Rubber Stem Snap-in Sensor  
 Dodge; Challenger; 2016; W/Rubber Stem Snap-in Sensor  
 Dodge; Charger; 2010; W/Rubber Stem Snap-in Sensor  
 Dodge; Charger; 2011; W/Rubber Stem Snap-in Sensor  
 Dodge; Charger; 2012-2015  
 Dodge; Charger; 2016  
 Dodge; Durango; 2011-2015  
 Dodge; Grand Caravan; 2011-2015  
 Dodge; Grand Caravan; 2016  
 Dodge; Journey; 2010; OEM No. 56029398AA; Rubber Valve  
 Dodge; Journey; 2011-2015  
 Dodge; Journey; 2016  
 Dodge; Ram 4500; 2010; W/Rubber Stem Snap-in Sensor  
 Dodge; Ram 5500; 2010; W/Rubber Stem Snap-in Sensor  
 Dodge; Ram Series; 2010; W/Rubber Stem Snap-in Sensor  
 Fiat; 500; 2012-2015  
 Fiat; 500; 2016  
 Jeep; Grand Cherokee; 2011-2015  
 Jeep; Wrangler; 2013-2015  
 Jeep; Wrangler; 2016  
 Ram; 4500; 2012  
 Ram; 5500; 2012  
 Ram; C/V; 2012; Rubber Valve  
 Ram; C/V; 2013-2015  
 Ram; ProMaster; 2014-2015  
 Ram; ProMaster; 2016  
 Ram; Ram Series; 2011; W/Rubber Stem Snap-in Sensor  
 Ram; Ram Series; 2012-2013  
 Volkswagen; Routan; 2011-2012  
 Volkswagen; Routan; 2014



# Numerical Listing

<p style="text-align: center;"><b>Sensor</b> <b>20720 (433 MHz)</b></p>  <p>Acura; TL; 2009-2013 Acura; ZDX; 2010-2013</p>	<p style="text-align: center;"><b>Sensor</b> <b>28081 (433 MHz)</b></p>  <p>BMW; 1 Series; 2012-2013; Includes Transmitter Only BMW; 328i; 2010-2013; Includes Transmitter Only BMW; 328i xDrive; 2010-2013; Includes Transmitter Only BMW; 335d; 2010-2011; Includes Transmitter Only BMW; 335i; 2010-2013; Includes Transmitter Only BMW; 335i xDrive; 2010-2013; Includes Transmitter Only BMW; 335is; 2012-2013; Includes Transmitter Only BMW; 528; 2012-2014; Includes Transmitter Only BMW; 535; 2012-2014; Includes Transmitter Only BMW; 535d; 2014; Includes Transmitter Only BMW; 535d xDrive; 2014; Includes Transmitter Only BMW; 550; 2012-2014; Includes Transmitter Only BMW; 640; 2012-2015; Includes Transmitter Only BMW; 650; 2012-2015; Includes Transmitter Only BMW; 740i; 2012-2015; Includes Transmitter Only BMW; 740Li; 2012-2015; Includes Transmitter Only BMW; 740Li xDrive; 2013-2015; Includes Transmitter Only BMW; 750; 2012-2015; Includes Transmitter Only BMW; 760Li; 2012-2015 BMW; ActiveHybrid 5; 2012-2014; Includes Transmitter Only BMW; ActiveHybrid 7; 2013-2015; Includes Transmitter Only BMW; M; 2010; Includes Transmitter Only BMW; M; 2011-2013; Includes Transmitter Only BMW; M; 2014; Includes Transmitter Only BMW; M; 2015; Includes Transmitter Only BMW; X; 2012-2014; Includes Transmitter Only BMW; X; 2015; Includes Transmitter Only BMW; Z4; 2012-2015; Includes Transmitter Only Mini; Cooper; 2009; Includes Transmitter Only Mini; Cooper; 2010-2013; Includes Transmitter Only Mini; Cooper; 2014; Transmitter only</p>
<p style="text-align: center;"><b>28004 (315 MHz)</b></p>  <p>Chrysler; Prowler; 2001 Plymouth; Prowler; 1997 Plymouth; Prowler; 1999-2001</p>	<p style="text-align: center;"><b>28006 (315 MHz)</b></p>  <p>Chevrolet; Corvette; 1997-2000</p>
<p style="text-align: center;"><b>28070 (315 MHz)</b></p>  <p>Kia; Forte; 2014-2015</p>	<p style="text-align: center;"><b>28082 (433 MHz)</b></p>  <p>BMW; X; 2000-2003; Includes Transmitter Only BMW; X; 2004; Includes Transmitter Only Land Rover; LR3; 2002-2005; Includes Transmitter Only Land Rover; Range Rover; 2002; Includes Transmitter Only Land Rover; Range Rover; 2003-2005; Includes Transmitter Only</p>
<p style="text-align: center;"><b>28078 (433 MHz)</b></p>  <p>Saab; 9-3; 2003-2007 Saab; 9-5; 2003-2007 Saturn; Astra; 2008-2009</p>	

# Numerical Listing

## Sensor

**28087 (433 MHz)**



Porsche; 911; 2005-2006; Includes Transmitter Only  
 Porsche; 911; 2007-2009; Includes Transmitter Only  
 Porsche; 911; 2010; Includes Transmitter Only  
 Porsche; 911; 2012; Includes Transmitter Only  
 Porsche; Boxster; 2005-2007; Includes Transmitter Only  
 Porsche; Boxster; 2008-2010; Includes Transmitter Only  
 Porsche; Carrera GT; 2004-2005; Includes Transmitter Only  
 Porsche; Cayenne; 2003-2006; Includes Transmitter Only  
 Porsche; Cayman; 2006-2007; Includes Transmitter Only  
 Porsche; Cayman; 2008-2010; Includes Transmitter Only  
 Porsche; Cayman; 2011; Includes Transmitter Only  
 Porsche; Panamera; 2010; Includes Transmitter Only  
 Porsche; Panamera; 2011; Includes Transmitter Only

**28096 (315 MHz)**



Mitsubishi; i-MiEV; 2012  
 Mitsubishi; Lancer; 2008-2010  
 Mitsubishi; Lancer; 2011  
 Mitsubishi; Lancer; 2012  
 Mitsubishi; Lancer; 2013-2014  
 Mitsubishi; Lancer; 2015  
 Mitsubishi; Mirage; 2014  
 Mitsubishi; Outlander; 2007-2010  
 Mitsubishi; Outlander; 2011-2015  
 Mitsubishi; Outlander Sport; 2011-2015  
 Mitsubishi; RVR; 2011-2014

## Sensor

**28126 (433 MHz)**



BMW; 228i; 2014  
 BMW; 228i; 2015  
 BMW; 320i; 2014  
 BMW; 320i xDrive; 2014  
 BMW; 328d; 2014  
 BMW; 328d xDrive; 2014  
 BMW; 328i; 2014; Includes Transmitter Only  
 BMW; 328i; 2015; Includes Transmitter Only  
 BMW; 328i GT xDrive; 2014; Includes Transmitter Only  
 BMW; 328i GT xDrive; 2015; Includes Transmitter Only  
 BMW; 328i xDrive; 2014; Includes Transmitter Only  
 BMW; 328i xDrive; 2015; Includes Transmitter Only  
 BMW; 335i; 2014; Includes Transmitter Only  
 BMW; 335i GT xDrive; 2014; Includes Transmitter Only  
 BMW; 335i GT xDrive; 2015; Includes Transmitter Only  
 BMW; 335i xDrive; 2014; Includes Transmitter Only  
 BMW; 335i xDrive; 2015; Includes Transmitter Only  
 BMW; 428i; 2014; Includes Transmitter Only  
 BMW; 428i; 2015  
 BMW; 428i; 2016  
 BMW; 428i xDrive; 2014  
 BMW; 428i xDrive; 2015  
 BMW; 435i; 2014  
 BMW; 435i; 2015  
 BMW; 435i; 2016  
 BMW; 435i xDrive; 2014  
 BMW; 435i xDrive; 2015  
 BMW; 528; 2015-2016  
 BMW; 535; 2015-2016  
 BMW; 535d; 2015-2016  
 BMW; 535d xDrive; 2015-2016  
 BMW; 550; 2015-2016  
 BMW; 640; 2016  
 BMW; 650; 2016  
 BMW; 650i Gran Coupe xDrive; 2016  
 BMW; ActiveHybrid 3; 2013-2014  
 BMW; ActiveHybrid 5; 2015  
 BMW; M; 2014; Includes Transmitter Only  
 BMW; M; 2015  
 BMW; X; 2015  
 BMW; X; 2016  
 BMW; Z4; 2016  
 Mini; Cooper; 2014; Includes Transmitter Only  
 Mini; Cooper; 2014; Transmitter only  
 Mini; Cooper; 2015

**28128 (315 MHz)**



Acura; MDX, RDX; 2013-2015  
 Acura; RLX; 2016

# Numerical Listing

## Sensor 28129 (315 MHz)



Mitsubishi; Eclipse; 2006-2007; W/Steel Wheels  
 Mitsubishi; Eclipse; 2012; W/Steel Wheels  
 Mitsubishi; Endeavor; 2011; W/Steel Wheels  
 Mitsubishi; Galant; 2007; W/Steel Wheels  
 Mitsubishi; Galant; 2008-2009; W/Steel Wheels  
 Mitsubishi; Galant; 2010-2012; W/Steel Wheels

## 28167 (315 MHz)



Nissan; Pathfinder; 2007; OEM Part No. 40700JA01A  
 Nissan; Versa; 2007; OEM Part No. 40700JA01A  
 Nissan; Xterra; 2007; OEM Part No. 40700JA01A

## 28203 (315 MHz)



Subaru; Forester; 2008-2015  
 Subaru; Forester; 2016  
 Subaru; Impreza; 2008-2015  
 Subaru; Impreza; 2016  
 Subaru; Legacy; 2008; W/18" Wheels  
 Subaru; Legacy; 2009-2015  
 Subaru; Legacy; 2016  
 Subaru; Outback; 2008-2015  
 Subaru; Outback; 2016  
 Subaru; Tribeca; 2008; W/Rubber Stem Snap-in Sensor  
 Subaru; Tribeca; 2009; W/Rubber Stem Snap-in Sensor  
 Subaru; Tribeca; 2010; W/Rubber Stem Snap-in Sensor  
 Subaru; Tribeca; 2011; W/Rubber Stem Snap-in Sensor  
 Subaru; Tribeca; 2012-2014  
 Subaru; WRX; 2013-2015  
 Subaru; WRX; 2016  
 Subaru; XV Crosstrek; 2013-2015  
 Subaru; XV Crosstrek; 2016

## Sensor 28204 (315 MHz)



Infiniti; FX35; 2007; Jul. & Newer  
 Infiniti; FX35; 2008  
 Infiniti; FX45; 2007; Jul. & Newer  
 Infiniti; FX45; 2008  
 Infiniti; G35; 2007; Coupe  
 Infiniti; M35; 2008-2010  
 Infiniti; M35h; 2012  
 Infiniti; M37; 2011-2012  
 Infiniti; M45; 2008-2009  
 Infiniti; M45; 2010  
 Infiniti; M56; 2011-2012  
 Infiniti; Q45; 2006; Aug. & Newer  
 Infiniti; QX56; 2007; Apr. 1 & Newer  
 Infiniti; QX56; 2008-2010  
 Nissan; 350Z; 2007-2009  
 Nissan; Altima; 2006; Oct. 1 & Newer  
 Nissan; Altima; 2007-2010  
 Nissan; Altima; 2011-2012  
 Nissan; Armada; 2008; LE  
 Nissan; Armada; 2009-2011  
 Nissan; Armada; 2012-2015  
 Nissan; Armada; 2016  
 Nissan; Cube; 2009-2010  
 Nissan; Cube; 2011-2012; non-Ikey  
 Nissan; Frontier; 2008; W/Steel Wheels  
 Nissan; Frontier; 2009-2011  
 Nissan; Frontier; 2012-2015  
 Nissan; Frontier; 2016  
 Nissan; GT-R; 2009  
 Nissan; GT-R; 2010  
 Nissan; GT-R; 2011-2016  
 Nissan; Juke; 2011  
 Nissan; Juke; 2012  
 Nissan; Maxima; 2007; Apr. 1 & Newer  
 Nissan; Maxima; 2008-2010  
 Nissan; Maxima; 2011-2012  
 Nissan; Murano; 2007  
 Nissan; Murano; 2009  
 Nissan; Murano; 2010  
 Nissan; Murano; 2011  
 Nissan; Murano; 2012-2014  
 Nissan; NV; 2014-2015  
 Nissan; NV; 2016  
 Nissan; Pathfinder; 2007; OEM Part No. 40700JA01B  
 Nissan; Pathfinder; 2008-2011  
 Nissan; Pathfinder; 2012  
 Nissan; Quest; 2007-2009  
 Nissan; Rogue; 2008-2009  
 Nissan; Rogue; 2011  
 Nissan; Rogue; 2012  
 Nissan; Sentra; 2007; W/Steel Wheels  
 Nissan; Sentra; 2008  
 Nissan; Sentra; 2009-2010  
 Nissan; Sentra; 2011-2013  
 Nissan; Titan; 2007; Apr. 1 & Newer  
 Nissan; Titan; 2008-2011  
 Nissan; Titan; 2012-2015  
 Nissan; Versa; 2007; OEM Part No. 40700JA01B  
 Nissan; Versa; 2008-2010  
 Nissan; Versa; 2011-2012

# Numerical Listing

Nissan; Xterra; 2007; OEM Part No. 40700JA01B  
 Nissan; Xterra; 2008-2011  
 Nissan; Xterra; 2012-2015  
 Nissan; Xterra; 2016  
 Suzuki; Equator; 2009-2012

## Sensor

28206 (314.9 MHz)



Buick; Allure; 2010  
 Buick; Encore; 2013-2015  
 Buick; Encore; 2016  
 Buick; LaCrosse; 2010-2015  
 Buick; LaCrosse; 2016  
 Buick; Regal; 2011-2016  
 Buick; Verano; 2012-2015  
 Buick; Verano; 2016  
 Cadillac; ATS; 2013; exc V  
 Cadillac; ATS; 2014; exc V  
 Cadillac; ATS; 2015; exc V  
 Cadillac; ATS; 2016; exc V  
 Cadillac; CTS; 2014-2015; exc V  
 Cadillac; CTS; 2016; exc V  
 Cadillac; ELR; 2014  
 Cadillac; ELR; 2015  
 Cadillac; ELR; 2016  
 Cadillac; Escalade; 2014-2015  
 Cadillac; Escalade; 2016  
 Cadillac; SRX; 2010-2015  
 Cadillac; XTS; 2013-2015  
 Cadillac; XTS; 2016  
 Chevrolet; Camaro; 2010-2011  
 Chevrolet; Camaro; 2012; exc ZL1; OEM Part No. 20922900; OEM Part No. 22854866  
 Chevrolet; Camaro; 2013-2015; Exc. ZL1  
 Chevrolet; Cobalt; 2010  
 Chevrolet; Colorado; 2015  
 Chevrolet; Colorado; 2016  
 Chevrolet; Cruze; 2011-2015  
 Chevrolet; Cruze; 2016  
 Chevrolet; Equinox; 2010-2014  
 Chevrolet; Equinox; 2015  
 Chevrolet; Equinox; 2016  
 Chevrolet; HHR; 2010  
 Chevrolet; Impala; 2014-2015  
 Chevrolet; Impala; 2016  
 Chevrolet; Malibu; 2010  
 Chevrolet; Malibu; 2013-2015  
 Chevrolet; Orlando; 2012-2014  
 Chevrolet; Silverado Series; 2014-2015; W/Single Rear Wheels  
 Chevrolet; Silverado Series; 2016; W/Single Rear Wheels  
 Chevrolet; Sonic; 2012-2015  
 Chevrolet; Sonic; 2016  
 Chevrolet; Spark; 2013-2015  
 Chevrolet; Spark; 2016  
 Chevrolet; Suburban; 2014  
 Chevrolet; Suburban; 2015  
 Chevrolet; Suburban; 2016  
 Chevrolet; Tahoe; 2014-2015  
 Chevrolet; Tahoe; 2016  
 Chevrolet; Trax; 2013-2015  
 Chevrolet; Trax; 2016  
 Chevrolet; Volt; 2011-2015  
 Chevrolet; Volt; 2016  
 GMC; Canyon; 2015  
 GMC; Canyon; 2016  
 GMC; Sierra Series; 2014; W/Single Rear Wheels  
 GMC; Sierra Series; 2015; W/Single Rear Wheels  
 GMC; Sierra Series; 2016; W/Single Rear Wheels

# Numerical Listing

GMC; Terrain; 2010-2014  
 GMC; Terrain; 2015  
 GMC; Terrain; 2016  
 GMC; Yukon; 2014-2015  
 GMC; Yukon; 2016  
 Saab; 9-4X; 2011

## 28210 (315 MHz)



Infiniti; EX35; 2008-2010  
 Infiniti; FX35; 2009-2010  
 Infiniti; FX50; 2009-2010  
 Infiniti; G35; 2007; Sedan  
 Infiniti; G35; 2008  
 Infiniti; G37; 2008-2010  
 Nissan; 370Z; 2009-2010

## Sensor

## 28214 (433 MHz)



Mercedes-Benz; 550,63AMG; 2007-2009  
 Mercedes-Benz; C Series; 2007; Jun. & Newer  
 Mercedes-Benz; C Series; 2008-2009  
 Mercedes-Benz; C Series; 2010-2012  
 Mercedes-Benz; C Series; 2013  
 Mercedes-Benz; C250; 2012  
 Mercedes-Benz; C250; 2013  
 Mercedes-Benz; C280; 2007; Mar. & Newer  
 Mercedes-Benz; CLK; 2006  
 Mercedes-Benz; CLK350; 2006-2009  
 Mercedes-Benz; CLS550; 2012  
 Mercedes-Benz; CLS550; 2013  
 Mercedes-Benz; E350; 2010-2012  
 Mercedes-Benz; E350; 2013  
 Mercedes-Benz; E550; 2010-2011  
 Mercedes-Benz; E550; 2012-2013  
 Mercedes-Benz; E63 AMG; 2010-2011  
 Mercedes-Benz; E63 AMG; 2012-2013  
 Mercedes-Benz; G500; 2007; Mar. & Newer  
 Mercedes-Benz; G500; 2008  
 Mercedes-Benz; G55 AMG; 2007; Mar. & Newer  
 Mercedes-Benz; G55 AMG; 2008-2010  
 Mercedes-Benz; G55 AMG; 2011  
 Mercedes-Benz; G550; 2009-2010  
 Mercedes-Benz; G550; 2011  
 Mercedes-Benz; G550; 2012-2013  
 Mercedes-Benz; GL; 2010  
 Mercedes-Benz; GL; 2011  
 Mercedes-Benz; GL; 2012-2013  
 Mercedes-Benz; GL350; 2010  
 Mercedes-Benz; GL350; 2011  
 Mercedes-Benz; GL350; 2012-2013  
 Mercedes-Benz; GL63 AMG; 2013  
 Mercedes-Benz; GLK350; 2010  
 Mercedes-Benz; GLK350; 2011  
 Mercedes-Benz; GLK350; 2012  
 Mercedes-Benz; GLK350; 2013  
 Mercedes-Benz; ML350; 2010  
 Mercedes-Benz; ML350; 2011  
 Mercedes-Benz; ML350; 2012  
 Mercedes-Benz; ML350; 2013  
 Mercedes-Benz; ML450; 2010  
 Mercedes-Benz; ML450; 2011  
 Mercedes-Benz; ML550; 2010  
 Mercedes-Benz; ML550; 2011-2012  
 Mercedes-Benz; ML63 AMG; 2010  
 Mercedes-Benz; ML63 AMG; 2011  
 Mercedes-Benz; ML63 AMG; 2012-2013  
 Mercedes-Benz; R350; 2010  
 Mercedes-Benz; R350; 2011  
 Mercedes-Benz; R350; 2012  
 Mercedes-Benz; R350; 2013  
 Mercedes-Benz; S Series; 2011  
 Mercedes-Benz; S Series; 2012  
 Mercedes-Benz; S Series; 2013  
 Mercedes-Benz; S550; 2011  
 Mercedes-Benz; S550; 2012-2013  
 Mercedes-Benz; S600; 2011  
 Mercedes-Benz; S600; 2012-2013  
 Mercedes-Benz; S63 AMG; 2011

# Numerical Listing

Mercedes-Benz; S63 AMG; 2012-2013  
 Mercedes-Benz; S65 AMG; 2011  
 Mercedes-Benz; S65 AMG; 2012-2013  
 Mercedes-Benz; SL550; 2012  
 Mercedes-Benz; SL550; 2013  
 Mercedes-Benz; SL63 AMG; 2012  
 Mercedes-Benz; SL63 AMG; 2013  
 Mercedes-Benz; SLK250; 2012  
 Mercedes-Benz; SLK250; 2013  
 Mercedes-Benz; SLK280; 2007; May & Newer  
 Mercedes-Benz; SLK280; 2008  
 Mercedes-Benz; SLK300; 2009-2011  
 Mercedes-Benz; SLK350; 2007; May & Newer  
 Mercedes-Benz; SLK350; 2008-2012  
 Mercedes-Benz; SLK350; 2013  
 Mercedes-Benz; SLK55 AMG; 2007; May & Newer  
 Mercedes-Benz; SLK55 AMG; 2008-2010  
 Mercedes-Benz; SLS AMG; 2011-2012  
 Mercedes-Benz; SLS AMG; 2013  
 Smart; Fortwo; 2008-2012  
 Smart; Fortwo; 2013

## 28291 (433 MHz)



Chrysler; 300; 2009-2010  
 Dodge; Challenger; 2008; OEM No. 56029400AB  
 Dodge; Challenger; 2009  
 Dodge; Challenger; 2010-2012; W/Metal Stem Clamp-in Sensor  
 Dodge; Charger; 2009  
 Dodge; Charger; 2010; W/Metal Stem Clamp-in Sensor  
 Dodge; Viper; 2012-2013; W/Metal Stem Clamp-in Sensor  
 Dodge; Viper; 2014-2015; W/Metal Stem Clamp-in Sensor  
 Dodge; Viper; 2016; W/Metal Stem Clamp-in Sensor

## 28300 (315 MHz)



Toyota; Sequoia; 2004-2007; W/Steel Wheels; W/40 Deg. Angled Valve Sensor  
 Toyota; Tacoma; 2005; W/40 Deg. Angled Valve Sensor; Nov. 30 & Older  
 Toyota; Tundra; 2005; W/Steel Wheels; W/40 Deg. Angled Valve Sensor  
 Toyota; Tundra; 2006; W/Steel Wheels; W/40 Deg. Angled Valve Sensor

## Sensor

### 28305 (315 MHz)



Toyota; Sequoia; 2004; W/Alloy Wheels  
 Toyota; Sequoia; 2004; W/Steel Wheels; W/20 Deg. Angled Valve Sensor  
 Toyota; Sequoia; 2005; W/Alloy Wheels  
 Toyota; Sequoia; 2005; W/Steel Wheels; W/20 Deg. Angled Valve Sensor  
 Toyota; Sequoia; 2006; W/Alloy Wheels  
 Toyota; Sequoia; 2006; W/Steel Wheels; W/20 Deg. Angled Valve Sensor  
 Toyota; Sequoia; 2007; W/Alloy Wheels  
 Toyota; Sequoia; 2007; W/Steel Wheels; W/20 Deg. Angled Valve Sensor  
 Toyota; Tacoma; 2005; W/20 Deg. Angled Valve Sensor; Nov. 30 & Older  
 Toyota; Tundra; 2005; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor  
 Toyota; Tundra; 2006; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor



# Numerical Listing

## Sensor 28308 (315 MHz)



Chrysler; 200; 2011  
 Chrysler; 200; 2012; Rubber Valve  
 Chrysler; 200; 2013-2014  
 Chrysler; 300; 2005-2006  
 Chrysler; 300; 2007; Use until depleted-superseded by 20066  
 Chrysler; Aspen; 2007-2011  
 Chrysler; Crossfire; 2005  
 Chrysler; Pacifica; 2006-2007  
 Chrysler; Pacifica; 2008  
 Chrysler; PT Cruiser; 2008-2010  
 Chrysler; Sebring; 2007-2009  
 Chrysler; Sebring; 2010  
 Chrysler; Town & Country; 2006-2007  
 Chrysler; Town & Country; 2008; Can also use 20066 until depleted  
 Dodge; Avenger; 2008-2009  
 Dodge; Avenger; 2010-2012  
 Dodge; Avenger; 2013-2014  
 Dodge; Caliber; 2007-2010  
 Dodge; Caliber; 2011-2012  
 Dodge; Caravan; 2006-2007  
 Dodge; Charger; 2006-2007  
 Dodge; Durango; 2007  
 Dodge; Durango; 2008  
 Dodge; Durango; 2009  
 Dodge; Grand Caravan; 2006-2007  
 Dodge; Magnum; 2005-2007  
 Dodge; Nitro; 2007-2008  
 Dodge; Nitro; 2009-2011  
 Jeep; Commander; 2006-2007  
 Jeep; Compass; 2007-2010  
 Jeep; Compass; 2011  
 Jeep; Compass; 2012-2015  
 Jeep; Compass; 2016  
 Jeep; Grand Cherokee; 2005-2007  
 Jeep; Liberty; 2005-2008  
 Jeep; Liberty; 2009; W/315 MHz Snap-in Sensor  
 Jeep; Liberty; 2010-2012  
 Jeep; Patriot; 2007-2010  
 Jeep; Patriot; 2011-2012  
 Jeep; Patriot; 2013-2015; W/315 MHz  
 Jeep; Patriot; 2016; W/315 MHz  
 Jeep; Wrangler; 2007-2008  
 Jeep; Wrangler; 2011  
 Jeep; Wrangler; 2012  
 Suzuki; Kizashi; 2010-2012

## 28310 (315 MHz)



Lexus; SC430; 2002-2005; W/White I.D. Mark  
 Lexus; SC430; 2006; W/White I.D. Mark; Jul. & Older

## Sensor 28315 (315 MHz)



Lexus; SC430; 2002-2005; W/Blue I.D. Mark  
 Lexus; SC430; 2006; W/Blue I.D. Mark; Jul. & Older

## 28320 (315 MHz)



Lexus; SC430; 2002-2005; W/Red I.D. Mark  
 Lexus; SC430; 2006; W/Red I.D. Mark; Jul. & Older

## 28325 (315 MHz)



Lexus; SC430; 2002-2005; W/Gold I.D. Mark  
 Lexus; SC430; 2006; W/Gold I.D. Mark; Jul. & Older

## 28335 (315 MHz)



Lexus; GS300; 2006  
 Lexus; GS430; 2005  
 Lexus; GS430; 2006; Jun. & Older  
 Lexus; GX470; 2006; Feb. & Newer; W/O Valve Cap  
 Lexus; IS250; 2006; Mar. & Older  
 Lexus; IS350; 2006; Mar. & Older  
 Toyota; 4Runner; 2006; OEM Part No. 4260730030

# Numerical Listing

## Sensor

**28342 (315 MHz)**



Nissan; NV; 2012  
Nissan; NV; 2013-2015  
Nissan; NV; 2016

**28345 (315 MHz)**



Lexus; GX470; 2004-2005  
Lexus; GX470; 2006; Jan. 31 & Older  
Lexus; HS250h; 2010-2012  
Toyota; 4Runner; 2003-2005  
Toyota; 4Runner; 2006; OEM Part No. 4260735010

**28355 (315 MHz)**



Toyota; Tacoma; 2005; W/20 Deg. Angled Valve Sensor; Dec. 1 & Newer  
Toyota; Tacoma; 2006; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor; Jul. & Older

## Sensor

**28360 (315 MHz)**



Lexus; LS460; 2016  
Pontiac; Vibe; 2008-2010  
Scion; FR-S; 2013  
Subaru; BRZ; 2013-2014  
Toyota; Avalon; 2006; Aug. & Newer  
Toyota; Avalon; 2007-2014  
Toyota; Avalon; 2015  
Toyota; Camry; 2007-2011; Models made in USA; OEM Part No. 4260706011  
Toyota; Camry; 2012-2014  
Toyota; Camry; 2015; Lo Line Sensor  
Toyota; Corolla; 2007; Models made in USA; OEM Part No. 4260706011; Jun. & Newer  
Toyota; Corolla; 2008; Models made in USA; OEM Part No. 4260706011  
Toyota; Corolla; 2009-2012; Models made in USA; W/16" Or 17" Wheels  
Toyota; Corolla; 2013; Models made in USA; W/16" Or 17" Wheels  
Toyota; Corolla; 2014; Models made in USA; W/16" Or 17" Wheels  
Toyota; Corolla; 2015; Models made in USA; W/16" Or 17" Wheels  
Toyota; FJ Cruiser; 2015; Models made in USA; W/16" Or 17" Wheels  
Toyota; Highlander; 2011-2014  
Toyota; Highlander; 2015  
Toyota; Matrix; 2007; Models made in USA; OEM Part No. 4260706011; Jun. & Newer  
Toyota; Matrix; 2008-2013; Models made in USA; OEM Part No. 4260706011  
Toyota; Prius; 2013  
Toyota; RAV4; 2012; Electric  
Toyota; Solara; 2006; May & Newer  
Toyota; Solara; 2007-2008  
Toyota; Tacoma; 2006; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor; Aug. & Newer  
Toyota; Tacoma; 2007-2013; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor  
Toyota; Tacoma; 2014; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor  
Toyota; Tacoma; 2015; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor  
Toyota; Venza; 2009-2014  
Toyota; Venza; 2015-2016  
Toyota; Yaris; 2013

**28362 (315 MHz)**



Volvo; XC90; 2012-2015

# Numerical Listing

<p style="text-align: center;"><b>Sensor</b> <b>28365 (315 MHz)</b></p>	<p style="text-align: center;"><b>Sensor</b> <b>28370 (315 MHz)</b></p>
	
<p>Lexus: GX470; 2006; Feb. &amp; Newer; W/Valve Cap            Lexus: LX470; 2005            Lexus: LX470; 2006; Jul. &amp; Older            Scion: iQ; 2012-2014            Scion: iQ; 2015            Scion: tC; 2006; May &amp; Newer            Scion: tC; 2007-2014            Scion: tC; 2015            Scion: xB; 2008-2014            Scion: xB; 2015            Scion: xD; 2008-2014            Toyota: 4Runner; 2006; OEM Part No. 4260733011            Toyota: 4Runner; 2007; W/Valve Cap            Toyota: 4Runner; 2008; W/Valve Cap; OEM Part No. 4260733011            Toyota: 4Runner; 2009; W/Valve Cap            Toyota: Camry; 2007-2011; Models made in Japan; OEM Part No. 4260733011            Toyota: Corolla; 2007; Models made in Japan; OEM Part No. 4260733011; Jun. &amp; Newer            Toyota: Corolla; 2008; Models made in Japan; OEM Part No. 4260733011            Toyota: Corolla; 2009; Models made in Japan; OEM Part No. 4260733011            Toyota: Corolla; 2009-2010; Models made in USA; W/15" Wheels            Toyota: Corolla; 2010; Models made in Japan; OEM Part No. 4260733011            Toyota: Corolla; 2011; Models made in USA; W/15" Wheels            Toyota: Corolla; 2011-2012; Models made in Japan; OEM Part No. 4260733011            Toyota: Corolla; 2012; Models made in USA; W/15" Wheels            Toyota: Corolla; 2013; Models made in Japan            Toyota: FJ Cruiser; 2008-2014            Toyota: Highlander; 2007; May &amp; Newer            Toyota: Highlander; 2008-2010            Toyota: Land Cruiser; 2005; May &amp; Newer            Toyota: Land Cruiser; 2006            Toyota: Land Cruiser; 2007-2011            Toyota: Land Cruiser; 2013-2014            Toyota: Land Cruiser; 2015            Toyota: Matrix; 2007; Models made in Japan; OEM Part No. 4260733011; Jun. &amp; Newer            Toyota: Matrix; 2008-2013; Models made in Japan; OEM Part No. 4260733011            Toyota: Prius; 2005-2013            Toyota: Prius; 2014-2016            Toyota: RAV4; 2006; exc Electric            Toyota: Yaris; 2007; Aug. &amp; Newer            Toyota: Yaris; 2008-2012</p>	<p>Lexus: CT200h; 2011            Lexus: CT200h; 2012-2015            Lexus: ES300h; 2013            Lexus: ES300h; 2014-2015            Lexus: ES350; 2007-2013            Lexus: ES350; 2014-2015            Lexus: GS350; 2007-2011            Lexus: GS350; 2013; 315 MHz            Lexus: GS350; 2014-2016; 315 MHz            Lexus: GS430; 2006; Jul. &amp; Newer            Lexus: GS430; 2007            Lexus: GS450h; 2007-2011            Lexus: GS450h; 2013-2016            Lexus: GS460; 2008-2011            Lexus: GS460; 2012-2016            Lexus: GX460; 2010-2015            Lexus: GX470; 2007-2009            Lexus: IS F; 2008-2015            Lexus: IS F; 2016            Lexus: IS250; 2006; Apr. 1 &amp; Newer            Lexus: IS250; 2007            Lexus: IS250; 2008-2015            Lexus: IS250; 2016            Lexus: IS350; 2006; Apr. 1 &amp; Newer            Lexus: IS350; 2007-2015            Lexus: IS350; 2016            Lexus: LFA; 2012            Lexus: LFA; 2016            Lexus: LS460; 2007-2015            Lexus: LS600h; 2008-2016            Lexus: LX470; 2006; Aug. &amp; Newer            Lexus: LX470; 2007            Lexus: LX570; 2008-2011            Lexus: LX570; 2013-2014            Lexus: LX570; 2016            Lexus: RX330; 2006; Models made in Japan; Feb. &amp; Newer            Lexus: RX350; 2007-2010; Models made in Japan            Lexus: RX350; 2011-2012            Lexus: RX350; 2013; exc F Sport            Lexus: RX350; 2014-2015; F Sport; Vehicle Made for Canada            Lexus: RX400h; 2006            Lexus: RX400h; 2007-2008; Models made in Japan            Lexus: RX450h; 2010-2013            Lexus: RX450h; 2014-2015            Lexus: SC430; 2006; Aug. &amp; Newer            Lexus: SC430; 2007-2010            Toyota: 4Runner; 2006; OEM Part No. 4260733021            Toyota: 4Runner; 2007; W/O Valve Cap            Toyota: 4Runner; 2008; W/O Valve Cap; OEM Part No. 4260733021            Toyota: 4Runner; 2009; W/O Valve Cap            Toyota: 4Runner; 2010-2016            Toyota: Corolla; 2009-2012; Models made in Japan; OEM Part No. 4260733021            Toyota: RAV4; 2007-2011; exc Electric            Toyota: RAV4; 2012; exc Electric            Toyota: RAV4; 2013; exc Electric</p>

# Numerical Listing

## Sensor

**28380 (315 MHz)**



Toyota; Tacoma; 2005; W/40 Deg. Angled Valve Sensor; Dec. 1 & Newer  
 Toyota; Tacoma; 2006; W/Steel Wheels; W/40 Deg. Angled Valve Sensor  
 Toyota; Tacoma; 2007-2013; W/Steel Wheels; W/40 Deg. Angled Valve Sensor  
 Toyota; Tacoma; 2015; W/Steel Wheels; W/20 Deg. Angled Valve Sensor  
 Toyota; Tundra; 2014; W/Steel Wheels

**28385 (315 MHz)**



Ford; Crown Victoria; 2006-2011  
 Ford; Edge; 2007-2008; W/Chrome Plated Almm. Wheels  
 Ford; Escape; 2005; Oct. 3, 2005 & Newer  
 Ford; Escape; 2006-2008  
 Ford; E-Series Van; 2007  
 Ford; Explorer; 2006-2010  
 Ford; Explorer Sport Trac; 2007-2010  
 Ford; F-150; 2007  
 Ford; F-150; 2008; W/O H.D. Payload Pkg  
 Ford; Focus; 2007  
 Ford; Freestar; 2006-2007  
 Ford; Fusion; 2007-2009  
 Ford; Mustang; 2007-2009  
 Ford; Ranger; 2007-2011  
 Lincoln; Mark LT; 2007-2008  
 Lincoln; MKX; 2007-2008; W/Chrome Plated Almm. Wheels  
 Lincoln; MKZ; 2007-2009  
 Lincoln; Town Car; 2006-2010  
 Lincoln; Zephyr; 2006  
 Mazda; B2300; 2007-2009  
 Mazda; B3000; 2007-2008  
 Mazda; B4000; 2007-2009  
 Mazda; Tribute; 2006  
 Mazda; Tribute; 2008  
 Mercury; Grand Marquis; 2006-2011  
 Mercury; Mariner; 2005; Oct. 3, 2005 & Newer  
 Mercury; Mariner; 2006-2008  
 Mercury; Milan; 2007-2009  
 Mercury; Monterey; 2006-2007  
 Mercury; Mountaineer; 2006-2010

## Sensor

**28390 (315 MHz)**



Ford; Edge; 2007-2008; W/O Chrome Plated Almm. Wheels  
 Ford; Edge; 2009-2010  
 Ford; Expedition; 2007-2010  
 Ford; Five Hundred; 2006-2007  
 Ford; Flex; 2009-2010  
 Ford; Focus; 2008-2009  
 Ford; Taurus; 2008-2009  
 Ford; Taurus; 2010; Apr. & Older  
 Lincoln; MKS; 2009-2010  
 Lincoln; MKT; 2010  
 Lincoln; MKX; 2007-2008; W/O Chrome Plated Almm. Wheels  
 Lincoln; MKX; 2009-2010  
 Lincoln; Navigator; 2007-2010  
 Mercury; Montego; 2006-2007  
 Mercury; Sable; 2008-2009

**28395 (315 MHz)**



Ford; E-Series Van; 2007  
 Ford; E-Series Van; 2008-2009  
 Ford; E-Series Van; 2010  
 Ford; E-Series Van; 2010; W/Alloy Wheels  
 Ford; F-150; 2008; W/H.D. Payload Pkg  
 Ford; F-250 Super Duty; 2008-2010  
 Ford; F-350 Super Duty; 2008-2010  
 Ford; F-450 Super Duty; 2008  
 Ford; F-450 Super Duty; 2009  
 Ford; F-450 Super Duty; 2010  
 Ford; F-550 Super Duty; 2010

**28423 (314.9 MHz)**



Cadillac; ATS; 2014; V  
 Cadillac; ATS; 2015; V  
 Cadillac; CTS; 2014-2015; V  
 Chevrolet; Camaro; 2012; ZL1  
 Chevrolet; Camaro; 2013-2015; ZL1  
 Chevrolet; Caprice; 2016  
 Chevrolet; SS; 2014-2016

# Numerical Listing

## Sensor 28434 (433 MHz)



Chrysler; 300; 2007; Can also use 28155 until depleted  
 Chrysler; 300; 2008  
 Chrysler; Town & Country; 2008; Can also use 28155 until depleted  
 Chrysler; Town & Country; 2009-2010  
 Dodge; Challenger; 2008; OEM No. 56029481AB; 433 MHz Sensor; Rubber Valve  
 Dodge; Charger; 2008  
 Dodge; Grand Caravan; 2008  
 Dodge; Grand Caravan; 2009-2010  
 Dodge; Journey; 2009  
 Dodge; Journey; 2010; Replaces clamp-in Sensor  
 Dodge; Magnum; 2008  
 Dodge; Ram 4500; 2010; W/Rubber Stem Snap-in Sensor  
 Dodge; Ram 5500; 2010; W/Rubber Stem Snap-in Sensor  
 Dodge; Ram Series; 2009  
 Dodge; Ram Series; 2010; W/Rubber Stem Snap-in Sensor  
 Jeep; Commander; 2008-2010  
 Jeep; Grand Cherokee; 2008-2010  
 Jeep; Liberty; 2009; W/433 MHz Clamp-in Sensor  
 Jeep; Wrangler; 2009  
 Jeep; Wrangler; 2010  
 Volkswagen; Routan; 2009-2010

## 28461 (315 MHz)



Dodge; Dakota; 2008-2010  
 Dodge; Ram Series; 2008  
 Dodge; Ram Series; 2009  
 Mitsubishi; Raider; 2008-2009

## 28500 (315 MHz)

Hyundai; Tucson; 2014  
 Kia; Sportage; 2014-2015

## Sensor 28505 (315 MHz)



Hyundai; Veloster; 2012-2015

## 28586 (433 MHz)



Chrysler; 200; 2015  
 Dodge; Dart; 2013-2015

## 28670 (315 MHz)



Toyota; Sequoia; 2008-2013  
 Toyota; Sienna; 2006-2014  
 Toyota; Tundra; 2006; W/Alloy Wheels; W/TRW Sensor  
 Toyota; Tundra; 2007; W/Alloy Wheels; W/TRW Sensor  
 Toyota; Tundra; 2008-2011; W/Alloy Wheels; W/TRW Sensor  
 Toyota; Tundra; 2012  
 Toyota; Tundra; 2013; W/Alloy Wheels; W/TRW Sensor  
 Toyota; Tundra; 2014; W/Alloy Wheels

## 28720 (315 MHz)



Acura; CSX; 2008-2011  
 Honda; Civic; 2008-2014  
 Honda; CR-Z; 2011-2014  
 Honda; CR-Z; 2015  
 Honda; Element; 2009-2011  
 Honda; Fit; 2009-2014  
 Honda; Insight; 2010-2014  
 Honda; Odyssey; 2011-2016



# Numerical Listing

## Sensor

**28849 (315 MHz)**



Hyundai; Accent; 2008-2011  
 Hyundai; Equus; 2011-2013  
 Hyundai; Genesis; 2011-2013  
 Hyundai; Genesis; 2014  
 Hyundai; Santa Fe XL; 2013  
 Hyundai; Sonata; 2008  
 Hyundai; Sonata; 2009-2010  
 Hyundai; Tucson; 2010-2013  
 Kia; Borrego; 2009-2011  
 Kia; Rio; 2007-2011  
 Kia; Rio5; 2007-2011  
 Kia; Spectra; 2006  
 Kia; Spectra; 2007-2009  
 Kia; Spectra5; 2006  
 Kia; Spectra5; 2007-2009  
 Kia; Sportage; 2009-2012  
 Kia; Sportage; 2013

**28981 (315 MHz)**



Acura; MDX, RDX; 2004-2006  
 Acura; RL; 2005-2012  
 Acura; TL; 2005-2008  
 Honda; Odyssey; 2005-2007; Touring  
 Honda; Odyssey; 2008; Touring  
 Honda; Pilot; 2005; W/Short Stem Valve  
 Honda; Pilot; 2006-2008  
 Honda; Ridgeline; 2006; RTL, RTS  
 Honda; Ridgeline; 2007-2008; RTL, RTS, RTX  
 Honda; Ridgeline; 2009  
 Honda; Ridgeline; 2010; W/Alloy Wheels  
 Honda; Ridgeline; 2010; W/Steel Wheels  
 Honda; Ridgeline; 2011-2014

**28982 (315 MHz)**



Honda; Pilot; 2005; LX; W/Long Stem Valve  
 Honda; Ridgeline; 2006; RT  
 Honda; Ridgeline; 2007-2008; RT

## Sensor

**28983 (315 MHz)**



Honda; Odyssey; 2008  
 Honda; Odyssey; 2009-2010  
 Hyundai; Accent; 2006-2007  
 Hyundai; Sonata; 2007  
 Hyundai; Sonata; 2008  
 Hyundai; Tiburon; 2007-2008  
 Hyundai; Tucson; 2006-2009  
 Kia; Amanti; 2007-2009  
 Kia; Sorento; 2007-2009  
 Kia; Sportage; 2005; Jun. 15, 2005 & Newer  
 Kia; Sportage; 2006-2008


**28984 (315 MHz)**




Jeep; Cherokee; 2014  
 Jeep; Cherokee; 2015  
 Ram; Ram Series; 2014-2015



# Numerical Listing

Sensor INDIRECT	Service Pack 20002
<p>Audi; A3, A4,A5 &amp; Quattro; 2013-2016  Audi; A4 allroad; 2013-2016  Audi; A6; 2013-2016  Audi; A7 Quattro; 2013-2014  Audi; A8; 2013-2016  Audi; Q5; 2013-2016  Audi; Q7; 2013-2016  Audi; RS5; 2013-2015  Audi; S4; 2013-2014  Audi; S5; 2013-2015  Audi; S6; 2013-2015  Audi; S7; 2013-2015  Audi; S8; 2013-2014  Audi; S8; 2015  Audi; SQ5; 2013-2014  Audi; TT; 2013-2015  Buick; Allure; 2006  Buick; Century; 1999-2005  Buick; LeSabre; 2000-2005  Buick; Park Avenue; 1998-2005  Buick; Regal; 1999-2004  Buick; Rendezvous; 2003-2007  Chevrolet; Impala; 2000-2005  Chevrolet; Monte Carlo; 2000-2005  Honda; Accord; 2013-2016  Honda; CR-V; 2014-2015  Honda; Fit; 2015-2016  Lexus; LS430; 2004-2006  Lexus; RX330; 2004-2005  Mazda; 3; 2014-2015  Mazda; 6; 2014-2016  Mazda; CX-5; 2013-2016  Mazda; MX-5 Miata; 2016  Oldsmobile; Alero; 1999-2000  Oldsmobile; Aurora; 2001-2003  Pontiac; Aztek; 2003-2005  Pontiac; Bonneville; 2000-2005  Pontiac; Grand Am; 1999-2002  Pontiac; Grand Prix; 2004-2006  Pontiac; Vibe; 2005-2007  Toyota; Sienna; 2005  Toyota; Yaris; 2015  Volkswagen; Beetle; 2013-2014  Volkswagen; Eos; 2015  Volkswagen; Golf; 2013-2015  Volkswagen; GTI; 2013-2015  Volkswagen; Jetta; 2013-2015  Volkswagen; Passat; 2013-2015  Volkswagen; Routan; 2015  Volkswagen; Tiguan; 2014  Volkswagen; Tiguan; 2015  Volvo; XC60; 2015</p>	 <p>Ford; Expedition; 2003-2004  Ford; Expedition; 2005-2006  Ford; Explorer; 2002-2003; Exc. Sport  Ford; Explorer; 2004-2005  Ford; Freestar; 2004-2005; W/Aluminium Valve Stem  Lincoln; Aviator; 2003-2005  Lincoln; Navigator; 2003-2004  Lincoln; Navigator; 2005-2006  Mercury; Monterey; 2004-2005  Mercury; Mountaineer; 2002-2005</p>

# Numerical Listing

Service Pack 2003	Service Pack 2004
 <p>           Cadillac; DeVille; 2001-2005            Cadillac; Seville; 2001-2004            Chevrolet; Corvette; 2001-2004            Chrysler; 300M; 2002-2004; W/Schrader Sensor            Chrysler; Concorde; 2002-2004; W/Schrader Sensor            Chrysler; Crossfire; 2004; W/Schrader Sensor            Chrysler; Crossfire; 2005; exc Siemens OE Sensor; Service Pack contains cap, core, grommet, and nut            Chrysler; Crossfire; 2006-2008; W/Schrader Sensor            Chrysler; Intrepid; 2002; W/Schrader Sensor            Chrysler; Intrepid; 2003-2004; W/Schrader Sensor            Chrysler; Pacifica; 2004; W/Schrader Sensor            Chrysler; Prowler; 2001; W/Red Sensor Body            Chrysler; Prowler; 2002; W/Schrader Sensor            Chrysler; Town &amp; Country; 2002-2003            Chrysler; Voyager; 2002-2003            Dodge; Caravan; 2002-2003            Dodge; Grand Caravan; 2002-2003            Dodge; Intrepid; 2002-2004            Dodge; Viper; 2003-2006            Dodge; Viper; 2008-2010            Isuzu; Rodeo; 2004            Jeep; Grand Cherokee; 2002-2004            Jeep; Liberty; 2002-2004            Mitsubishi; Eclipse; 2006-2007; W/Alloy Wheels            Mitsubishi; Eclipse; 2008-2010            Mitsubishi; Eclipse; 2011            Mitsubishi; Eclipse; 2012            Mitsubishi; Endeavor; 2004-2005            Mitsubishi; Endeavor; 2006            Mitsubishi; Endeavor; 2007            Mitsubishi; Endeavor; 2008            Mitsubishi; Endeavor; 2010            Mitsubishi; Endeavor; 2011; W/Alloy Wheels            Mitsubishi; Galant; 2004-2006            Mitsubishi; Galant; 2007; W/Alloy Wheels            Mitsubishi; Galant; 2008-2009; W/Alloy Wheels            Mitsubishi; Galant; 2010-2012; W/Alloy Wheels            Mitsubishi; Montero; 2003-2006            Mitsubishi; Montero Sport; 2003-2004            Plymouth; Prowler; 1997; W/Red Sensor Body            Plymouth; Prowler; 1999-2001; W/Red Sensor Body         </p>	 <p>           Buick; Allure; 2007-2008; W/Schrader Sensor            Buick; Enclave; 2008; W/Schrader Sensor            Buick; LaCrosse; 2006; W/Schrader Sensor            Buick; LaCrosse; 2007-2008; W/Schrader Sensor            Buick; Rainier; 2006            Buick; Rainier; 2007            Cadillac; ATS; 2014; V            Cadillac; ATS; 2015; V            Cadillac; CTS; 2004-2007            Cadillac; CTS; 2009-2011; OEM Part No. 15268606; CTS V; W/315 MHz Sensor            Cadillac; CTS; 2012; OEM Part No. 15268606; CTS V; W/315 MHz Sensor            Cadillac; CTS; 2013; OEM Part No. 15268606; CTS V; W/315 MHz Sensor            Cadillac; CTS; 2014-2015; V            Cadillac; DTS; 2006            Cadillac; Escalade; 2004            Cadillac; Escalade; 2005-2006            Cadillac; SRX; 2004-2006            Cadillac; STS; 2005            Cadillac; STS; 2006-2008            Cadillac; XLR; 2004            Cadillac; XLR; 2005-2009            Chevrolet; Camaro; 2012; ZL1            Chevrolet; Camaro; 2013-2015; ZL1            Chevrolet; Caprice; 2011-2013            Chevrolet; Caprice; 2016            Chevrolet; Cobalt; 2008; Clamp-In Style Only; W/Aluminium Valve Stem            Chevrolet; Cobalt; 2009; Clamp-In Style Only; W/Aluminium Valve Stem            Chevrolet; Corvette; 2005-2009            Chevrolet; Corvette; 2010-2011            Chevrolet; Corvette; 2012; Z06; Base            Chevrolet; Corvette; 2013            Chevrolet; Equinox; 2007-2009; W/Schrader Sensor            Chevrolet; Express; 2008-2009; W/Schrader Sensor            Chevrolet; HHR; 2008-2009; Clamp-In Style Only; W/Aluminium Valve Stem            Chevrolet; Impala; 2006; W/Alloy Wheels            Chevrolet; Impala; 2007; Clamp-In Style Only; W/Aluminium Valve Stem            Chevrolet; Malibu; 2008; Clamp-In Style Only; W/Aluminium Valve Stem            Chevrolet; Monte Carlo; 2006; W/Alloy Wheels            Chevrolet; Monte Carlo; 2007; Clamp-In Style Only; W/Aluminium Valve Stem            Chevrolet; Silverado Series; 2004            Chevrolet; Silverado Series; 2005-2006            Chevrolet; Silverado Series; 2007; Classic            Chevrolet; SS; 2014-2016            Chevrolet; SSR; 2006            Chevrolet; Suburban; 2004            Chevrolet; Suburban; 2005-2006            Chevrolet; Tahoe; 2004            Chevrolet; Tahoe; 2005-2006            Chevrolet; Trailblazer; 2006-2009            Chevrolet; Uplander; 2008-2009            GMC; Acadia; 2007-2008; W/Schrader Sensor            GMC; Envoy; 2006            GMC; Envoy; 2007-2009            GMC; Savana Series; 2008-2009; W/Schrader Sensor            GMC; Sierra Series; 2004            GMC; Sierra Series; 2005-2006            GMC; Sierra Series; 2007; Classic            GMC; Yukon; 2004            GMC; Yukon; 2005-2006            Isuzu; Ascender; 2006-2008         </p>

# Numerical Listing

Pontiac; G Series; 2008; W/Schrader Sensor  
 Pontiac; Grand Prix; 2007; W/Schrader Sensor  
 Pontiac; Grand Prix; 2008; Clamp-In Style Only; W/Aluminium Valve Stem  
 Pontiac; Montana; 2008; W/Schrader Sensor  
 Pontiac; Solstice; 2008-2009; W/Schrader Sensor  
 Pontiac; Torrent; 2007-2009; W/Schrader Sensor  
 Saab; 9-7x; 2005-2009  
 Saturn; Aura; 2007; W/Schrader Sensor  
 Saturn; Outlook; 2007-2008; W/Schrader Sensor  
 Saturn; Sky; 2008-2010; W/Schrader Sensor  
 Suzuki; XL-7; 2007-2009; W/Schrader Sensor

## 2005



Infiniti; QX56; 2004  
 Infiniti; QX56; 2005-2006; W/Steel Wheels  
 Nissan; Armada; 2005-2006; W/Steel Wheels  
 Nissan; Frontier; 2005-2007; W/Steel Wheels  
 Nissan; Pathfinder; 2004; Armada  
 Nissan; Pathfinder; 2004; Exc. Armada; Aug. & Newer  
 Nissan; Quest; 2004  
 Nissan; Quest; 2005-2006; W/Steel Wheels  
 Nissan; Titan; 2004  
 Nissan; Titan; 2005; Mar. & Older  
 Nissan; Xterra; 2006; Submodel X

## 2006



Chevrolet; Colorado; 2007-2012  
 GMC; Canyon; 2007-2012  
 Hummer; H3; 2006-2010  
 Hummer; H3T; 2009-2010  
 Isuzu; i-290; 2007-2008  
 Isuzu; i-370; 2007-2008  
 Pontiac; Montana; 2009

## Service Pack

### 2007



Infiniti; FX35; 2003-2006  
 Infiniti; FX35; 2007; Jun. & Older  
 Infiniti; FX45; 2003-2006  
 Infiniti; FX45; 2007; Jun. & Older  
 Infiniti; G35; 2003; Jun. & Newer  
 Infiniti; G35; 2004-2006  
 Infiniti; M35; 2006-2007  
 Infiniti; M45; 2003-2004  
 Infiniti; M45; 2006-2007  
 Infiniti; Q45; 2002  
 Infiniti; Q45; 2003-2005  
 Infiniti; Q45; 2006; Jul. & Older  
 Infiniti; QX4; 2003  
 Infiniti; QX56; 2005-2006; W/Alloy Wheels  
 Infiniti; QX56; 2007; Mar. & Older  
 Nissan; 350Z; 2003-2006  
 Nissan; Armada; 2005-2006; W/Alloy Wheels  
 Nissan; Armada; 2007  
 Nissan; Armada; 2008; SE  
 Nissan; Frontier; 2003-2004  
 Nissan; Frontier; 2005-2007; W/Alloy Wheels  
 Nissan; Frontier; 2008; W/Alloy Wheels  
 Nissan; Maxima; 2006; Jun. & Newer  
 Nissan; Maxima; 2007; Mar. & Older  
 Nissan; Murano; 2003-2006  
 Nissan; Pathfinder; 2003  
 Nissan; Pathfinder; 2004; Exc. Armada; Jul. & Older  
 Nissan; Pathfinder; 2005-2006  
 Nissan; Quest; 2005-2006; W/Alloy Wheels  
 Nissan; Sentra; 2007; W/Alloy Wheels  
 Nissan; Titan; 2005; Apr. 1 & Newer  
 Nissan; Titan; 2006  
 Nissan; Titan; 2007; Mar. & Older  
 Nissan; Xterra; 2003-2004  
 Nissan; Xterra; 2005  
 Nissan; Xterra; 2006; Exc. Submodel X

# Numerical Listing

## Service Pack

20008



Buick; Allure; 2009  
 Buick; Allure; 2010  
 Buick; Enclave; 2009-2015  
 Buick; Enclave; 2016  
 Buick; Encore; 2013-2015  
 Buick; Encore; 2016  
 Buick; LaCrosse; 2009  
 Buick; LaCrosse; 2010-2015  
 Buick; LaCrosse; 2016  
 Buick; Lucerne; 2007-2011  
 Buick; Regal; 2011-2016  
 Buick; Verano; 2012-2015  
 Buick; Verano; 2016  
 Cadillac; ATS; 2013; exc V  
 Cadillac; ATS; 2014; exc V  
 Cadillac; ATS; 2015; exc V  
 Cadillac; ATS; 2016; exc V  
 Cadillac; CTS; 2008  
 Cadillac; CTS; 2009-2011; OEM Part No. 25920615; Exc. CTS V  
 Cadillac; CTS; 2012; OEM Part No. 25920615; Exc. CTS V  
 Cadillac; CTS; 2013; OEM Part No. 25920615; Exc. CTS V  
 Cadillac; CTS; 2014-2015; exc V  
 Cadillac; CTS; 2016; exc V  
 Cadillac; DTS; 2007-2011  
 Cadillac; ELR; 2014  
 Cadillac; ELR; 2015  
 Cadillac; ELR; 2016  
 Cadillac; Escalade; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem  
 Cadillac; Escalade; 2008  
 Cadillac; Escalade; 2009-2011  
 Cadillac; Escalade; 2012-2013  
 Cadillac; Escalade; 2014-2015  
 Cadillac; Escalade; 2016  
 Cadillac; SRX; 2007-2009  
 Cadillac; SRX; 2010-2015  
 Cadillac; STS; 2009; OEM Part No. 25920615; Exc. STS V  
 Cadillac; STS; 2010  
 Cadillac; STS; 2011  
 Cadillac; XTS; 2013-2015  
 Cadillac; XTS; 2016  
 Chevrolet; Avalanche; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem  
 Chevrolet; Avalanche; 2008  
 Chevrolet; Avalanche; 2009-2013  
 Chevrolet; Aveo; 2007  
 Chevrolet; Aveo; 2008-2011  
 Chevrolet; Aveo5; 2007  
 Chevrolet; Aveo5; 2008-2011  
 Chevrolet; Camaro; 2010-2011  
 Chevrolet; Camaro; 2012; Exc. ZL1  
 Chevrolet; Camaro; 2013-2015; Exc. ZL1  
 Chevrolet; Camaro; 2016; Exc. ZL1  
 Chevrolet; Captiva Sport; 2012-2013  
 Chevrolet; Cobalt; 2008; Snap-In Style Only; W/Rubber Valve Stem  
 Chevrolet; Cobalt; 2009; Snap-In Style Only; W/Rubber Valve Stem  
 Chevrolet; Cobalt; 2010  
 Chevrolet; Colorado; 2015  
 Chevrolet; Colorado; 2016  
 Chevrolet; Cruze; 2011-2015

Chevrolet; Cruze; 2016  
 Chevrolet; Equinox; 2010-2014  
 Chevrolet; Equinox; 2015  
 Chevrolet; Equinox; 2016  
 Chevrolet; Express; 2010-2015  
 Chevrolet; Express; 2016  
 Chevrolet; HHR; 2008-2009; Snap-In Style Only; W/Rubber Valve Stem  
 Chevrolet; HHR; 2010  
 Chevrolet; HHR; 2011  
 Chevrolet; Impala; 2007; Snap-In Style Only; W/Rubber Valve Stem  
 Chevrolet; Impala; 2008-2013  
 Chevrolet; Impala; 2014-2015  
 Chevrolet; Impala; 2016  
 Chevrolet; Malibu; 2008; Snap-In Style Only; W/Rubber Valve Stem  
 Chevrolet; Malibu; 2009  
 Chevrolet; Malibu; 2010  
 Chevrolet; Malibu; 2011-2012  
 Chevrolet; Malibu; 2013-2015  
 Chevrolet; Malibu; 2016  
 Chevrolet; Monte Carlo; 2007; Snap-In Style Only; W/Rubber Valve Stem  
 Chevrolet; Orlando; 2012-2014  
 Chevrolet; Silverado Series; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic  
 Chevrolet; Silverado Series; 2008-2013; W/Single Rear Wheels  
 Chevrolet; Silverado Series; 2014-2015; W/Single Rear Wheels  
 Chevrolet; Silverado Series; 2016; W/Single Rear Wheels  
 Chevrolet; Sonic; 2012-2015  
 Chevrolet; Sonic; 2016  
 Chevrolet; Spark; 2013-2015  
 Chevrolet; Spark; 2016  
 Chevrolet; Suburban; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem  
 Chevrolet; Suburban; 2008-2014  
 Chevrolet; Suburban; 2015  
 Chevrolet; Suburban; 2016  
 Chevrolet; Tahoe; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem  
 Chevrolet; Tahoe; 2008-2013  
 Chevrolet; Tahoe; 2014-2015  
 Chevrolet; Tahoe; 2016  
 Chevrolet; Traverse; 2009-2015  
 Chevrolet; Traverse; 2016  
 Chevrolet; Trax; 2013-2015  
 Chevrolet; Volt; 2011-2015  
 Chevrolet; Volt; 2016  
 GMC; Acadia; 2009-2015  
 GMC; Acadia; 2016  
 GMC; Canyon; 2015  
 GMC; Canyon; 2016  
 GMC; Savana Series; 2010-2015  
 GMC; Savana Series; 2016  
 GMC; Sierra Series; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic  
 GMC; Sierra Series; 2008-2013; W/Single Rear Wheels  
 GMC; Sierra Series; 2014; W/Single Rear Wheels  
 GMC; Sierra Series; 2015  
 GMC; Sierra Series; 2015; W/Single Rear Wheels  
 GMC; Sierra Series; 2016  
 GMC; Sierra Series; 2016; W/Single Rear Wheels  
 GMC; Terrain; 2010-2014  
 GMC; Terrain; 2015; Rubber Valve  
 GMC; Terrain; 2016; Rubber Valve  
 GMC; Yukon; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem  
 GMC; Yukon; 2008-2013  
 GMC; Yukon; 2014-2015  
 GMC; Yukon; 2016  
 Hummer; H2; 2008-2009  
 Hyundai; Veloster; 2012-2015  
 Pontiac; G Series; 2008  
 Pontiac; G Series; 2009-2010  
 Pontiac; Grand Prix; 2008; Snap-In Style Only; W/Rubber Valve Stem  
 Pontiac; Wave; 2008  
 Saab; 9-4X; 2011  
 Saturn; Aura; 2008-2009  
 Saturn; Outlook; 2009-2010

# Numerical Listing

Saturn; Vue; 2007-2010  
 Subaru; Forester; 2008-2015  
 Subaru; Forester; 2016  
 Subaru; Impreza; 2008-2015  
 Subaru; Impreza; 2016  
 Subaru; Legacy; 2008; W/18" Wheels  
 Subaru; Legacy; 2009-2015  
 Subaru; Legacy; 2016  
 Subaru; Outback; 2008-2015  
 Subaru; Outback; 2016  
 Subaru; Tribeca; 2008  
 Subaru; Tribeca; 2009; Rubber Valve  
 Subaru; Tribeca; 2010  
 Subaru; Tribeca; 2011; Rubber Valve  
 Subaru; Tribeca; 2012-2014  
 Subaru; WRX; 2013-2015  
 Subaru; WRX; 2016  
 Subaru; XV Crosstrek; 2013-2015  
 Subaru; XV Crosstrek; 2016  
 Suzuki; Forenza; 2007-2008  
 Suzuki; Reno; 2007-2008  
 Volvo; XC90; 2012-2015

## 20009



Lotus; Elise; 2008  
 Lotus; Elise; 2009  
 Lotus; Elise; 2010-2015  
 Lotus; Evora; 2010  
 Lotus; Evora; 2011-2013  
 Lotus; Evora; 2014  
 Lotus; Evora; 2015  
 Lotus; Exige; 2008-2015  
 Porsche; 911; 2012  
 Saab; 9-3; 2003-2007  
 Saab; 9-3; 2008-2011  
 Saab; 9-3X; 2010-2011  
 Saab; 9-5; 2003-2007  
 Saab; 9-5; 2008-2011  
 Saturn; Astra; 2008-2009  
 Suzuki; Grand Vitara; 2007-2013  
 Suzuki; SX4; 2007-2013  
 Suzuki; SX4 Crossover; 2012  
 Suzuki; Verona; 2005-2006  
 Suzuki; XL-7; 2005-2006

## Service Pack

### 20010



Mitsubishi; Eclipse; 2006-2007; W/Steel Wheels  
 Mitsubishi; Endeavor; 2011; W/Steel Wheels  
 Mitsubishi; Galant; 2007; W/Steel Wheels  
 Mitsubishi; Galant; 2008-2009; W/Steel Wheels  
 Mitsubishi; Galant; 2010-2012; W/Steel Wheels  
 Volvo; S60,S80; 2004  
 Volvo; S60,S80; 2004; W/315 MHz Sensor  
 Volvo; S60,S80; 2005  
 Volvo; S60,S80; 2005; W/315 MHz Sensor  
 Volvo; S60,S80; 2006-2009  
 Volvo; V70; 2004-2007; W/315 MHz Sensor  
 Volvo; XC70; 2004-2007; W/315 MHz Sensor  
 Volvo; XC90; 2004  
 Volvo; XC90; 2005-2007; W/315 MHz Sensor  
 Volvo; XC90; 2008-2011

### 20011



Subaru; B9 Tribeca; 2006-2007  
 Subaru; Legacy; 2004-2007  
 Subaru; Legacy; 2008; W/16" Or 17" Wheels  
 Subaru; Outback; 2004-2007  
 Subaru; Tribeca; 2008; W/Metal Stem Clamp-in Sensor  
 Subaru; Tribeca; 2009; W/Metal Stem Clamp-in Sensor  
 Subaru; Tribeca; 2010; W/Metal Stem Clamp-in Sensor  
 Subaru; Tribeca; 2011; W/Metal Stem Clamp-in Sensor

### 20012



Chevrolet; Corvette; 1997-2000  
 Chrysler; Prowler; 2001; W/Black Sensor Body  
 Plymouth; Prowler; 1997; W/Black Sensor Body  
 Plymouth; Prowler; 1999-2001; W/Black Sensor Body

# Numerical Listing

## Service Pack

2013



Chrysler; 200; 2011; Fits Schrader Alum stem sensor. Does not include stem.  
Chrysler; 200; 2012; Fits Schrader Alum stem sensor. Does not include stem.  
Chrysler; 300; 2005-2006; Fits Schrader Alum stem sensor. Does not include stem.  
Chrysler; 300; 2007; Fits Schrader Alum stem sensor. Does not include stem.  
Chrysler; 300; 2008; Fits Schrader Alum stem sensor. Does not include stem.  
Chrysler; Aspen; 2007-2011; Fits Schrader Alum stem sensor. Does not include stem.  
Chrysler; Crossfire; 2005; Fits Schrader Alum stem sensor. Does not include stem.  
Chrysler; Pacifica; 2006-2007; Fits Schrader Alum stem sensor. Does not include stem.  
Chrysler; Pacifica; 2008; Fits Schrader Alum stem sensor. Does not include stem.  
Chrysler; PT Cruiser; 2008-2010; Fits Schrader Alum stem sensor. Does not include stem.  
Chrysler; Sebring; 2007-2009; Fits Schrader Alum stem sensor. Does not include stem.  
Chrysler; Sebring; 2010; Fits Schrader Alum stem sensor. Does not include stem.  
Chrysler; Town & Country; 2006-2007; Fits Schrader Alum stem sensor. Does not include stem.  
Chrysler; Town & Country; 2008; Fits Schrader Alum stem sensor. Does not include stem.  
Chrysler; Town & Country; 2009-2010; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Avenger; 2008-2009; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Avenger; 2010-2012; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Caliber; 2007-2010; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Caliber; 2011-2012; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Caravan; 2006-2007; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Charger; 2006-2007; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Charger; 2008; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Dakota; 2008-2010; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Durango; 2007; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Durango; 2008; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Durango; 2009; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Grand Caravan; 2006-2007; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Grand Caravan; 2008; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Grand Caravan; 2009-2010; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Journey; 2009; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Journey; 2010; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Magnum; 2005-2007; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Magnum; 2008; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Nitro; 2007-2008; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Nitro; 2009-2011; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Ram Series; 2008; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Ram Series; 2009; Fits Schrader Alum stem sensor. Does not include stem.  
Dodge; Ram Series; 2010; Fits Schrader Alum stem sensor. Does not include stem.  
Jeep; Commander; 2006-2007; Fits Schrader Alum stem sensor. Does not include stem.  
Jeep; Commander; 2008-2010; Fits Schrader Alum stem sensor. Does not include stem.

Jeep; Compass; 2007-2010; Fits Schrader Alum stem sensor. Does not include stem.  
Jeep; Compass; 2011; Fits Schrader Alum stem sensor. Does not include stem.  
Jeep; Grand Cherokee; 2005-2007; Fits Schrader Alum stem sensor. Does not include stem.  
Jeep; Grand Cherokee; 2008-2010; Fits Schrader Alum stem sensor. Does not include stem.  
Jeep; Liberty; 2005-2008; Fits Schrader Alum stem sensor. Does not include stem.  
Jeep; Liberty; 2009; Fits Schrader Alum stem sensor. Does not include stem.  
Jeep; Liberty; 2010-2012; Fits Schrader Alum stem sensor. Does not include stem.  
Jeep; Patriot; 2007-2010; Fits Schrader Alum stem sensor. Does not include stem.  
Jeep; Patriot; 2011-2012; Fits Schrader Alum stem sensor. Does not include stem.  
Jeep; Wrangler; 2007-2008; Fits Schrader Alum stem sensor. Does not include stem.  
Jeep; Wrangler; 2009; Fits Schrader Alum stem sensor. Does not include stem.  
Jeep; Wrangler; 2010; Fits Schrader Alum stem sensor. Does not include stem.  
Jeep; Wrangler; 2011; Fits Schrader Alum stem sensor. Does not include stem.  
Mitsubishi; Raider; 2008-2009; Fits Schrader Alum stem sensor. Does not include stem.  
Suzuki; Kizashi; 2010-2012; Fits Schrader Alum stem sensor. Does not include stem.



# Numerical Listing

## Service Pack

### 20014



Infiniti; EX35; 2008-2010  
 Infiniti; FX35; 2007; Jul. & Newer  
 Infiniti; FX35; 2008  
 Infiniti; FX35; 2009-2010  
 Infiniti; FX45; 2007; Jul. & Newer  
 Infiniti; FX45; 2008  
 Infiniti; FX50; 2009-2010  
 Infiniti; G35; 2007  
 Infiniti; G35; 2008  
 Infiniti; G37; 2008-2010  
 Infiniti; M35; 2008-2010  
 Infiniti; M35h; 2012  
 Infiniti; M37; 2011-2012  
 Infiniti; M45; 2008-2009  
 Infiniti; M45; 2010  
 Infiniti; M56; 2011-2012  
 Infiniti; Q45; 2006; Aug. & Newer  
 Infiniti; QX56; 2007; Apr. 1 & Newer  
 Infiniti; QX56; 2008-2010  
 Nissan; 350Z; 2007-2009  
 Nissan; 370Z; 2009-2010  
 Nissan; Altima; 2006; Oct. 1 & Newer  
 Nissan; Altima; 2007-2010  
 Nissan; Altima; 2011-2012  
 Nissan; Armada; 2008; LE  
 Nissan; Armada; 2009-2011  
 Nissan; Armada; 2012-2015  
 Nissan; Armada; 2016  
 Nissan; Cube; 2009-2010  
 Nissan; Cube; 2011-2012; non-Ikey  
 Nissan; Frontier; 2008; W/Steel Wheels  
 Nissan; Frontier; 2009-2011  
 Nissan; Frontier; 2012-2015  
 Nissan; Frontier; 2016  
 Nissan; GT-R; 2009  
 Nissan; GT-R; 2010  
 Nissan; GT-R; 2011-2016  
 Nissan; Juke; 2011  
 Nissan; Juke; 2012  
 Nissan; Maxima; 2007; Apr. 1 & Newer  
 Nissan; Maxima; 2008-2010  
 Nissan; Maxima; 2011-2012  
 Nissan; Murano; 2007  
 Nissan; Murano; 2009  
 Nissan; Murano; 2010  
 Nissan; Murano; 2011  
 Nissan; Murano; 2012-2014  
 Nissan; NV; 2012  
 Nissan; NV; 2013-2015  
 Nissan; NV; 2016  
 Nissan; Pathfinder; 2007  
 Nissan; Pathfinder; 2008-2011  
 Nissan; Pathfinder; 2012  
 Nissan; Quest; 2007-2009  
 Nissan; Rogue; 2008-2009  
 Nissan; Rogue; 2011  
 Nissan; Rogue; 2012  
 Nissan; Sentra; 2007; W/Steel Wheels  
 Nissan; Sentra; 2008  
 Nissan; Sentra; 2009-2010

Nissan; Sentra; 2011-2013  
 Nissan; Titan; 2007; Apr. 1 & Newer  
 Nissan; Titan; 2008-2011  
 Nissan; Titan; 2012-2015  
 Nissan; Versa; 2007  
 Nissan; Versa; 2008-2010  
 Nissan; Versa; 2011-2012  
 Nissan; Xterra; 2007  
 Nissan; Xterra; 2008-2011  
 Nissan; Xterra; 2012-2015  
 Nissan; Xterra; 2016  
 Suzuki; Equator; 2009-2012

### 20015



Cadillac; Escalade; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem  
 Chevrolet; Avalanche; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem  
 Chevrolet; Silverado Series; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic  
 Chevrolet; Suburban; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem  
 Chevrolet; Tahoe; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem  
 GMC; Sierra Series; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic  
 GMC; Yukon; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem

# Numerical Listing

## Service Pack

### 2016



Chrysler; 300; 2009-2010; Does Not Include Stem  
 Chrysler; 300; 2012; W/Metal Stem Clamp-in Sensor; Does Not Include Stem  
 Dodge; Challenger; 2008; Does Not Include Stem  
 Dodge; Challenger; 2009; Does Not Include Stem  
 Dodge; Challenger; 2010-2012; W/Metal Stem Clamp-in Sensor; Does Not Include Stem  
 Dodge; Charger; 2009; Does Not Include Stem  
 Dodge; Charger; 2010; W/Metal Stem Clamp-in Sensor; Does Not Include Stem  
 Dodge; Viper; 2012-2013; W/Metal Stem Clamp-in Sensor; Does Not Include Stem  
 Dodge; Viper; 2014-2015; W/Metal Stem Clamp-in Sensor; Does Not Include Stem  
 Dodge; Viper; 2016; W/Metal Stem Clamp-in Sensor; Does Not Include Stem  
 Mercedes-Benz; 550,63AMG; 2007-2009; Does Not Include Stem  
 Mercedes-Benz; C Series; 2007; Jun. & Newer; Does Not Include Stem  
 Mercedes-Benz; C Series; 2008-2009; Does Not Include Stem  
 Mercedes-Benz; C Series; 2010-2012; Does Not Include Stem  
 Mercedes-Benz; C Series; 2013; W/O Valve  
 Mercedes-Benz; C250; 2012; Does Not Include Stem  
 Mercedes-Benz; C250; 2013; W/O Valve  
 Mercedes-Benz; C280; 2007; Mar. & Newer; Does Not Include Stem  
 Mercedes-Benz; CLK; 2006; Does Not Include Stem  
 Mercedes-Benz; CLK350; 2006-2009; Does Not Include Stem  
 Mercedes-Benz; CLS550; 2012; Does Not Include Stem  
 Mercedes-Benz; CLS550; 2013; W/O Valve  
 Mercedes-Benz; E350; 2010-2012; Does Not Include Stem  
 Mercedes-Benz; E350; 2013; W/O Valve  
 Mercedes-Benz; E550; 2010-2011; Does Not Include Stem  
 Mercedes-Benz; E550; 2012-2013; W/O Valve  
 Mercedes-Benz; E63 AMG; 2010-2011; Does Not Include Stem  
 Mercedes-Benz; E63 AMG; 2012-2013; W/O Valve  
 Mercedes-Benz; G500; 2007; Mar. & Newer; Does Not Include Stem  
 Mercedes-Benz; G500; 2008; Does Not Include Stem  
 Mercedes-Benz; G55 AMG; 2007; Mar. & Newer; Does Not Include Stem  
 Mercedes-Benz; G55 AMG; 2008-2010; Does Not Include Stem  
 Mercedes-Benz; G55 AMG; 2011; Mar. & Newer; Does Not Include Stem  
 Mercedes-Benz; G550; 2009-2010; Does Not Include Stem  
 Mercedes-Benz; G550; 2011; Mar. & Newer; Does Not Include Stem  
 Mercedes-Benz; G550; 2012-2013; W/O Valve  
 Mercedes-Benz; GL; 2010; Does Not Include Stem  
 Mercedes-Benz; GL; 2011; Mar. & Newer; Does Not Include Stem  
 Mercedes-Benz; GL; 2012-2013; W/O Valve  
 Mercedes-Benz; GL350; 2010; Does Not Include Stem  
 Mercedes-Benz; GL350; 2011; Mar. & Newer; Does Not Include Stem  
 Mercedes-Benz; GL350; 2012-2013; W/O Valve  
 Mercedes-Benz; GL63 AMG; 2013; W/O Valve  
 Mercedes-Benz; GLK350; 2010; Does Not Include Stem  
 Mercedes-Benz; GLK350; 2011; Mar. & Newer; Does Not Include Stem  
 Mercedes-Benz; GLK350; 2012; Does Not Include Stem  
 Mercedes-Benz; GLK350; 2013; W/O Valve  
 Mercedes-Benz; ML350; 2010; Does Not Include Stem  
 Mercedes-Benz; ML350; 2011; Mar. & Newer; Does Not Include Stem  
 Mercedes-Benz; ML350; 2012; Does Not Include Stem  
 Mercedes-Benz; ML350; 2013; W/O Valve  
 Mercedes-Benz; ML450; 2010; Does Not Include Stem  
 Mercedes-Benz; ML450; 2011; Mar. & Newer; Does Not Include Stem  
 Mercedes-Benz; ML550; 2010; Does Not Include Stem  
 Mercedes-Benz; ML550; 2011-2012; Mar. & Newer; Does Not Include Stem  
 Mercedes-Benz; ML63 AMG; 2010; Does Not Include Stem  
 Mercedes-Benz; ML63 AMG; 2011; Mar. & Newer; Does Not Include Stem  
 Mercedes-Benz; ML63 AMG; 2012-2013; W/O Valve  
 Mercedes-Benz; R350; 2010; Does Not Include Stem

Mercedes-Benz; R350; 2011; Mar. & Newer; Does Not Include Stem  
 Mercedes-Benz; R350; 2012; Does Not Include Stem  
 Mercedes-Benz; R350; 2013; W/O Valve  
 Mercedes-Benz; S Series; 2011; Does Not Include Stem  
 Mercedes-Benz; S Series; 2012; W/O Valve  
 Mercedes-Benz; S Series; 2013; W/O Valve  
 Mercedes-Benz; S550; 2011; Does Not Include Stem  
 Mercedes-Benz; S550; 2012-2013; W/O Valve  
 Mercedes-Benz; S600; 2011; Does Not Include Stem  
 Mercedes-Benz; S600; 2012-2013; W/O Valve  
 Mercedes-Benz; S63 AMG; 2011; Does Not Include Stem  
 Mercedes-Benz; S63 AMG; 2012-2013; W/O Valve  
 Mercedes-Benz; S65 AMG; 2011; Does Not Include Stem  
 Mercedes-Benz; S65 AMG; 2012-2013; W/O Valve  
 Mercedes-Benz; SL550; 2012; Does Not Include Stem  
 Mercedes-Benz; SL550; 2013; W/O Valve  
 Mercedes-Benz; SL63 AMG; 2012; Does Not Include Stem  
 Mercedes-Benz; SL63 AMG; 2013; W/O Valve  
 Mercedes-Benz; SLK250; 2012; Does Not Include Stem  
 Mercedes-Benz; SLK250; 2013; W/O Valve  
 Mercedes-Benz; SLK280; 2007; May & Newer; Does Not Include Stem  
 Mercedes-Benz; SLK280; 2008; Does Not Include Stem  
 Mercedes-Benz; SLK300; 2009-2011; Does Not Include Stem  
 Mercedes-Benz; SLK350; 2007; May & Newer; Does Not Include Stem  
 Mercedes-Benz; SLK350; 2008-2012; Does Not Include Stem  
 Mercedes-Benz; SLK350; 2013; W/O Valve  
 Mercedes-Benz; SLK55 AMG; 2007; May & Newer; Does Not Include Stem  
 Mercedes-Benz; SLK55 AMG; 2008-2010; Does Not Include Stem  
 Mercedes-Benz; SLS AMG; 2011-2012; Does Not Include Stem  
 Mercedes-Benz; SLS AMG; 2013; W/O Valve  
 Mercedes-Benz; Sprinter 2500; 2014-2016  
 Mercedes-Benz; Sprinter 3500; 2014-2016  
 Smart; Fortwo; 2008-2012; Does Not Include Stem  
 Smart; Fortwo; 2013; W/O Valve

### 2017



Audi; A3, A4,A5 & Quattro; 2008  
 Audi; A3, A4,A5 & Quattro; 2009-2012  
 Audi; Q5; 2009-2012  
 Audi; S4; 2010-2011  
 Audi; S5; 2008-2012  
 Audi; TT; 2008-2009  
 Audi; TT Quattro; 2008-2009  
 Volkswagen; Beetle; 2008-2010  
 Volkswagen; CC; 2009-2011  
 Volkswagen; CC; 2012-2014  
 Volkswagen; Eos; 2007-2014  
 Volkswagen; Golf; 2006  
 Volkswagen; Golf; 2010  
 Volkswagen; GTI; 2006-2007; W/16" Or 17" Wheels  
 Volkswagen; GTI; 2008-2010  
 Volkswagen; Jetta; 2006-2007  
 Volkswagen; Jetta; 2008-2009  
 Volkswagen; Jetta; 2010  
 Volkswagen; Passat; 2006-2008; W/16" Or 17" Wheels  
 Volkswagen; Passat; 2009-2010  
 Volkswagen; R32; 2008  
 Volkswagen; Rabbit; 2006-2007; W/15" Wheels  
 Volkswagen; Rabbit; 2008-2009  
 Volkswagen; Tiguan; 2009-2011  
 Volkswagen; Tiguan; 2012

# Numerical Listing

## Service Pack

2018



Chevrolet; Trax; 2016; Rubber Valve  
 Chrysler; 200; 2011; Rubber Valve  
 Chrysler; 200; 2012; Rubber Valve  
 Chrysler; 200; 2013-2014; Rubber Valve  
 Chrysler; 300; 2005-2006; Rubber Valve  
 Chrysler; 300; 2007; Rubber Valve  
 Chrysler; 300; 2008; Rubber Valve  
 Chrysler; 300; 2009-2010; Rubber Valve  
 Chrysler; 300; 2011; Rubber Valve  
 Chrysler; 300; 2012; Rubber Valve  
 Chrysler; 300; 2012; W/Rubber Stem Snap-in Sensor  
 Chrysler; 300; 2013-2015; Rubber Valve  
 Chrysler; 300; 2016; Rubber Valve  
 Chrysler; Aspen; 2007-2011; Rubber Valve  
 Chrysler; Crossfire; 2005; Rubber Valve  
 Chrysler; Pacifica; 2006-2007; Rubber Valve  
 Chrysler; Pacifica; 2008; Rubber Valve  
 Chrysler; PT Cruiser; 2008-2010; Rubber Valve  
 Chrysler; Sebring; 2007-2009; Rubber Valve  
 Chrysler; Sebring; 2010; Rubber Valve  
 Chrysler; Town & Country; 2006-2007; Rubber Valve  
 Chrysler; Town & Country; 2008; Rubber Valve  
 Chrysler; Town & Country; 2009-2010; Rubber Valve  
 Chrysler; Town & Country; 2011-2014; Rubber Valve  
 Chrysler; Town & Country; 2015; Rubber Valve  
 Chrysler; Town & Country; 2016; Rubber Valve  
 Dodge; Avenger; 2008-2009; Rubber Valve  
 Dodge; Avenger; 2010-2012; Rubber Valve  
 Dodge; Avenger; 2013-2014; Rubber Valve  
 Dodge; Caliber; 2007-2010; Rubber Valve  
 Dodge; Caliber; 2011-2012; Rubber Valve  
 Dodge; Caravan; 2006-2007; Rubber Valve  
 Dodge; Challenger; 2008; Rubber Valve  
 Dodge; Challenger; 2010-2012; Rubber Valve  
 Dodge; Challenger; 2013-2015; W/Rubber Stem Snap-in Sensor  
 Dodge; Challenger; 2016; W/Rubber Stem Snap-in Sensor  
 Dodge; Charger; 2006-2007; Rubber Valve  
 Dodge; Charger; 2008; Rubber Valve  
 Dodge; Charger; 2010; Rubber Valve  
 Dodge; Charger; 2011; Rubber Valve  
 Dodge; Charger; 2012-2015; Rubber Valve  
 Dodge; Charger; 2016; Rubber Valve  
 Dodge; Dakota; 2008-2010; Rubber Valve  
 Dodge; Durango; 2007; Rubber Valve  
 Dodge; Durango; 2008; Rubber Valve  
 Dodge; Durango; 2009; Rubber Valve  
 Dodge; Durango; 2011-2015; Rubber Valve  
 Dodge; Grand Caravan; 2006-2007; Rubber Valve  
 Dodge; Grand Caravan; 2008; Rubber Valve  
 Dodge; Grand Caravan; 2009-2010; Rubber Valve  
 Dodge; Grand Caravan; 2011-2015; Rubber Valve  
 Dodge; Grand Caravan; 2016; Rubber Valve  
 Dodge; Journey; 2009; Rubber Valve  
 Dodge; Journey; 2010; Rubber Valve  
 Dodge; Journey; 2011-2015; Rubber Valve  
 Dodge; Journey; 2016; Rubber Valve  
 Dodge; Magnum; 2005-2007; Rubber Valve  
 Dodge; Magnum; 2008; Rubber Valve  
 Dodge; Magnum; 2009-2011; Rubber Valve  
 Dodge; Nitro; 2007-2008; Rubber Valve

Dodge; Nitro; 2009-2011; Rubber Valve  
 Dodge; Ram 4500; 2010; W/Rubber Stem Snap-in Sensor  
 Dodge; Ram 5500; 2010; W/Rubber Stem Snap-in Sensor  
 Dodge; Ram Series; 2008; Rubber Valve  
 Dodge; Ram Series; 2009; Rubber Valve  
 Dodge; Ram Series; 2010; Rubber Valve  
 Dodge; Ram Series; 2010; W/Rubber Stem Snap-in Sensor  
 Dodge; Ram Series; 2011-2013; Rubber Valve  
 Fiat; 500; 2012-2015; Rubber Valve  
 Fiat; 500; 2016; Rubber Valve  
 Ford; C-Max; 2012-2015; Rubber Valve  
 Ford; C-Max; 2016; Rubber Valve  
 Ford; Edge; 2011-2014; Rubber Valve  
 Ford; Edge; 2015-2016; Rubber Valve  
 Ford; Escape; 2009-2010; Rubber Valve  
 Ford; Escape; 2012-2015; Rubber Valve  
 Ford; Escape; 2016; Rubber Valve  
 Ford; E-Series Van; 2010; Rubber Valve  
 Ford; E-Series Van; 2010; W/Steel Wheels  
 Ford; E-Series Van; 2011-2013; Rubber Valve  
 Ford; E-Series Van; 2014-2015; Rubber Valve  
 Ford; E-Series Van; 2016; Rubber Valve  
 Ford; Expedition; 2011-2015; Rubber Valve  
 Ford; Expedition; 2016; Rubber Valve  
 Ford; Explorer; 2011-2014; Rubber Valve  
 Ford; Explorer; 2015; Rubber Valve  
 Ford; Explorer; 2016; Rubber Valve  
 Ford; F-150; 2009-2014; Rubber Valve  
 Ford; F-150; 2015-2016; Rubber Valve  
 Ford; F-250 Super Duty; 2011-2015; Rubber Valve  
 Ford; F-250 Super Duty; 2016; Rubber Valve  
 Ford; F-350 Super Duty; 2011-2015; Rubber Valve  
 Ford; F-350 Super Duty; 2016; Rubber Valve  
 Ford; Fiesta; 2011-2015; Rubber Valve  
 Ford; Fiesta; 2016; Rubber Valve  
 Ford; Flex; 2011-2015; Rubber Valve  
 Ford; Flex; 2016; Rubber Valve  
 Ford; Focus; 2010; Rubber Valve  
 Ford; Focus; 2011; Rubber Valve  
 Ford; Focus; 2012-2015; Rubber Valve  
 Ford; Focus; 2016; Rubber Valve  
 Ford; Fusion; 2010-2015; Rubber Valve  
 Ford; Fusion; 2016; Rubber Valve  
 Ford; Mustang; 2010-2011; Rubber Valve  
 Ford; Mustang; 2012; exc Shelby GT500  
 Ford; Mustang; 2013; exc Shelby GT500  
 Ford; Mustang; 2014; exc Shelby GT500  
 Ford; Mustang; 2015-2016; Rubber Valve  
 Ford; Taurus; 2010; May & Newer  
 Ford; Taurus; 2011-2015; Rubber Valve  
 Ford; Taurus; 2016; Rubber Valve  
 Ford; Transit; 2014-2015; Rubber Valve  
 Ford; Transit; 2016; Rubber Valve  
 Ford; Transit Connect; 2010-2015; Rubber Valve  
 Ford; Transit Connect; 2016; Rubber Valve  
 Jeep; Commander; 2006-2007; Rubber Valve  
 Jeep; Commander; 2008-2010; Rubber Valve  
 Jeep; Compass; 2007-2010; Rubber Valve  
 Jeep; Compass; 2011; Rubber Valve  
 Jeep; Compass; 2012-2015; Rubber Valve  
 Jeep; Compass; 2016; Rubber Valve  
 Jeep; Grand Cherokee; 2005-2007; Rubber Valve  
 Jeep; Grand Cherokee; 2008-2010; Rubber Valve  
 Jeep; Grand Cherokee; 2011-2015  
 Jeep; Liberty; 2005-2008; Rubber Valve  
 Jeep; Liberty; 2009; Rubber Valve  
 Jeep; Liberty; 2010-2012; Rubber Valve  
 Jeep; Patriot; 2007-2010; Rubber Valve  
 Jeep; Patriot; 2011-2012; Rubber Valve  
 Jeep; Patriot; 2013-2015; Rubber Valve  
 Jeep; Patriot; 2016; Rubber Valve  
 Jeep; Wrangler; 2007-2008; Rubber Valve  
 Jeep; Wrangler; 2009; Rubber Valve  
 Jeep; Wrangler; 2010; Rubber Valve  
 Jeep; Wrangler; 2011; Rubber Valve

# Numerical Listing

Jeep; Wrangler; 2012; Rubber Valve  
 Jeep; Wrangler; 2013-2015; Rubber Valve  
 Jeep; Wrangler; 2016; Rubber Valve  
 Lincoln; Mark LT; 2013-2014; Rubber Valve  
 Lincoln; Mark LT; 2015-2016; Rubber Valve  
 Lincoln; MKC; 2015; Rubber Valve  
 Lincoln; MKS; 2011-2015; Rubber Valve  
 Lincoln; MKS; 2016; Rubber Valve  
 Lincoln; MKT; 2011-2016; Rubber Valve  
 Lincoln; MKX; 2011-2014; Rubber Valve  
 Lincoln; MKX; 2015-2016; Rubber Valve  
 Lincoln; MKZ; 2010-2015; Rubber Valve  
 Lincoln; MKZ; 2016; Rubber Valve  
 Lincoln; Navigator; 2011-2015; Rubber Valve  
 Lincoln; Navigator; 2016; Rubber Valve  
 Lincoln; Town Car; 2011; Rubber Valve  
 Mazda; Tribute; 2009-2011; Rubber Valve  
 Mercury; Mariner; 2009-2011; Rubber Valve  
 Mercury; Milan; 2010-2011; Rubber Valve  
 Mitsubishi; Lancer; 2012; Rubber Valve  
 Ram; 4500; 2012; Rubber Valve  
 Ram; 5500; 2012; Rubber Valve  
 Ram; C/V; 2012; Rubber Valve  
 Ram; C/V; 2013-2015; Rubber Valve  
 Ram; ProMaster; 2014-2015; Rubber Valve  
 Ram; ProMaster; 2016; Rubber Valve  
 Ram; Ram Series; 2011; W/Rubber Stem Snap-in Sensor  
 Ram; Ram Series; 2012-2013; Rubber Valve  
 Volkswagen; Routan; 2009-2010; Rubber Valve  
 Volkswagen; Routan; 2011-2012; Rubber Valve  
 VPG; MV-1; 2012; Rubber Valve

## 20019



Acura; CSX; 2008-2011  
 Acura; TL; 2009-2013  
 Acura; ZDX; 2010-2013  
 Honda; Civic; 2008-2014  
 Honda; CR-Z; 2011-2014  
 Honda; CR-Z; 2015  
 Honda; Element; 2009-2011  
 Honda; Fit; 2009-2014  
 Honda; Insight; 2010-2014  
 Honda; Odyssey; 2011-2016  
 Hyundai; Elantra; 2010  
 Hyundai; Elantra; 2011  
 Hyundai; Elantra; 2012  
 Hyundai; Elantra; 2013

## Service Pack

### 20020



Chrysler; 200; 2011; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; 200; 2012; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; 300; 2005-2006; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; 300; 2007; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; 300; 2008; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; 300; 2009-2010; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; 300; 2012; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; Aspen; 2007-2011; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; Crossfire; 2005; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; Pacifica; 2006-2007; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; Pacifica; 2008; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; PT Cruiser; 2008-2010; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; Sebring; 2007-2009; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; Sebring; 2010; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; Town & Country; 2006-2007; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; Town & Country; 2008; Fits Schrader Sensor; Includes Stem Only  
 Chrysler; Town & Country; 2009-2010; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Avenger; 2008-2009; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Avenger; 2010-2012; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Caliber; 2007-2010; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Caliber; 2011-2012; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Caravan; 2006-2007; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Challenger; 2008; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Challenger; 2009; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Challenger; 2010-2012; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Charger; 2006-2007; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Charger; 2008; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Charger; 2009; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Charger; 2010; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Dakota; 2008-2010; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Durango; 2007; W/Schrader Sensor; Includes Stem Only  
 Dodge; Durango; 2008; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Durango; 2009; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Grand Caravan; 2006-2007; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Grand Caravan; 2008; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Grand Caravan; 2009-2010; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Journey; 2009; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Journey; 2010; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Magnum; 2005-2007; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Magnum; 2008; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Nitro; 2007-2008; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Nitro; 2009-2011; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Ram Series; 2008; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Ram Series; 2009; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Ram Series; 2010; Fits Schrader Sensor; Includes Stem Only  
 Dodge; Viper; 2012-2013; Fits Schrader Sensor; Includes Stem Only  
 Jeep; Commander; 2006-2007; Fits Schrader Sensor; Includes Stem Only  
 Jeep; Commander; 2008-2010; Fits Schrader Sensor; Includes Stem Only  
 Jeep; Compass; 2007-2010; Fits Schrader Sensor; Includes Stem Only  
 Jeep; Compass; 2011; Fits Schrader Sensor; Includes Stem Only  
 Jeep; Grand Cherokee; 2005-2007; Fits Schrader Sensor; Includes Stem Only  
 Jeep; Grand Cherokee; 2008-2010; Fits Schrader Sensor; Includes Stem Only  
 Jeep; Liberty; 2005-2008; Fits Schrader Sensor; Includes Stem Only  
 Jeep; Liberty; 2009; Fits Schrader Sensor; Includes Stem Only  
 Jeep; Liberty; 2010-2012; Fits Schrader Sensor; Includes Stem Only  
 Jeep; Patriot; 2007-2010; Fits Schrader Sensor; Includes Stem Only  
 Jeep; Patriot; 2011-2012; Fits Schrader Sensor; Includes Stem Only  
 Jeep; Wrangler; 2007-2008; Fits Schrader Sensor; Includes Stem Only  
 Jeep; Wrangler; 2009; Fits Schrader Sensor; Includes Stem Only  
 Jeep; Wrangler; 2010; Fits Schrader Sensor; Includes Stem Only



# Numerical Listing

Jeep; Wrangler; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; 550,63AMG; 2007-2009; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; C Series; 2007; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; C Series; 2008-2009; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; C Series; 2010-2012; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; C Series; 2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; C250; 2012; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; C250; 2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; C280; 2007; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; CLK; 2006; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; CLK350; 2006-2009; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; CLS550; 2012; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; CLS550; 2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; E350; 2010-2012; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; E350; 2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; E550; 2010-2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; E550; 2012-2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; E63 AMG; 2010-2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; E63 AMG; 2012-2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; G500; 2007; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; G500; 2008; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; G55 AMG; 2007; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; G55 AMG; 2008-2010; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; G55 AMG; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; G550; 2009-2010; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; G550; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; G550; 2012-2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; GL; 2010; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; GL; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; GL; 2012-2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; GL350; 2010; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; GL350; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; GL350; 2012-2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; GL63 AMG; 2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; GLK350; 2010; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; GLK350; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; GLK350; 2012; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; GLK350; 2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; ML350; 2010; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; ML350; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; ML350; 2012; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; ML350; 2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; ML450; 2010; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; ML450; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; ML550; 2010; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; ML550; 2011-2012; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; ML63 AMG; 2010; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; ML63 AMG; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; ML63 AMG; 2012-2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; R350; 2010; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; R350; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; R350; 2012; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; R350; 2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; S Series; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; S Series; 2012; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; S Series; 2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; S550; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; S550; 2012-2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; S600; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; S600; 2012-2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; S63 AMG; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; S63 AMG; 2012-2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; S65 AMG; 2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; S65 AMG; 2012-2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SL550; 2012; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SL550; 2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SL63 AMG; 2012; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SL63 AMG; 2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SLK250; 2012; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SLK250; 2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SLK280; 2007; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SLK280; 2008; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SLK300; 2009-2011; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SLK350; 2007; Fits Schrader Sensor; Includes Stem Only

Mercedes-Benz; SLK350; 2008-2012; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SLK350; 2013; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SLK55 AMG; 2007; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SLK55 AMG; 2008-2010; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SLS AMG; 2011-2012; Fits Schrader Sensor; Includes Stem Only  
 Mercedes-Benz; SLS AMG; 2013; Fits Schrader Sensor; Includes Stem Only  
 Mitsubishi; Raider; 2008-2009; Fits Schrader Sensor; Includes Stem Only  
 Smart; Fortwo; 2008-2012; Fits Schrader Sensor; Includes Stem Only  
 Smart; Fortwo; 2013; Fits Schrader Sensor; Includes Stem Only  
 Suzuki; Kizashi; 2010-2012; Fits Schrader Sensor; Includes Stem Only

## 20022



Hyundai; Accent; 2008-2011  
 Hyundai; Equus; 2011-2013  
 Hyundai; Genesis; 2009  
 Hyundai; Genesis; 2011-2013  
 Hyundai; Genesis; 2014  
 Hyundai; Santa Fe; 2013  
 Hyundai; Santa Fe XL; 2013  
 Hyundai; Sonata; 2009-2010  
 Hyundai; Tucson; 2010-2013  
 Kia; Borrego; 2009-2011  
 Kia; Rio; 2007-2011  
 Kia; Rio5; 2007-2011  
 Kia; Spectra; 2006  
 Kia; Spectra; 2007-2009  
 Kia; Spectra5; 2006  
 Kia; Spectra5; 2007-2009  
 Kia; Sportage; 2009-2012  
 Kia; Sportage; 2013  
 Toyota; Sequoia; 2008-2013  
 Toyota; Sienna; 2006-2014  
 Toyota; Tundra; 2006; Nov. 1 & Newer  
 Toyota; Tundra; 2007; W/Alloy Wheels; W/TRW Sensor  
 Toyota; Tundra; 2008-2011  
 Toyota; Tundra; 2012  
 Toyota; Tundra; 2013  
 Toyota; Tundra; 2014

# Numerical Listing

## Service Pack

20023



Audi; A3, A4,A5 & Quattro; 2002-2007; Does Not Include Valve  
 Audi; A3, A4,A5 & Quattro; 2008; Does Not Include Valve  
 Audi; A6; 2002-2004; Does Not Include Valve  
 Audi; A6; 2006-2008; Does Not Include Valve  
 Audi; A6; 2009; Does Not Include Valve  
 Audi; A6; 2010; Does Not Include Valve  
 Audi; A6; 2011; Does Not Include Valve  
 Audi; A6 Quattro; 2006-2008; Does Not Include Valve  
 Audi; A6 Quattro; 2010; Does Not Include Valve  
 Audi; A6 Quattro; 2011; Does Not Include Valve  
 Audi; A8; 2000; Does Not Include Valve  
 Audi; A8 Quattro; 2000-2002; Does Not Include Valve  
 Audi; A8 Quattro; 2003; Does Not Include Valve  
 Audi; A8 Quattro; 2004-2011; Does Not Include Valve  
 Audi; Allroad Quattro; 2001-2005; Does Not Include Valve  
 Audi; Q7; 2007-2009; Does Not Include Valve  
 Audi; Q7; 2010; Does Not Include Valve  
 Audi; Q7; 2011; Does Not Include Valve  
 Audi; Q7; 2012; Does Not Include Valve  
 Audi; R8; 2008-2009; Does Not Include Valve  
 Audi; R8; 2010; Does Not Include Valve  
 Audi; R8; 2011; Does Not Include Valve  
 Audi; R8; 2012; Does Not Include Valve  
 Audi; R8; 2014-2015; Does Not Include Valve  
 Audi; RS4; 2007-2008; Does Not Include Valve  
 Audi; RS6; 2003; Does Not Include Valve  
 Audi; RS7; 2014-2016; Does Not Include Valve  
 Audi; S4; 2002; Does Not Include Valve  
 Audi; S4; 2003; Does Not Include Valve  
 Audi; S4; 2004-2009; Does Not Include Valve  
 Audi; S6; 2007-2009; Does Not Include Valve  
 Audi; S6; 2010; Does Not Include Valve  
 Audi; S6; 2011; Does Not Include Valve  
 Audi; S8; 2001-2002; Does Not Include Valve  
 Audi; S8; 2003; Does Not Include Valve  
 Audi; S8; 2004-2006; Does Not Include Valve  
 Audi; S8; 2007-2008; Does Not Include Valve  
 Audi; S8; 2009; Does Not Include Valve  
 Audi; S8; 2015; Does Not Include Valve  
 Bentley; Azure; 2007-2009; Does Not Include Valve  
 Bentley; Continental; 2003-2005; Does Not Include Valve  
 Bentley; Continental; 2006-2010; Does Not Include Valve  
 Bentley; Continental; 2012-2014; Does Not Include Valve  
 Bentley; Mulsanne; 2011-2015; Does Not Include Valve  
 BMW; 1 Series; 2008-2011; Does Not Include Valve  
 BMW; 1 Series; 2012-2013; Does Not Include Valve  
 BMW; 228i; 2015  
 BMW; 320i; 2001-2002; Does Not Include Valve  
 BMW; 320i; 2003-2005; Does Not Include Valve  
 BMW; 323Ci; 2000; Does Not Include Valve  
 BMW; 323i; 2000; Does Not Include Valve  
 BMW; 323i; 2006; Does Not Include Valve; Jun. & Newer  
 BMW; 323i; 2007-2010; Does Not Include Valve  
 BMW; 325; 2001-2002; Does Not Include Valve  
 BMW; 325; 2003-2006; Does Not Include Valve  
 BMW; 328Ci; 2000; Does Not Include Valve  
 BMW; 328i; 2000; Does Not Include Valve  
 BMW; 328i; 2007-2009; Does Not Include Valve  
 BMW; 328i; 2010-2013; Does Not Include Valve  
 BMW; 328i; 2014; Does Not Include Valve

BMW; 328i; 2015; Does Not Include Valve  
 BMW; 328i GT xDrive; 2014; Does Not Include Valve  
 BMW; 328i GT xDrive; 2015; Does Not Include Valve  
 BMW; 328i xDrive; 2009; Does Not Include Valve  
 BMW; 328i xDrive; 2010-2013; Does Not Include Valve  
 BMW; 328i xDrive; 2014; Does Not Include Valve  
 BMW; 328i xDrive; 2015; Does Not Include Valve  
 BMW; 328xi; 2007-2008; Does Not Include Valve  
 BMW; 330; 2001-2002; Does Not Include Valve  
 BMW; 330; 2003-2006; Does Not Include Valve  
 BMW; 335d; 2009; Does Not Include Valve  
 BMW; 335d; 2010-2011; Does Not Include Valve  
 BMW; 335i; 2007-2009; Does Not Include Valve  
 BMW; 335i; 2010-2013; Does Not Include Valve  
 BMW; 335i; 2014; Does Not Include Valve  
 BMW; 335i GT xDrive; 2014; Does Not Include Valve  
 BMW; 335i GT xDrive; 2015; Does Not Include Valve  
 BMW; 335i xDrive; 2009; Does Not Include Valve  
 BMW; 335i xDrive; 2010-2013; Does Not Include Valve  
 BMW; 335i xDrive; 2014; Does Not Include Valve  
 BMW; 335i xDrive; 2015; Does Not Include Valve  
 BMW; 335is; 2012-2013; Does Not Include Valve  
 BMW; 335xi; 2007-2008; Does Not Include Valve  
 BMW; 428i; 2014; Does Not Include Valve  
 BMW; 428i; 2015; Does not include valve  
 BMW; 428i xDrive; 2014; Does Not Include Valve  
 BMW; 428i xDrive; 2015; Does not include valve  
 BMW; 435i; 2014; Does Not Include Valve  
 BMW; 435i; 2015; Does not include valve  
 BMW; 435i; 2016; Does not include valve  
 BMW; 435i xDrive; 2014; Does Not Include Valve  
 BMW; 435i xDrive; 2015; Does not include valve  
 BMW; 525i; 2001; Does Not Include Valve  
 BMW; 525i; 2002; Does Not Include Valve  
 BMW; 525i; 2003-2005; Does Not Include Valve  
 BMW; 525i; 2006-2007; Does Not Include Valve  
 BMW; 525xi; 2006-2007; Does Not Include Valve  
 BMW; 528; 1997-1999; Does Not Include Valve  
 BMW; 528; 2000; Does Not Include Valve  
 BMW; 528; 2008-2011; Does Not Include Valve  
 BMW; 528; 2012-2014; Does Not Include Valve  
 BMW; 528; 2015-2016; Does Not Include Valve  
 BMW; 528xi; 2008; Does Not Include Valve  
 BMW; 530; 2001; Does Not Include Valve  
 BMW; 530; 2002; Does Not Include Valve  
 BMW; 530; 2003-2005; Does Not Include Valve  
 BMW; 530; 2006-2007; Does Not Include Valve  
 BMW; 535; 2008-2011; Does Not Include Valve  
 BMW; 535; 2012-2014; Does Not Include Valve  
 BMW; 535; 2015-2016; Does Not Include Valve  
 BMW; 535d; 2014; Does Not Include Valve  
 BMW; 535d; 2015-2016; Does Not Include Valve  
 BMW; 535d xDrive; 2014; Does Not Include Valve  
 BMW; 535d xDrive; 2015-2016; Does Not Include Valve  
 BMW; 535xi; 2008; Does Not Include Valve  
 BMW; 540i; 1997-1999; Does Not Include Valve  
 BMW; 540i; 2000; Does Not Include Valve  
 BMW; 540i; 2001; Does Not Include Valve  
 BMW; 540i; 2002; Does Not Include Valve  
 BMW; 540i; 2003; Does Not Include Valve  
 BMW; 545i; 2004-2005; Does Not Include Valve  
 BMW; 550; 2006-2011; Does Not Include Valve  
 BMW; 550; 2012-2014; Does Not Include Valve  
 BMW; 550; 2015-2016; Does Not Include Valve  
 BMW; 640; 2012-2015; Does Not Include Valve  
 BMW; 640; 2016  
 BMW; 645Ci; 2004-2005; Does Not Include Valve  
 BMW; 650; 2006-2010; Does Not Include Valve  
 BMW; 650; 2012-2015; Does Not Include Valve  
 BMW; 650; 2016  
 BMW; 650i Gran Coupe xDrive; 2016  
 BMW; 740i; 1997-1999; Does Not Include Valve  
 BMW; 740i; 2000-2001; Does Not Include Valve  
 BMW; 740i; 2011; Does Not Include Valve  
 BMW; 740i; 2012-2015; Does Not Include Valve



# Numerical Listing

BMW; 740iL; 1997-1999; Does Not Include Valve  
 BMW; 740iL; 2000; Does Not Include Valve  
 BMW; 740iL; 2001; Does Not Include Valve  
 BMW; 740Li; 2011; Does Not Include Valve  
 BMW; 740Li; 2012-2015; Does Not Include Valve  
 BMW; 740Li xDrive; 2013-2015; Does Not Include Valve  
 BMW; 745; 2002; Does Not Include Valve  
 BMW; 745; 2003; Does Not Include Valve  
 BMW; 745; 2004-2005; Does Not Include Valve  
 BMW; 750; 2006-2011; Does Not Include Valve  
 BMW; 750; 2012-2015; Does Not Include Valve  
 BMW; 750iL; 1997-1999; Does Not Include Valve  
 BMW; 750iL; 2000; Does Not Include Valve  
 BMW; 750iL; 2001; Does Not Include Valve  
 BMW; 760i; 2004-2005; Does Not Include Valve  
 BMW; 760i; 2006; Does Not Include Valve  
 BMW; 760Li; 2003; Does Not Include Valve  
 BMW; 760Li; 2004-2008; Does Not Include Valve  
 BMW; 760Li; 2010-2011; Does Not Include Valve  
 BMW; 760Li; 2012-2015; Does Not Include Valve  
 BMW; ActiveHybrid 3; 2013-2014; Does Not Include Valve  
 BMW; ActiveHybrid 5; 2012-2014; Does Not Include Valve  
 BMW; ActiveHybrid 5; 2015; Does Not Include Valve  
 BMW; ActiveHybrid 7; 2013-2015; Does Not Include Valve  
 BMW; Alpina B7; 2007-2008; Does Not Include Valve  
 BMW; Alpina B7; 2011; Does Not Include Valve  
 BMW; Alpina B7; 2012-2014; Does Not Include Valve  
 BMW; Alpina B7 xDrive; 2011; Does Not Include Valve  
 BMW; Alpina B7L; 2011; Does Not Include Valve  
 BMW; Alpina B7L xDrive; 2011; Does Not Include Valve  
 BMW; M; 2000-2001; Does Not Include Valve  
 BMW; M; 2002; Does Not Include Valve  
 BMW; M; 2003; Does Not Include Valve  
 BMW; M; 2004-2010; Does Not Include Valve  
 BMW; M; 2011-2013; Does Not Include Valve  
 BMW; M; 2014; Does Not Include Valve  
 BMW; M; 2015; Does Not Include Valve  
 BMW; X; 2000-2003; Does Not Include Valve  
 BMW; X; 2004; Does Not Include Valve  
 BMW; X; 2005-2011; Does Not Include Valve  
 BMW; X; 2012-2014; Does Not Include Valve  
 BMW; X; 2015; Does Not Include Valve  
 BMW; X; 2016; Does Not Include Valve  
 BMW; Z3; 2000-2002; Does Not Include Valve  
 BMW; Z4; 2003-2011; Does Not Include Valve  
 BMW; Z4; 2012-2015; Does Not Include Valve  
 BMW; Z4; 2016; Does Not Include Valve  
 BMW; Z8; 2000-2002; Does Not Include Valve  
 BMW; Z8; 2003; Does Not Include Valve  
 Bugatti; Veyron 16.4; 2006; Does Not Include Valve  
 Ferrari; 612 Scaglietti; 2005-2009; Does Not Include Valve  
 Ferrari; Enzo; 2003-2004; Does Not Include Valve  
 Ferrari; F430; 2006-2009; Does Not Include Valve  
 Ferrari; Maranello; 2001-2005; Does Not Include Valve  
 Land Rover; LR3; 2002-2005; Does Not Include Valve  
 Land Rover; Range Rover; 2002; Does Not Include Valve  
 Land Rover; Range Rover; 2003-2005; Does Not Include Valve  
 Maserati; Coupe; 2004-2006; Does Not Include Valve  
 Maserati; Quattroporte; 2004-2008; Does Not Include Valve  
 Maserati; Spyder; 2004-2006; Does Not Include Valve  
 Mercedes-Benz; C Series; 2001-2006; Does Not Include Valve  
 Mercedes-Benz; CL; 2000-2006; Does Not Include Valve  
 Mercedes-Benz; E320; 2001-2005; Does Not Include Valve  
 Mercedes-Benz; E430; 2001-2002; Does Not Include Valve  
 Mercedes-Benz; E500; 2003-2005; Does Not Include Valve  
 Mercedes-Benz; E55 AMG; 1999; Does Not Include Valve; Jul. & Newer  
 Mercedes-Benz; E55 AMG; 2000-2005; Does Not Include Valve  
 Mercedes-Benz; S Series; 2006; Does Not Include Valve  
 Mercedes-Benz; S430; 2000-2006; Does Not Include Valve  
 Mercedes-Benz; S500; 2000; Does Not Include Valve  
 Mercedes-Benz; S500; 2001; Does Not Include Valve  
 Mercedes-Benz; S500; 2002-2006; Does Not Include Valve  
 Mercedes-Benz; S55 AMG; 2001-2006; Does Not Include Valve  
 Mercedes-Benz; S600; 2001-2006; Does Not Include Valve  
 Mercedes-Benz; S65 AMG; 2006; Does Not Include Valve

Mercedes-Benz; SL500; 2000-2005; Does Not Include Valve  
 Mercedes-Benz; SL55 AMG; 2003; Does Not Include Valve  
 Mercedes-Benz; SL55 AMG; 2005; Does Not Include Valve  
 Mercedes-Benz; SL600; 2001-2002; Does Not Include Valve  
 Mercedes-Benz; SL600; 2004-2005; Does Not Include Valve  
 Mercedes-Benz; SL65 AMG; 2005; Does Not Include Valve  
 Mercedes-Benz; SLR McLaren; 2004; Does Not Include Valve  
 Mercedes-Benz; SLR McLaren; 2005; Does Not Include Valve  
 Mercedes-Benz; SLR McLaren; 2006; Does Not Include Valve  
 Mercedes-Benz; SLR McLaren; 2007; Does Not Include Valve  
 Mini; Cooper; 2008-2009; Does Not Include Valve  
 Mini; Cooper; 2010-2013; Does Not Include Valve  
 Mini; Cooper; 2014; Does Not Include Valve  
 Mini; Cooper; 2015; Does Not Include Valve  
 Porsche; 911; 2005-2006; Does Not Include Valve  
 Porsche; 911; 2007-2009; Does Not Include Valve  
 Porsche; 911; 2010; Does Not Include Valve  
 Porsche; 911; 2011; Does Not Include Valve  
 Porsche; 911; 2012; Does Not Include Valve  
 Porsche; 911; 2013-2014; Does Not Include Valve  
 Porsche; 911; 2015; Does Not Include Valve  
 Porsche; Boxster; 2005-2007; Does Not Include Valve  
 Porsche; Boxster; 2008-2010; Does Not Include Valve  
 Porsche; Boxster; 2011; Does Not Include Valve  
 Porsche; Boxster; 2012-2013; Does Not Include Valve  
 Porsche; Boxster; 2014-2016; Does Not Include Valve  
 Porsche; Carrera GT; 2004-2005; Does Not Include Valve  
 Porsche; Cayenne; 2003-2006; Does Not Include Valve  
 Porsche; Cayenne; 2008-2010; Does Not Include Valve  
 Porsche; Cayman; 2006-2007; Does Not Include Valve  
 Porsche; Cayman; 2008-2010; Does Not Include Valve  
 Porsche; Cayman; 2011; Does Not Include Valve  
 Porsche; Cayman; 2012-2016; Does Not Include Valve  
 Porsche; Panamera; 2010; Does Not Include Valve  
 Rolls Royce; Phantom; 2007-2010; Does Not Include Valve  
 Volkswagen; Phaeton; 2004-2006; Does Not Include Valve; W/315 MHz Sensor  
 Volkswagen; Touareg; 2004-2006; Does Not Include Valve  
 Volkswagen; Touareg; 2007; Does Not Include Valve  
 Volkswagen; Touareg; 2008-2009; Does Not Include Valve  
 Volkswagen; Touareg; 2010; Does Not Include Valve  
 Volkswagen; Touareg; 2011-2013; Does Not Include Valve; W/315 MHz Sensor  
 Volkswagen; Touareg; 2014; Does Not Include Valve; W/315 MHz Sensor

# Numerical Listing

## Service Pack

### 20030



Buick; Allure; 2007-2008; W/Siemens Sensor  
 Buick; Enclave; 2008; W/Siemens Sensor  
 Buick; LaCrosse; 2007-2008; W/Siemens Sensor  
 Chevrolet; Equinox; 2007-2009; W/Siemens Sensor  
 Chevrolet; Express; 2008-2009; W/Siemens Sensor  
 Chrysler; 300; 2005-2006; W/Siemens Sensor  
 Chrysler; 300; 2007; W/Siemens Sensor  
 Chrysler; 300; 2008; W/Siemens Sensor  
 Chrysler; 300M; 2002-2004; W/Siemens Sensor  
 Chrysler; Aspen; 2007-2011; W/Siemens Sensor  
 Chrysler; Concorde; 2002-2004; W/Siemens Sensor  
 Chrysler; Crossfire; 2004; W/Siemens Sensor  
 Chrysler; Crossfire; 2006-2008; W/Siemens Sensor  
 Chrysler; Intrepid; 2002; W/Siemens Sensor  
 Chrysler; Intrepid; 2003-2004; W/Siemens Sensor  
 Chrysler; Pacifica; 2004; W/Siemens Sensor  
 Chrysler; Pacifica; 2005  
 Chrysler; Pacifica; 2006-2007; W/Siemens Sensor  
 Chrysler; Pacifica; 2008; W/Siemens Sensor  
 Chrysler; Prowler; 2002; W/Siemens Sensor  
 Chrysler; PT Cruiser; 2008-2010; W/Siemens Sensor  
 Chrysler; Sebring; 2007-2009; W/Siemens Sensor  
 Chrysler; Town & Country; 2004-2005  
 Chrysler; Town & Country; 2006-2007; W/Siemens Sensor  
 Chrysler; Town & Country; 2008; W/Siemens Sensor  
 Chrysler; Town & Country; 2009-2010; W/Siemens Sensor  
 Dodge; Avenger; 2008-2009; W/Siemens Sensor  
 Dodge; Caliber; 2007-2010; W/Siemens Sensor  
 Dodge; Caravan; 2004-2005  
 Dodge; Caravan; 2006-2007; W/Siemens Sensor  
 Dodge; Charger; 2006-2007; W/Siemens Sensor  
 Dodge; Charger; 2008; W/Siemens Sensor  
 Dodge; Durango; 2007; W/Siemens Sensor  
 Dodge; Durango; 2008; W/Siemens Sensor  
 Dodge; Grand Caravan; 2004-2005  
 Dodge; Grand Caravan; 2006-2007; W/Siemens Sensor  
 Dodge; Grand Caravan; 2008; W/Siemens Sensor  
 Dodge; Grand Caravan; 2009-2010; W/Siemens Sensor  
 Dodge; Journey; 2009; W/Siemens Sensor  
 Dodge; Journey; 2010; W/Siemens Sensor  
 Dodge; Magnum; 2005-2007; W/Siemens Sensor  
 Dodge; Magnum; 2008; W/Siemens Sensor  
 Dodge; Nitro; 2007-2008; W/Siemens Sensor  
 GMC; Acadia; 2007-2008; W/Siemens Sensor  
 GMC; Savana Series; 2008-2009; W/Siemens Sensor  
 Jaguar; Jaguar; 2004-2012  
 Jeep; Commander; 2006-2007; W/Siemens Sensor  
 Jeep; Compass; 2007-2010; W/Siemens Sensor  
 Jeep; Grand Cherokee; 2005-2007; W/Siemens Sensor  
 Jeep; Liberty; 2005-2008; W/Siemens Sensor  
 Jeep; Patriot; 2007-2010; W/Siemens Sensor  
 Jeep; Wrangler; 2007-2008; W/Siemens Sensor  
 Land Rover; LR2; 2008-2015  
 Land Rover; LR3; 2006-2009  
 Land Rover; LR4; 2010-2011  
 Land Rover; LR4; 2012-2014  
 Land Rover; Range Rover; 2006-2011  
 Land Rover; Range Rover; 2012-2014  
 Land Rover; Range Rover Evoque; 2012-2015  
 Land Rover; Range Rover Sport; 2006-2011

Land Rover; Range Rover Sport; 2012-2014  
 Mitsubishi; i-MiEV; 2012  
 Mitsubishi; Lancer; 2008-2010  
 Mitsubishi; Lancer; 2011  
 Mitsubishi; Lancer; 2012  
 Mitsubishi; Lancer; 2013-2014  
 Mitsubishi; Lancer; 2015  
 Mitsubishi; Mirage; 2014  
 Mitsubishi; Outlander; 2007-2010  
 Mitsubishi; Outlander; 2011-2015  
 Mitsubishi; Outlander Sport; 2011-2015  
 Mitsubishi; RVR; 2011-2014  
 Pontiac; G Series; 2008; W/Siemens Sensor  
 Pontiac; Grand Prix; 2007; W/Siemens Sensor  
 Pontiac; Montana; 2008; W/Siemens Sensor  
 Pontiac; Solstice; 2008-2009; W/Siemens Sensor  
 Pontiac; Torrent; 2007-2009; W/Siemens Sensor  
 Saturn; Aura; 2007; W/Siemens Sensor  
 Saturn; Outlook; 2007-2008; W/Siemens Sensor  
 Saturn; Sky; 2008-2010; W/Siemens Sensor  
 Suzuki; Kizashi; 2010-2012; W/Siemens Sensor  
 Suzuki; XL-7; 2007-2009; W/Siemens Sensor

### 20031



Lexus; GS300; 2006  
 Lexus; GS430; 2005  
 Lexus; GS430; 2006; Jun. & Older  
 Lexus; GX470; 2004-2005  
 Lexus; GX470; 2006; Jan. 31 & Older  
 Lexus; IS250; 2006; Mar. & Older  
 Lexus; IS350; 2006; Mar. & Older  
 Lexus; LX470; 2005  
 Lexus; LX470; 2006; Jul. & Older  
 Lexus; RX330; 2006; Jan. 31 & Older  
 Toyota; 4Runner; 2003-2005  
 Toyota; 4Runner; 2006; May & Older  
 Toyota; Land Cruiser; 2005; May & Newer  
 Toyota; Land Cruiser; 2006; Mar. & Older  
 Toyota; Sequoia; 2004-2007  
 Toyota; Tacoma; 2005  
 Toyota; Tacoma; 2006; Jul. & Older  
 Toyota; Tundra; 2005  
 Toyota; Tundra; 2006; Oct. 31 & Older

# Numerical Listing

## Service Pack

20032



Honda; Accord; 2008-2012  
 Honda; CR-V; 2007-2011  
 Honda; Fit; 2008  
 Honda; Pilot; 2009; W/Alloy Wheels  
 Honda; Pilot; 2010-2011; Exc. LX  
 Honda; Pilot; 2012-2015; W/Alloy Wheels  
 Honda; S2000; 2008-2009  
 Lexus; CT200h; 2011  
 Lexus; CT200h; 2012-2015  
 Lexus; ES300h; 2013  
 Lexus; ES300h; 2014-2015  
 Lexus; ES350; 2007-2013  
 Lexus; ES350; 2014-2015  
 Lexus; GS350; 2007-2011  
 Lexus; GS350; 2013  
 Lexus; GS350; 2014-2016  
 Lexus; GS430; 2006; Jul. & Newer  
 Lexus; GS430; 2007  
 Lexus; GS450h; 2007-2011  
 Lexus; GS450h; 2013-2016  
 Lexus; GS460; 2008-2011  
 Lexus; GS460; 2012-2016  
 Lexus; GX460; 2010-2015  
 Lexus; GX470; 2006; Feb. & Newer  
 Lexus; GX470; 2007-2009  
 Lexus; HS250h; 2010-2012  
 Lexus; IS F; 2008-2015  
 Lexus; IS F; 2016  
 Lexus; IS250; 2006; Apr. 1 & Newer  
 Lexus; IS250; 2007  
 Lexus; IS250; 2008-2015  
 Lexus; IS250; 2016  
 Lexus; IS350; 2006; Apr. 1 & Newer  
 Lexus; IS350; 2007-2015  
 Lexus; IS350; 2016  
 Lexus; LFA; 2012  
 Lexus; LFA; 2016  
 Lexus; LS460; 2007-2015  
 Lexus; LS460; 2016  
 Lexus; LS600h; 2008-2016  
 Lexus; LX470; 2006; Aug. & Newer  
 Lexus; LX470; 2007  
 Lexus; LX570; 2008-2011  
 Lexus; LX570; 2013-2014  
 Lexus; LX570; 2016  
 Lexus; RX330; 2006; Feb. & Newer  
 Lexus; RX350; 2007-2010  
 Lexus; RX350; 2011-2012  
 Lexus; RX350; 2013; exc F Sport  
 Lexus; RX350; 2014-2015  
 Lexus; RX400h; 2006  
 Lexus; RX400h; 2007-2008  
 Lexus; RX450h; 2010-2013  
 Lexus; RX450h; 2014-2015  
 Lexus; SC430; 2006; Aug. & Newer  
 Lexus; SC430; 2007-2010  
 Nissan; 370Z; 2010  
 Nissan; 370Z; 2011-2013  
 Pontiac; Vibe; 2008-2010  
 Scion; FR-S; 2013

Scion; iQ; 2012-2014  
 Scion; iQ; 2015  
 Scion; tC; 2006; May & Newer  
 Scion; tC; 2007-2014  
 Scion; tC; 2015  
 Scion; xB; 2008-2014  
 Scion; xB; 2015  
 Scion; xD; 2008-2014  
 Subaru; BRZ; 2013-2014  
 Toyota; 4Runner; 2006; Jun. & Newer  
 Toyota; 4Runner; 2007  
 Toyota; 4Runner; 2008  
 Toyota; 4Runner; 2009  
 Toyota; 4Runner; 2010-2016  
 Toyota; Avalon; 2006; Aug. & Newer  
 Toyota; Avalon; 2007-2014  
 Toyota; Avalon; 2015  
 Toyota; Camry; 2007-2011  
 Toyota; Camry; 2012-2014  
 Toyota; Camry; 2015  
 Toyota; Corolla; 2007; Jun. & Newer  
 Toyota; Corolla; 2008  
 Toyota; Corolla; 2009-2012  
 Toyota; Corolla; 2013  
 Toyota; Corolla; 2014  
 Toyota; Corolla; 2015  
 Toyota; FJ Cruiser; 2008-2014  
 Toyota; FJ Cruiser; 2015  
 Toyota; Highlander; 2007; May & Newer  
 Toyota; Highlander; 2008-2010  
 Toyota; Highlander; 2011-2014  
 Toyota; Highlander; 2015  
 Toyota; Land Cruiser; 2006; Apr. 1 & Newer  
 Toyota; Land Cruiser; 2007-2011  
 Toyota; Land Cruiser; 2013-2014  
 Toyota; Land Cruiser; 2015  
 Toyota; Matrix; 2007; Jun. & Newer  
 Toyota; Matrix; 2008-2013  
 Toyota; Prius; 2005-2013  
 Toyota; Prius; 2014-2016  
 Toyota; RAV4; 2006; exc Electric  
 Toyota; RAV4; 2007-2011; exc Electric  
 Toyota; RAV4; 2012  
 Toyota; RAV4; 2013; exc Electric  
 Toyota; Solara; 2006; May & Newer  
 Toyota; Solara; 2007-2008  
 Toyota; Tacoma; 2006; Aug. & Newer  
 Toyota; Tacoma; 2007-2013  
 Toyota; Tacoma; 2014  
 Toyota; Tacoma; 2015  
 Toyota; Venza; 2009-2014  
 Toyota; Venza; 2015-2016  
 Toyota; Yaris; 2007; Aug. & Newer  
 Toyota; Yaris; 2008-2012  
 Toyota; Yaris; 2013

20035



Honda; Pilot; 2005; LX; W/Long Stem Valve; Includes Valve  
 Honda; Ridgeline; 2006; RT; Includes Valve  
 Honda; Ridgeline; 2007-2008; RT; Includes Valve

# Numerical Listing

## Service Pack

20036



Acura; MDX, RDX; 2004-2006; Includes Valve  
 Acura; RL; 2005-2012; Includes Valve  
 Acura; TL; 2005-2008; Includes Valve  
 Dodge; Sprinter; 2007-2009; Includes Valve  
 Freightliner; Sprinter; 2007-2008; Includes Valve  
 Freightliner; Sprinter; 2013; Includes Valve  
 Honda; Element; 2007-2008; Includes Valve  
 Honda; Odyssey; 2005-2007; Touring; Includes Valve  
 Honda; Odyssey; 2008; Includes Valve  
 Honda; Odyssey; 2008; Touring; Includes Valve  
 Honda; Odyssey; 2009-2010; Includes Valve  
 Honda; Pilot; 2005; EX; Includes Valve  
 Honda; Pilot; 2005; LX; W/Short Stem Valve; Includes Valve  
 Honda; Pilot; 2006-2008; Includes Valve  
 Honda; Ridgeline; 2006; RTL, RTS; Includes Valve  
 Honda; Ridgeline; 2007-2008; RTL, RTS, RTX; Includes Valve  
 Honda; Ridgeline; 2009; Includes Valve  
 Honda; Ridgeline; 2010; RT; Includes Valve  
 Honda; Ridgeline; 2011-2014; RT; Includes Valve  
 Hyundai; Accent; 2006-2007  
 Hyundai; Azera; 2006; Includes Valve  
 Hyundai; Azera; 2007-2012; Includes Valve  
 Hyundai; Azera; 2013; Includes Valve  
 Hyundai; Elantra; 2007-2009; Includes Valve  
 Hyundai; Elantra; 2010; exc Touring; Includes Valve  
 Hyundai; Elantra; 2011; exc Touring; Includes Valve  
 Hyundai; Elantra; 2012; exc Touring; Includes Valve  
 Hyundai; Elantra; 2013; Includes Valve  
 Hyundai; Elantra Coupe; 2013; Includes Valve  
 Hyundai; Entourage; 2007-2009; Includes Valve  
 Hyundai; Santa Fe; 2007; Includes Valve  
 Hyundai; Santa Fe; 2008; Includes Valve  
 Hyundai; Santa Fe; 2009; Includes Valve  
 Hyundai; Sonata; 2007; Includes Valve  
 Hyundai; Sonata; 2008; Includes Valve  
 Hyundai; Tiburon; 2007-2008; Includes Valve  
 Hyundai; Tucson; 2006-2009; Includes Valve  
 Hyundai; Veracruz; 2006-2007; Includes Valve  
 Hyundai; Veracruz; 2008; Includes Valve  
 Hyundai; Veracruz; 2009-2012; Includes Valve  
 Kia; Amanti; 2007-2009; Includes Valve  
 Kia; Magentis; 2008; Includes Valve  
 Kia; Magentis; 2009; Includes Valve  
 Kia; Magentis; 2010; Includes Valve  
 Kia; Optima; 2006-2010; Includes Valve  
 Kia; Rondo; 2007-2011; Includes Valve  
 Kia; Sedona; 2006-2008; Includes Valve  
 Kia; Sedona; 2009-2012; Includes Valve  
 Kia; Sorento; 2007-2009; Includes Valve  
 Kia; Sportage; 2005; Jun. 15, 2005 & Newer; Includes Valve  
 Kia; Sportage; 2006-2008; Includes Valve  
 Mercedes-Benz; C Series; 2007; Includes Valve  
 Mercedes-Benz; C Series; 2008-2009; Includes Valve  
 Mercedes-Benz; CL; 2008-2009; Includes Valve  
 Mercedes-Benz; CLS; 2006; Includes Valve  
 Mercedes-Benz; CLS550; 2007-2011; Includes Valve  
 Mercedes-Benz; E320; 2006-2009; Includes Valve  
 Mercedes-Benz; E350; 2006-2009; Includes Valve  
 Mercedes-Benz; E500; 2006; Includes Valve  
 Mercedes-Benz; E55 AMG; 2006; Includes Valve

Mercedes-Benz; E550; 2007-2009; Includes Valve  
 Mercedes-Benz; E63 AMG; 2007-2009; Includes Valve  
 Mercedes-Benz; GL; 2007-2009; Includes Valve  
 Mercedes-Benz; GL320; 2007-2009; Includes Valve  
 Mercedes-Benz; ML320; 2007-2009; Includes Valve  
 Mercedes-Benz; ML350; 2006-2009; Includes Valve  
 Mercedes-Benz; ML500; 2006-2007; Includes Valve  
 Mercedes-Benz; ML550; 2008-2009; Includes Valve  
 Mercedes-Benz; ML63 AMG; 2007-2009; Includes Valve  
 Mercedes-Benz; R320; 2007-2009; Includes Valve  
 Mercedes-Benz; R350; 2006-2009; Includes Valve  
 Mercedes-Benz; R500; 2006-2007; Includes Valve  
 Mercedes-Benz; R63 AMG; 2007; Includes Valve  
 Mercedes-Benz; S Series; 2010; Includes Valve  
 Mercedes-Benz; S550; 2007-2010; Includes Valve  
 Mercedes-Benz; S600; 2007-2010; Includes Valve  
 Mercedes-Benz; S63 AMG; 2008-2010; Includes Valve  
 Mercedes-Benz; S65 AMG; 2007-2010; Includes Valve  
 Mercedes-Benz; SL500; 2006; Includes Valve  
 Mercedes-Benz; SL55 AMG; 2006-2008; Includes Valve  
 Mercedes-Benz; SL550; 2007-2009; Includes Valve  
 Mercedes-Benz; SL600; 2006-2009; Includes Valve  
 Mercedes-Benz; SL63 AMG; 2009; Includes Valve  
 Mercedes-Benz; SL65 AMG; 2006-2009; Includes Valve  
 Mercedes-Benz; SLR McLaren; 2008-2009; Includes Valve  
 Mercedes-Benz; Sprinter 2500; 2010  
 Mercedes-Benz; Sprinter 2500; 2011-2012  
 Mercedes-Benz; Sprinter 3500; 2010-2012; Includes Valve

# Numerical Listing

## Service Pack

### 20037 (W/43mm Silver Insert)



Audi; A3, A4, A5 & Quattro; 2002-2007; W/43mm Silver Insert  
 Audi; A3, A4, A5 & Quattro; 2008; W/43mm Silver Insert  
 Audi; A6; 2002-2004; W/43mm Silver Insert  
 Audi; A6; 2006-2008; W/43mm Silver Insert  
 Audi; A6; 2009; W/43mm Silver Insert  
 Audi; A6; 2010; W/43mm Silver Insert  
 Audi; A6; 2011; W/43mm Silver Insert  
 Audi; A6 Quattro; 2006-2008; W/43mm Silver Insert  
 Audi; A6 Quattro; 2010; W/43mm Silver Insert  
 Audi; A6 Quattro; 2011; W/43mm Silver Insert  
 Audi; A8; 2000; W/43mm Silver Insert  
 Audi; A8 Quattro; 2000-2002; W/43mm Silver Insert  
 Audi; A8 Quattro; 2003; W/43mm Silver Insert  
 Audi; A8 Quattro; 2004-2011; W/43mm Silver Insert  
 Audi; Allroad Quattro; 2001-2005; W/43mm Silver Insert  
 Audi; Q7; 2007-2009; W/43mm Silver Insert  
 Audi; Q7; 2010; W/43mm Silver Insert  
 Audi; Q7; 2011; W/43mm Silver Insert  
 Audi; Q7; 2012; W/43mm Silver Insert  
 Audi; R8; 2008-2009; W/43mm Silver Insert  
 Audi; R8; 2010; W/43mm Silver Insert  
 Audi; R8; 2011; W/43mm Silver Insert  
 Audi; R8; 2012; W/43mm Silver Insert  
 Audi; R8; 2014-2015; W/43mm Silver Insert  
 Audi; RS4; 2007-2008; W/43mm Silver Insert  
 Audi; RS6; 2003; W/43mm Silver Insert  
 Audi; RS7; 2014-2016; W/43mm Silver Insert  
 Audi; S4; 2002; W/43mm Silver Insert  
 Audi; S4; 2004-2009; W/43mm Silver Insert  
 Audi; S6; 2007-2009; W/43mm Silver Insert  
 Audi; S6; 2010; W/43mm Silver Insert  
 Audi; S6; 2011; W/43mm Silver Insert  
 Audi; S8; 2003; W/43mm Silver Insert  
 Audi; S8; 2004-2006; W/43mm Silver Insert  
 Audi; S8; 2007-2008; W/43mm Silver Insert  
 Audi; S8; 2009; W/43mm Silver Insert  
 Audi; S8; 2015; W/43mm Silver Insert  
 Bentley; Azure; 2007-2009; W/43mm Silver Insert  
 Bentley; Continental; 2003-2005; W/43mm Silver Insert  
 Bentley; Continental; 2006-2010; W/43mm Silver Insert  
 Bentley; Continental; 2012-2014; W/43mm Silver Insert  
 Bentley; Continental; 2015; W/43mm Silver Insert  
 Bentley; Mulsanne; 2011-2015; W/43mm Silver Insert  
 BMW; 1 Series; 2008-2011; W/43mm Silver Insert  
 BMW; 1 Series; 2012-2013; W/43mm Silver Insert  
 BMW; 228i; 2014  
 BMW; 228i; 2015  
 BMW; 320i; 2001-2002; W/43mm Silver Insert  
 BMW; 320i; 2003-2005; W/43mm Silver Insert  
 BMW; 320i; 2014  
 BMW; 320i xDrive; 2014  
 BMW; 323Ci; 2000; W/43mm Silver Insert  
 BMW; 323i; 2000; W/43mm Silver Insert  
 BMW; 323i; 2006; W/43mm Silver Insert; Jun. & Newer  
 BMW; 323i; 2007-2010; W/43mm Silver Insert  
 BMW; 325; 2001-2002; W/43mm Silver Insert  
 BMW; 325; 2003-2006; W/43mm Silver Insert  
 BMW; 328Ci; 2000; W/43mm Silver Insert  
 BMW; 328d; 2014  
 BMW; 328d xDrive; 2014

BMW; 328i; 2000; W/43mm Silver Insert  
 BMW; 328i; 2007-2009; W/43mm Silver Insert  
 BMW; 328i; 2010-2013; W/43mm Silver Insert  
 BMW; 328i; 2014; W/43mm Silver Insert  
 BMW; 328i; 2015; W/43mm Silver Insert  
 BMW; 328i GT xDrive; 2014; W/43mm Silver Insert  
 BMW; 328i GT xDrive; 2015; W/43mm Silver Insert  
 BMW; 328i xDrive; 2009; W/43mm Silver Insert  
 BMW; 328i xDrive; 2010-2013; W/43mm Silver Insert  
 BMW; 328i xDrive; 2014  
 BMW; 328i xDrive; 2015; W/43mm Silver Insert  
 BMW; 328xi; 2007-2008; W/43mm Silver Insert  
 BMW; 330; 2001-2002; W/43mm Silver Insert  
 BMW; 330; 2003-2006; W/43mm Silver Insert  
 BMW; 335d; 2009; W/43mm Silver Insert  
 BMW; 335d; 2010-2011; W/43mm Silver Insert  
 BMW; 335i; 2007-2009; W/43mm Silver Insert  
 BMW; 335i; 2010-2013; W/43mm Silver Insert  
 BMW; 335i; 2014  
 BMW; 335i GT xDrive; 2014; W/43mm Silver Insert  
 BMW; 335i GT xDrive; 2015; W/43mm Silver Insert  
 BMW; 335i xDrive; 2009; W/43mm Silver Insert  
 BMW; 335i xDrive; 2010-2013; W/43mm Silver Insert  
 BMW; 335i xDrive; 2014; W/43mm Silver Insert  
 BMW; 335i xDrive; 2015; W/43mm Silver Insert  
 BMW; 335is; 2012-2013; W/43mm Silver Insert  
 BMW; 335xi; 2007-2008; W/43mm Silver Insert  
 BMW; 428i; 2014; W/43mm Silver Insert  
 BMW; 428i xDrive; 2014; W/43mm Silver Insert  
 BMW; 428i xDrive; 2015; W/43mm Silver Insert  
 BMW; 435i; 2014; W/43mm Silver Insert  
 BMW; 435i; 2015; W/43mm Silver Insert  
 BMW; 435i; 2016; W/43mm Silver Insert  
 BMW; 435i xDrive; 2014; W/43mm Silver Insert  
 BMW; 435i xDrive; 2015; W/43mm Silver Insert  
 BMW; 525i; 2001; W/43mm Silver Insert  
 BMW; 525i; 2002; W/43mm Silver Insert  
 BMW; 525i; 2003-2005; W/43mm Silver Insert  
 BMW; 525i; 2006-2007; W/43mm Silver Insert  
 BMW; 525xi; 2006-2007; W/43mm Silver Insert  
 BMW; 528; 1997-1999; W/43mm Silver Insert  
 BMW; 528; 2000; W/43mm Silver Insert  
 BMW; 528; 2008-2011; W/43mm Silver Insert  
 BMW; 528; 2012-2014; W/43mm Silver Insert  
 BMW; 528; 2015-2016; W/43mm Silver Insert  
 BMW; 528xi; 2008; W/43mm Silver Insert  
 BMW; 530; 2001; W/43mm Silver Insert  
 BMW; 530; 2002; W/43mm Silver Insert  
 BMW; 530; 2003-2005; W/43mm Silver Insert  
 BMW; 530; 2006-2007; W/43mm Silver Insert  
 BMW; 535; 2008-2011; W/43mm Silver Insert  
 BMW; 535; 2012-2014; W/43mm Silver Insert  
 BMW; 535; 2015-2016; W/43mm Silver Insert  
 BMW; 535d; 2014; W/43mm Silver Insert  
 BMW; 535d; 2015-2016; W/43mm Silver Insert  
 BMW; 535d xDrive; 2014; W/43mm Silver Insert  
 BMW; 535d xDrive; 2015-2016; W/43mm Silver Insert  
 BMW; 535xi; 2008; W/43mm Silver Insert  
 BMW; 540i; 1997-1999; W/43mm Silver Insert  
 BMW; 540i; 2000; W/43mm Silver Insert  
 BMW; 540i; 2001; W/43mm Silver Insert  
 BMW; 540i; 2002; W/43mm Silver Insert  
 BMW; 540i; 2003; W/43mm Silver Insert  
 BMW; 545i; 2004-2005; W/43mm Silver Insert  
 BMW; 550; 2006-2011; W/43mm Silver Insert  
 BMW; 550; 2012-2014; W/43mm Silver Insert  
 BMW; 550; 2015-2016; W/43mm Silver Insert  
 BMW; 640; 2012-2015; W/43mm Silver Insert  
 BMW; 640; 2016  
 BMW; 645Ci; 2004-2005; W/43mm Silver Insert  
 BMW; 650; 2006-2010; W/43mm Silver Insert  
 BMW; 650; 2012-2015; W/43mm Silver Insert  
 BMW; 650; 2016  
 BMW; 650i Gran Coupe xDrive; 2016  
 BMW; 740i; 1997-1999; W/43mm Silver Insert




# Numerical Listing

BMW; 740i; 2000-2001; W/43mm Silver Insert	Mercedes-Benz; S500; 2002-2006; W/43mm Silver Insert
BMW; 740i; 2011; W/43mm Silver Insert	Mercedes-Benz; S55 AMG; 2001-2006; W/43mm Silver Insert
BMW; 740i; 2012-2015; W/43mm Silver Insert	Mercedes-Benz; S600; 2001-2006; W/43mm Silver Insert
BMW; 740iL; 1997-1999; W/43mm Silver Insert	Mercedes-Benz; S65 AMG; 2006; W/43mm Silver Insert
BMW; 740iL; 2000; W/43mm Silver Insert	Mercedes-Benz; SL500; 2000-2005; W/43mm Silver Insert
BMW; 740iL; 2001; W/43mm Silver Insert	Mercedes-Benz; SL55 AMG; 2003; W/43mm Silver Insert
BMW; 740Li; 2011; W/43mm Silver Insert	Mercedes-Benz; SL55 AMG; 2004; W/43mm Silver Insert
BMW; 740Li; 2012-2015; W/43mm Silver Insert	Mercedes-Benz; SL55 AMG; 2005; W/43mm Silver Insert
BMW; 740Li xDrive; 2013-2015; W/43mm Silver Insert	Mercedes-Benz; SL600; 2001-2002; W/43mm Silver Insert
BMW; 745; 2002; W/43mm Silver Insert	Mercedes-Benz; SL600; 2004-2005; W/43mm Silver Insert
BMW; 745; 2003; W/43mm Silver Insert	Mercedes-Benz; SL65 AMG; 2005; W/43mm Silver Insert
BMW; 745; 2004-2005; W/43mm Silver Insert	Mercedes-Benz; SLR McLaren; 2004; W/43mm Silver Insert
BMW; 750; 2006-2011; W/43mm Silver Insert	Mercedes-Benz; SLR McLaren; 2005; W/43mm Silver Insert
BMW; 750; 2012-2015; W/43mm Silver Insert	Mercedes-Benz; SLR McLaren; 2006; W/43mm Silver Insert
BMW; 750iL; 1997-1999; W/43mm Silver Insert	Mercedes-Benz; SLR McLaren; 2007; W/43mm Silver Insert
BMW; 750iL; 2000; W/43mm Silver Insert	Mini; Cooper; 2008-2009; W/43mm Silver Insert
BMW; 750iL; 2001; W/43mm Silver Insert	Mini; Cooper; 2010-2013; W/43mm Silver Insert
BMW; 760i; 2004-2005; W/43mm Silver Insert	Mini; Cooper; 2014; W/43mm Silver Insert
BMW; 760i; 2006; W/43mm Silver Insert	Mini; Cooper; 2015; W/43mm Silver Insert
BMW; 760Li; 2003; W/43mm Silver Insert	Porsche; 911; 2005-2006; W/43mm Silver Insert
BMW; 760Li; 2004-2008; W/43mm Silver Insert	Porsche; 911; 2007-2009; W/43mm Silver Insert
BMW; 760Li; 2010-2011; W/43mm Silver Insert	Porsche; 911; 2010; W/43mm Silver Insert
BMW; 760Li; 2012-2015; W/43mm Silver Insert	Porsche; 911; 2011; W/43mm Silver Insert
BMW; ActiveHybrid 3; 2013-2014; W/43mm Silver Insert	Porsche; 911; 2012; W/43mm Silver Insert
BMW; ActiveHybrid 5; 2012-2014; W/43mm Silver Insert	Porsche; 911; 2013-2014; W/43mm Silver Insert
BMW; ActiveHybrid 5; 2015; W/43mm Silver Insert	Porsche; 911; 2015; W/43mm Silver Insert
BMW; ActiveHybrid 7; 2013-2015; W/43mm Silver Insert	Porsche; Boxster; 2005-2007; W/43mm Silver Insert
BMW; Alpina B7; 2007-2008; W/43mm Silver Insert	Porsche; Boxster; 2008-2010; W/43mm Silver Insert
BMW; Alpina B7; 2011; W/43mm Silver Insert	Porsche; Boxster; 2011; W/43mm Silver Insert
BMW; Alpina B7; 2012-2014; W/43mm Silver Insert	Porsche; Boxster; 2012-2013; W/43mm Silver Insert
BMW; Alpina B7 xDrive; 2011; W/43mm Silver Insert	Porsche; Boxster; 2014-2016; W/43mm Silver Insert
BMW; Alpina B7L; 2011; W/43mm Silver Insert	Porsche; Carrera GT; 2004-2005; W/43mm Silver Insert
BMW; Alpina B7L xDrive; 2011; W/43mm Silver Insert	Porsche; Cayenne; 2003-2006; W/43mm Silver Insert
BMW; M; 2000-2001; W/43mm Silver Insert	Porsche; Cayenne; 2008-2010; W/43mm Silver Insert
BMW; M; 2002; W/43mm Silver Insert	Porsche; Cayenne; 2011-2013; W/43mm Silver Insert
BMW; M; 2003; W/43mm Silver Insert	Porsche; Cayenne; 2014; W/43mm Silver Insert
BMW; M; 2004-2010; W/43mm Silver Insert	Porsche; Cayman; 2006-2007; W/43mm Silver Insert
BMW; M; 2011-2013; W/43mm Silver Insert	Porsche; Cayman; 2008-2010; W/43mm Silver Insert
BMW; M; 2014; W/43mm Silver Insert	Porsche; Cayman; 2011; W/43mm Silver Insert
BMW; M; 2015; W/43mm Silver Insert	Porsche; Cayman; 2012-2016; W/43mm Silver Insert
BMW; X; 2000-2003; W/43mm Silver Insert	Porsche; Panamera; 2010; W/43mm Silver Insert
BMW; X; 2004; W/43mm Silver Insert	Porsche; Panamera; 2011; W/43mm Silver Insert
BMW; X; 2005-2011; W/43mm Silver Insert	Rolls Royce; Phantom; 2007-2010; W/43mm Silver Insert
BMW; X; 2012-2014; W/43mm Silver Insert	Volkswagen; Phaeton; 2004-2006; W/43mm Silver Insert; W/315 MHz Sensor
BMW; X; 2015; W/43mm Silver Insert	Volkswagen; Touareg; 2004-2006; W/43mm Silver Insert
BMW; X; 2016; W/43mm Silver Insert	Volkswagen; Touareg; 2007; W/43mm Silver Insert
BMW; Z3; 2000-2002; W/43mm Silver Insert	Volkswagen; Touareg; 2008-2009; W/43mm Silver Insert
BMW; Z4; 2003-2011; W/43mm Silver Insert	Volkswagen; Touareg; 2010; W/43mm Silver Insert
BMW; Z4; 2012-2015; W/43mm Silver Insert	Volkswagen; Touareg; 2011-2013; W/43mm Silver Insert; W/315 MHz Sensor
BMW; Z4; 2016; W/43mm Silver Insert	Volkswagen; Touareg; 2014; W/43mm Silver Insert; W/315 MHz Sensor
BMW; Z8; 2000-2002; W/43mm Silver Insert	
BMW; Z8; 2003; W/43mm Silver Insert	
Bugatti; Veyron 16.4; 2006; W/43mm Silver Insert	
Ferrari; 612 Scaglietti; 2005-2009; W/43mm Silver Insert	
Ferrari; Enzo; 2003-2004; W/43mm Silver Insert	
Ferrari; F430; 2006-2009; W/43mm Silver Insert	
Ferrari; Maranello; 2001-2005; W/43mm Silver Insert	
Land Rover; LR3; 2002-2005; W/43mm Silver Insert	
Land Rover; Range Rover; 2002; W/43mm Silver Insert	
Land Rover; Range Rover; 2003-2005; W/43mm Silver Insert	
Maserati; Coupe; 2004-2006; W/43mm Silver Insert	
Maserati; GranTurismo; 2014; W/43mm Silver Insert	
Maserati; Quattroporte; 2004-2008; W/43mm Silver Insert	
Maserati; Spyder; 2004-2006; W/43mm Silver Insert	
Mercedes-Benz; C Series; 2001-2006; W/43mm Silver Insert	
Mercedes-Benz; CL; 2000-2006; W/43mm Silver Insert	
Mercedes-Benz; E320; 2001-2005; W/43mm Silver Insert	
Mercedes-Benz; E430; 2001-2002; W/43mm Silver Insert	
Mercedes-Benz; E500; 2003-2005; W/43mm Silver Insert	
Mercedes-Benz; E55 AMG; 1999; W/43mm Silver Insert; Jul. & Newer	
Mercedes-Benz; E55 AMG; 2000-2005; W/43mm Silver Insert	
Mercedes-Benz; S Series; 2006; W/43mm Silver Insert	
Mercedes-Benz; S430; 2000-2006; W/43mm Silver Insert	
Mercedes-Benz; S500; 2000; W/43mm Silver Insert	
Mercedes-Benz; S500; 2001; W/43mm Silver Insert	



# Numerical Listing

<p style="text-align: center;"><b>Service Pack</b> <b>20038 (W/48mm Green Insert)</b></p>	
	<p>BMW; 328i; 2000; W/48mm Green Insert            BMW; 328i; 2007-2009; W/48mm Green Insert            BMW; 328i; 2010-2013; W/48mm Green Insert            BMW; 328i; 2014; W/48mm Green Insert            BMW; 328i; 2015; W/48mm Green Insert            BMW; 328i GT xDrive; 2014            BMW; 328i GT xDrive; 2015; W/48mm Green Insert            BMW; 328i xDrive; 2009; W/48mm Green Insert            BMW; 328i xDrive; 2010-2013; W/48mm Green Insert            BMW; 328i xDrive; 2014; W/48mm Green Insert            BMW; 328i xDrive; 2015; W/48mm Green Insert            BMW; 328xi; 2007-2008; W/48mm Green Insert            BMW; 330; 2001-2002; W/48mm Green Insert            BMW; 330; 2003-2006; W/48mm Green Insert            BMW; 335d; 2009; W/48mm Green Insert            BMW; 335d; 2010-2011; W/48mm Green Insert            BMW; 335i; 2007-2009; W/48mm Green Insert            BMW; 335i; 2010-2013; W/48mm Green Insert            BMW; 335i; 2014; W/48mm Green Insert            BMW; 335i GT xDrive; 2014; W/48mm Green Insert            BMW; 335i GT xDrive; 2015; W/48mm Green Insert            BMW; 335i xDrive; 2009; W/48mm Green Insert            BMW; 335i xDrive; 2010-2013; W/48mm Green Insert            BMW; 335i xDrive; 2014; W/48mm Green Insert            BMW; 335i xDrive; 2015; W/48mm Green Insert            BMW; 335is; 2012-2013; W/48mm Green Insert            BMW; 335xi; 2007-2008; W/48mm Green Insert            BMW; 428i; 2014; W/48mm Green Insert            BMW; 428i xDrive; 2014; W/48mm Green Insert            BMW; 428i xDrive; 2015; W/48mm Green Insert            BMW; 435i; 2014; W/48mm Green Insert            BMW; 435i; 2015; W/48mm Green Insert            BMW; 435i; 2016; W/48mm Green Insert            BMW; 435i xDrive; 2014; W/48mm Green Insert            BMW; 435i xDrive; 2015; W/48mm Green Insert            BMW; 525i; 2001; W/48mm Green Insert            BMW; 525i; 2002; W/48mm Green Insert            BMW; 525i; 2003-2005; W/48mm Green Insert            BMW; 525i; 2006-2007; W/48mm Green Insert            BMW; 525xi; 2006-2007; W/48mm Green Insert            BMW; 528; 1997-1999; W/48mm Green Insert            BMW; 528; 2000; W/48mm Green Insert            BMW; 528; 2008-2011; W/48mm Green Insert            BMW; 528; 2012-2014; W/48mm Green Insert            BMW; 528; 2015-2016; W/48mm Green Insert            BMW; 528xi; 2008; W/48mm Green Insert            BMW; 530; 2001; W/48mm Green Insert            BMW; 530; 2002; W/48mm Green Insert            BMW; 530; 2003-2005; W/48mm Green Insert            BMW; 530; 2006-2007; W/48mm Green Insert            BMW; 535; 2008-2011; W/48mm Green Insert            BMW; 535; 2012-2014; W/48mm Green Insert            BMW; 535; 2015-2016; W/48mm Green Insert            BMW; 535d; 2014; W/48mm Green Insert            BMW; 535d; 2015-2016; W/48mm Green Insert            BMW; 535d xDrive; 2014; W/48mm Green Insert            BMW; 535d xDrive; 2015-2016; W/48mm Green Insert            BMW; 535xi; 2008; W/48mm Green Insert            BMW; 540i; 1997-1999; W/48mm Green Insert            BMW; 540i; 2000; W/48mm Green Insert            BMW; 540i; 2001; W/48mm Green Insert            BMW; 540i; 2002; W/48mm Green Insert            BMW; 540i; 2003; W/48mm Green Insert            BMW; 545i; 2004-2005; W/48mm Green Insert            BMW; 550; 2006-2011; W/48mm Green Insert            BMW; 550; 2012-2014; W/48mm Green Insert            BMW; 550; 2015-2016; W/48mm Green Insert            BMW; 640; 2012-2015; W/48mm Green Insert            BMW; 640; 2016            BMW; 645Ci; 2004-2005; W/48mm Green Insert            BMW; 650; 2006-2010; W/48mm Green Insert            BMW; 650; 2012-2015; W/48mm Green Insert            BMW; 650; 2016            BMW; 650i Gran Coupe xDrive; 2016            BMW; 740i; 1997-1999; W/48mm Green Insert</p>

# Numerical Listing

BMW; 740i; 2000-2001; W/48mm Green Insert	Mercedes-Benz; S500; 2002-2006; W/48mm Green Insert
BMW; 740i; 2011; W/48mm Green Insert	Mercedes-Benz; S55 AMG; 2001-2006; W/48mm Green Insert
BMW; 740i; 2012-2015; W/48mm Green Insert	Mercedes-Benz; S600; 2001-2006; W/48mm Green Insert
BMW; 740iL; 1997-1999; W/48mm Green Insert	Mercedes-Benz; S65 AMG; 2006; W/48mm Green Insert
BMW; 740iL; 2000; W/48mm Green Insert	Mercedes-Benz; SL500; 2000-2005; W/48mm Green Insert
BMW; 740iL; 2001; W/48mm Green Insert	Mercedes-Benz; SL55 AMG; 2003; W/48mm Green Insert
BMW; 740Li; 2011; W/48mm Green Insert	Mercedes-Benz; SL55 AMG; 2004; W/48mm Green Insert
BMW; 740Li; 2012-2015; W/48mm Green Insert	Mercedes-Benz; SL55 AMG; 2005; W/48mm Green Insert
BMW; 740Li xDrive; 2013-2015; W/48mm Green Insert	Mercedes-Benz; SL600; 2001-2002; W/48mm Green Insert
BMW; 745; 2002; W/48mm Green Insert	Mercedes-Benz; SL600; 2004-2005; W/48mm Green Insert
BMW; 745; 2003; W/48mm Green Insert	Mercedes-Benz; SL65 AMG; 2005; W/48mm Green Insert
BMW; 745; 2004-2005; W/48mm Green Insert	Mercedes-Benz; SLR McLaren; 2004; W/48mm Green Insert
BMW; 750; 2006-2011; W/48mm Green Insert	Mercedes-Benz; SLR McLaren; 2005; W/48mm Green Insert
BMW; 750; 2012-2015; W/48mm Green Insert	Mercedes-Benz; SLR McLaren; 2006; W/48mm Green Insert
BMW; 750iL; 1997-1999; W/48mm Green Insert	Mercedes-Benz; SLR McLaren; 2007; W/48mm Green Insert
BMW; 750iL; 2000; W/48mm Green Insert	Mini; Cooper; 2008-2009; W/48mm Green Insert
BMW; 750iL; 2001; W/48mm Green Insert	Mini; Cooper; 2010-2013; W/48mm Green Insert
BMW; 760i; 2004-2005; W/48mm Green Insert	Mini; Cooper; 2014; W/48mm Green Insert
BMW; 760i; 2006; W/48mm Green Insert	Mini; Cooper; 2015; W/48mm Green Insert
BMW; 760Li; 2003; W/48mm Green Insert	Porsche; 911; 2005-2006; W/48mm Green Insert
BMW; 760Li; 2004-2008; W/48mm Green Insert	Porsche; 911; 2007-2009; W/48mm Green Insert
BMW; 760Li; 2010-2011; W/48mm Green Insert	Porsche; 911; 2010; W/48mm Green Insert
BMW; 760Li; 2012-2015; W/48mm Green Insert	Porsche; 911; 2011; W/48mm Green Insert
BMW; ActiveHybrid 3; 2013-2014; W/48mm Green Insert	Porsche; 911; 2012; W/48mm Green Insert
BMW; ActiveHybrid 5; 2012-2014; W/48mm Green Insert	Porsche; 911; 2013-2014; W/48mm Green Insert
BMW; ActiveHybrid 5; 2015; W/48mm Green Insert	Porsche; 911; 2015; W/48mm Green Insert
BMW; ActiveHybrid 7; 2013-2015; W/48mm Green Insert	Porsche; Boxster; 2005-2007; W/48mm Green Insert
BMW; Alpina B7; 2007-2008; W/48mm Green Insert	Porsche; Boxster; 2008-2010; W/48mm Green Insert
BMW; Alpina B7; 2011; W/48mm Green Insert	Porsche; Boxster; 2011; W/48mm Green Insert
BMW; Alpina B7; 2012-2014; W/48mm Green Insert	Porsche; Boxster; 2012-2013; W/48mm Green Insert
BMW; Alpina B7 xDrive; 2011; W/48mm Green Insert	Porsche; Boxster; 2014-2016; W/48mm Green Insert
BMW; Alpina B7L; 2011; W/48mm Green Insert	Porsche; Carrera GT; 2004-2005; W/48mm Green Insert
BMW; Alpina B7L xDrive; 2011; W/48mm Green Insert	Porsche; Cayenne; 2003-2006; W/48mm Green Insert
BMW; M; 2000-2001; W/48mm Green Insert	Porsche; Cayenne; 2008-2010; W/48mm Green Insert
BMW; M; 2002; W/48mm Green Insert	Porsche; Cayenne; 2011-2013; W/48mm Green Insert
BMW; M; 2003; W/48mm Green Insert	Porsche; Cayenne; 2014; W/48mm Green Insert
BMW; M; 2004-2010; W/48mm Green Insert	Porsche; Cayman; 2006-2007; W/48mm Green Insert
BMW; M; 2011-2013; W/48mm Green Insert	Porsche; Cayman; 2008-2010; W/48mm Green Insert
BMW; M; 2014; W/48mm Green Insert	Porsche; Cayman; 2011; W/48mm Green Insert
BMW; M; 2015; W/48mm Green Insert	Porsche; Cayman; 2012-2016; W/48mm Green Insert
BMW; X; 2000-2003; W/48mm Green Insert	Porsche; Panamera; 2010; W/48mm Green Insert
BMW; X; 2004; W/48mm Green Insert	Porsche; Panamera; 2011; W/48mm Green Insert
BMW; X; 2005-2011; W/48mm Green Insert	Rolls Royce; Phantom; 2007-2010; W/48mm Green Insert
BMW; X; 2012-2014; W/48mm Green Insert	Volkswagen; Phaeton; 2004-2006; W/48mm Green Insert; W/315 MHz Sensor
BMW; X; 2015; W/48mm Green Insert	Volkswagen; Touareg; 2004-2006; W/48mm Green Insert
BMW; X; 2016; W/48mm Green Insert	Volkswagen; Touareg; 2007; W/48mm Green Insert
BMW; Z3; 2000-2002; W/48mm Green Insert	Volkswagen; Touareg; 2008-2009; W/48mm Green Insert
BMW; Z4; 2003-2011; W/48mm Green Insert	Volkswagen; Touareg; 2010; W/48mm Green Insert
BMW; Z4; 2012-2015; W/48mm Green Insert	Volkswagen; Touareg; 2011-2013; W/48mm Green Insert; W/315 MHz Sensor
BMW; Z4; 2016; W/48mm Green Insert	Volkswagen; Touareg; 2014; W/48mm Green Insert; W/315 MHz Sensor
BMW; Z8; 2000-2002; W/48mm Green Insert	
BMW; Z8; 2003; W/48mm Green Insert	
Bugatti; Veyron 16.4; 2006; W/48mm Green Insert	
Ferrari; 612 Scaglietti; 2005-2009; W/48mm Green Insert	
Ferrari; Enzo; 2003-2004; W/48mm Green Insert	
Ferrari; F430; 2006-2009; W/48mm Green Insert	
Ferrari; Maranello; 2001-2005; W/48mm Green Insert	
Land Rover; LR3; 2002-2005; W/48mm Green Insert	
Land Rover; Range Rover; 2002; W/48mm Green Insert	
Land Rover; Range Rover; 2003-2005; W/48mm Green Insert	
Maserati; Coupe; 2004-2006; W/48mm Green Insert	
Maserati; GranTurismo; 2014; W/48mm Green Insert	
Maserati; Quattroporte; 2004-2008; W/48mm Green Insert	
Maserati; Spyder; 2004-2006; W/48mm Green Insert	
Mercedes-Benz; C Series; 2001-2006; W/48mm Green Insert	
Mercedes-Benz; CL; 2000-2006; W/48mm Green Insert	
Mercedes-Benz; E320; 2001-2005; W/48mm Green Insert	
Mercedes-Benz; E430; 2001-2002; W/48mm Green Insert	
Mercedes-Benz; E500; 2003-2005; W/48mm Green Insert	
Mercedes-Benz; E55 AMG; 1999; W/48mm Green Insert; Jul. & Newer	
Mercedes-Benz; E55 AMG; 2000-2005; W/48mm Green Insert	
Mercedes-Benz; S Series; 2006; W/48mm Green Insert	
Mercedes-Benz; S430; 2000-2006; W/48mm Green Insert	
Mercedes-Benz; S500; 2000; W/48mm Green Insert	
Mercedes-Benz; S500; 2001; W/48mm Green Insert	

# Numerical Listing

## Service Pack

### 20039 (W/49mm Black Insert)



Audi; A3, A4, A5 & Quattro; 2002-2007; W/49mm Black Insert  
 Audi; A3, A4, A5 & Quattro; 2008; W/49mm Black Insert  
 Audi; A6; 2002-2004; W/49mm Black Insert  
 Audi; A6; 2006-2008; W/49mm Black Insert  
 Audi; A6; 2009; W/49mm Black Insert  
 Audi; A6; 2010; W/49mm Black Insert  
 Audi; A6; 2011; W/49mm Black Insert  
 Audi; A6 Quattro; 2006-2008; W/49mm Black Insert  
 Audi; A6 Quattro; 2010; W/49mm Black Insert  
 Audi; A6 Quattro; 2011; W/49mm Black Insert  
 Audi; A8; 2000; W/49mm Black Insert  
 Audi; A8 Quattro; 2000-2002; W/49mm Black Insert  
 Audi; A8 Quattro; 2003; W/49mm Black Insert  
 Audi; A8 Quattro; 2004-2011; W/49mm Black Insert  
 Audi; Allroad Quattro; 2001-2005; W/49mm Black Insert  
 Audi; Q7; 2007-2009; W/49mm Black Insert  
 Audi; Q7; 2010; W/49mm Black Insert  
 Audi; Q7; 2011; W/49mm Black Insert  
 Audi; Q7; 2012; W/49mm Black Insert  
 Audi; R8; 2008-2009; W/49mm Black Insert  
 Audi; R8; 2010; W/49mm Black Insert  
 Audi; R8; 2011; W/49mm Black Insert  
 Audi; R8; 2012; W/49mm Black Insert  
 Audi; R8; 2014-2015; W/49mm Black Insert  
 Audi; RS4; 2007-2008; W/49mm Black Insert  
 Audi; RS6; 2003; W/49mm Black Insert  
 Audi; RS7; 2014-2016; W/49mm Black Insert  
 Audi; S4; 2002; W/49mm Black Insert  
 Audi; S4; 2004-2009; W/49mm Black Insert  
 Audi; S6; 2007-2009; W/49mm Black Insert  
 Audi; S6; 2010; W/49mm Black Insert  
 Audi; S6; 2011; W/49mm Black Insert  
 Audi; S8; 2003; W/49mm Black Insert  
 Audi; S8; 2004-2006; W/49mm Black Insert  
 Audi; S8; 2007-2008; W/49mm Black Insert  
 Audi; S8; 2009; W/49mm Black Insert  
 Audi; S8; 2015; W/49mm Black Insert  
 Bentley; Azure; 2007-2009; W/49mm Black Insert  
 Bentley; Continental; 2003-2005; W/49mm Black Insert  
 Bentley; Continental; 2006-2010; W/49mm Black Insert  
 Bentley; Continental; 2012-2014; W/49mm Black Insert  
 Bentley; Continental; 2015; W/49mm Black Insert  
 Bentley; Mulsanne; 2011-2015; W/49mm Black Insert  
 BMW; 1 Series; 2008-2011; W/49mm Black Insert  
 BMW; 1 Series; 2012-2013; W/49mm Black Insert  
 BMW; 228i; 2014  
 BMW; 228i; 2015  
 BMW; 320i; 2001-2002; W/49mm Black Insert  
 BMW; 320i; 2003-2005; W/49mm Black Insert  
 BMW; 320i; 2014  
 BMW; 320i xDrive; 2014  
 BMW; 323Ci; 2000; W/49mm Black Insert  
 BMW; 323i; 2000; W/49mm Black Insert  
 BMW; 323i; 2006; W/49mm Black Insert; Jun. & Newer  
 BMW; 323i; 2007-2010; W/49mm Black Insert  
 BMW; 325; 2001-2002; W/49mm Black Insert  
 BMW; 325; 2003-2006; W/49mm Black Insert  
 BMW; 328Ci; 2000; W/49mm Black Insert  
 BMW; 328d; 2014  
 BMW; 328d xDrive; 2014

BMW; 328i; 2000; W/49mm Black Insert  
 BMW; 328i; 2007-2009; W/49mm Black Insert  
 BMW; 328i; 2010-2013; W/49mm Black Insert  
 BMW; 328i; 2014; W/49mm Black Insert  
 BMW; 328i; 2015; W/49mm Black Insert  
 BMW; 328i GT xDrive; 2014  
 BMW; 328i GT xDrive; 2015; W/49mm Black Insert  
 BMW; 328i xDrive; 2009; W/49mm Black Insert  
 BMW; 328i xDrive; 2010-2013; W/49mm Black Insert  
 BMW; 328i xDrive; 2014; W/49mm Black Insert  
 BMW; 328i xDrive; 2015; W/49mm Black Insert  
 BMW; 328xi; 2007-2008; W/49mm Black Insert  
 BMW; 330; 2001-2002; W/49mm Black Insert  
 BMW; 330; 2003-2006; W/49mm Black Insert  
 BMW; 335d; 2009; W/49mm Black Insert  
 BMW; 335d; 2010-2011; W/49mm Black Insert  
 BMW; 335i; 2007-2009; W/49mm Black Insert  
 BMW; 335i; 2010-2013; W/49mm Black Insert  
 BMW; 335i; 2014; W/49mm Black Insert  
 BMW; 335i GT xDrive; 2014; W/49mm Black Insert  
 BMW; 335i GT xDrive; 2015; W/49mm Black Insert  
 BMW; 335i xDrive; 2009; W/49mm Black Insert  
 BMW; 335i xDrive; 2010-2013; W/49mm Black Insert  
 BMW; 335i xDrive; 2014; W/49mm Black Insert  
 BMW; 335i xDrive; 2015; W/49mm Black Insert  
 BMW; 335is; 2012-2013; W/49mm Black Insert  
 BMW; 335xi; 2007-2008; W/49mm Black Insert  
 BMW; 428i; 2014; W/49mm Black Insert  
 BMW; 428i xDrive; 2014; W/49mm Black Insert  
 BMW; 428i xDrive; 2015; W/49mm Black Insert  
 BMW; 435i; 2014; W/49mm Black Insert  
 BMW; 435i; 2015; W/49mm Black Insert  
 BMW; 435i; 2016; W/49mm Black Insert  
 BMW; 435i xDrive; 2014; W/49mm Black Insert  
 BMW; 435i xDrive; 2015; W/49mm Black Insert  
 BMW; 525i; 2001; W/49mm Black Insert  
 BMW; 525i; 2002; W/49mm Black Insert  
 BMW; 525i; 2003-2005; W/49mm Black Insert  
 BMW; 525i; 2006-2007; W/49mm Black Insert  
 BMW; 525xi; 2006-2007; W/49mm Black Insert  
 BMW; 528; 1997-1999; W/49mm Black Insert  
 BMW; 528; 2000; W/49mm Black Insert  
 BMW; 528; 2008-2011; W/49mm Black Insert  
 BMW; 528; 2012-2014; W/49mm Black Insert  
 BMW; 528; 2015-2016; W/49mm Black Insert  
 BMW; 528xi; 2008; W/49mm Black Insert  
 BMW; 530; 2001; W/49mm Black Insert  
 BMW; 530; 2002; W/49mm Black Insert  
 BMW; 530; 2003-2005; W/49mm Black Insert  
 BMW; 530; 2006-2007; W/49mm Black Insert  
 BMW; 535; 2008-2011; W/49mm Black Insert  
 BMW; 535; 2012-2014; W/49mm Black Insert  
 BMW; 535; 2015-2016; W/49mm Black Insert  
 BMW; 535d; 2014; W/49mm Black Insert  
 BMW; 535d; 2015-2016; W/49mm Black Insert  
 BMW; 535d xDrive; 2014; W/49mm Black Insert  
 BMW; 535d xDrive; 2015-2016; W/49mm Black Insert  
 BMW; 535xi; 2008; W/49mm Black Insert  
 BMW; 540i; 1997-1999; W/49mm Black Insert  
 BMW; 540i; 2000; W/49mm Black Insert  
 BMW; 540i; 2001; W/49mm Black Insert  
 BMW; 540i; 2002; W/49mm Black Insert  
 BMW; 540i; 2003; W/49mm Black Insert  
 BMW; 545i; 2004-2005; W/49mm Black Insert  
 BMW; 550; 2006-2011; W/49mm Black Insert  
 BMW; 550; 2012-2014; W/49mm Black Insert  
 BMW; 550; 2015-2016; W/49mm Black Insert  
 BMW; 640; 2012-2015; W/49mm Black Insert  
 BMW; 640; 2016  
 BMW; 645Ci; 2004-2005; W/49mm Black Insert  
 BMW; 650; 2006-2010; W/49mm Black Insert  
 BMW; 650; 2012-2015; W/49mm Black Insert  
 BMW; 650; 2016  
 BMW; 650i Gran Coupe xDrive; 2016  
 BMW; 740i; 1997-1999; W/49mm Black Insert

# Numerical Listing

BMW; 740i; 2000-2001; W/49mm Black Insert	Mercedes-Benz; S500; 2002-2006; W/49mm Black Insert
BMW; 740i; 2011; W/49mm Black Insert	Mercedes-Benz; S55 AMG; 2001-2006; W/49mm Black Insert
BMW; 740i; 2012-2015; W/49mm Black Insert	Mercedes-Benz; S600; 2001-2006; W/49mm Black Insert
BMW; 740iL; 1997-1999; W/49mm Black Insert	Mercedes-Benz; S65 AMG; 2006; W/49mm Black Insert
BMW; 740iL; 2000; W/49mm Black Insert	Mercedes-Benz; SL500; 2000-2005; W/49mm Black Insert
BMW; 740iL; 2001; W/49mm Black Insert	Mercedes-Benz; SL55 AMG; 2003; W/49mm Black Insert
BMW; 740Li; 2011; W/49mm Black Insert	Mercedes-Benz; SL55 AMG; 2004; W/49mm Black Insert
BMW; 740Li; 2012-2015; W/49mm Black Insert	Mercedes-Benz; SL55 AMG; 2005; W/49mm Black Insert
BMW; 740Li xDrive; 2013-2015; W/49mm Black Insert	Mercedes-Benz; SL600; 2001-2002; W/49mm Black Insert
BMW; 745; 2002; W/49mm Black Insert	Mercedes-Benz; SL600; 2004-2005; W/49mm Black Insert
BMW; 745; 2003; W/49mm Black Insert	Mercedes-Benz; SL65 AMG; 2005; W/49mm Black Insert
BMW; 745; 2004-2005; W/49mm Black Insert	Mercedes-Benz; SLR McLaren; 2004; W/49mm Black Insert
BMW; 750; 2006-2011; W/49mm Black Insert	Mercedes-Benz; SLR McLaren; 2005; W/49mm Black Insert
BMW; 750; 2012-2015; W/49mm Black Insert	Mercedes-Benz; SLR McLaren; 2006; W/49mm Black Insert
BMW; 750iL; 1997-1999; W/49mm Black Insert	Mercedes-Benz; SLR McLaren; 2007; W/49mm Black Insert
BMW; 750iL; 2000; W/49mm Black Insert	Mini; Cooper; 2008-2009; W/49mm Black Insert
BMW; 750iL; 2001; W/49mm Black Insert	Mini; Cooper; 2010-2013; W/49mm Black Insert
BMW; 760i; 2004-2005; W/49mm Black Insert	Mini; Cooper; 2014; W/49mm Black Insert
BMW; 760i; 2006; W/49mm Black Insert	Mini; Cooper; 2015; W/49mm Black Insert
BMW; 760Li; 2003; W/49mm Black Insert	Porsche; 911; 2005-2006; W/49mm Black Insert
BMW; 760Li; 2004-2008; W/49mm Black Insert	Porsche; 911; 2007-2009; W/49mm Black Insert
BMW; 760Li; 2010-2011; W/49mm Black Insert	Porsche; 911; 2010; W/49mm Black Insert
BMW; 760Li; 2012-2015; W/49mm Black Insert	Porsche; 911; 2011; W/49mm Black Insert
BMW; ActiveHybrid 3; 2013-2014; W/49mm Black Insert	Porsche; 911; 2012; W/49mm Black Insert
BMW; ActiveHybrid 5; 2012-2014; W/49mm Black Insert	Porsche; 911; 2013-2014; W/49mm Black Insert
BMW; ActiveHybrid 5; 2015; W/49mm Black Insert	Porsche; 911; 2015; W/49mm Black Insert
BMW; ActiveHybrid 7; 2013-2015; W/49mm Black Insert	Porsche; Boxster; 2005-2007; W/49mm Black Insert
BMW; Alpina B7; 2007-2008; W/49mm Black Insert	Porsche; Boxster; 2008-2010; W/49mm Black Insert
BMW; Alpina B7; 2011; W/49mm Black Insert	Porsche; Boxster; 2011; W/49mm Black Insert
BMW; Alpina B7; 2012-2014; W/49mm Black Insert	Porsche; Boxster; 2012-2013; W/49mm Black Insert
BMW; Alpina B7 xDrive; 2011; W/49mm Black Insert	Porsche; Boxster; 2014-2016; W/49mm Black Insert
BMW; Alpina B7L; 2011; W/49mm Black Insert	Porsche; Carrera GT; 2004-2005; W/49mm Black Insert
BMW; Alpina B7L xDrive; 2011; W/49mm Black Insert	Porsche; Cayenne; 2003-2006; W/49mm Black Insert
BMW; M; 2000-2001; W/49mm Black Insert	Porsche; Cayenne; 2008-2010; W/49mm Black Insert
BMW; M; 2002; W/49mm Black Insert	Porsche; Cayenne; 2011-2013; W/49mm Black Insert
BMW; M; 2003; W/49mm Black Insert	Porsche; Cayenne; 2014; W/49mm Black Insert
BMW; M; 2004-2010; W/49mm Black Insert	Porsche; Cayman; 2006-2007; W/49mm Black Insert
BMW; M; 2011-2013; W/49mm Black Insert	Porsche; Cayman; 2008-2010; W/49mm Black Insert
BMW; M; 2014; W/49mm Black Insert	Porsche; Cayman; 2011; W/49mm Black Insert
BMW; M; 2015; W/49mm Black Insert	Porsche; Cayman; 2012-2016; W/49mm Black Insert
BMW; X; 2000-2003; W/49mm Black Insert	Porsche; Panamera; 2010; W/49mm Black Insert
BMW; X; 2004; W/49mm Black Insert	Porsche; Panamera; 2011; W/49mm Black Insert
BMW; X; 2005-2011; W/49mm Black Insert	Rolls Royce; Phantom; 2007-2010; W/49mm Black Insert
BMW; X; 2012-2014; W/49mm Black Insert	Volkswagen; Phaeton; 2004-2006; W/49mm Black Insert; W/315 MHz Sensor
BMW; X; 2015; W/49mm Black Insert	Volkswagen; Touareg; 2004-2006; W/49mm Black Insert
BMW; X; 2016; W/49mm Black Insert	Volkswagen; Touareg; 2007; W/49mm Black Insert
BMW; Z3; 2000-2002; W/49mm Black Insert	Volkswagen; Touareg; 2008-2009; W/49mm Black Insert
BMW; Z4; 2003-2011; W/49mm Black Insert	Volkswagen; Touareg; 2010; W/49mm Black Insert
BMW; Z4; 2012-2015; W/49mm Black Insert	Volkswagen; Touareg; 2011-2013; W/49mm Black Insert; W/315 MHz Sensor
BMW; Z4; 2016; W/49mm Black Insert	Volkswagen; Touareg; 2014; W/49mm Black Insert; W/315 MHz Sensor
BMW; Z8; 2000-2002; W/49mm Black Insert	
BMW; Z8; 2003; W/49mm Black Insert	
Bugatti; Veyron 16.4; 2006; W/49mm Black Insert	
Ferrari; 612 Scaglietti; 2005-2009; W/49mm Black Insert	
Ferrari; Enzo; 2003-2004; W/49mm Black Insert	
Ferrari; F430; 2006-2009; W/49mm Black Insert	
Ferrari; Maranello; 2001-2005; W/49mm Black Insert	
Land Rover; LR3; 2002-2005; W/49mm Black Insert	
Land Rover; Range Rover; 2002; W/49mm Black Insert	
Land Rover; Range Rover; 2003-2005; W/49mm Black Insert	
Maserati; Coupe; 2004-2006; W/49mm Black Insert	
Maserati; GranTurismo; 2014; W/49mm Black Insert	
Maserati; Quattroporte; 2004-2008; W/49mm Black Insert	
Maserati; Spyder; 2004-2006; W/49mm Black Insert	
Mercedes-Benz; C Series; 2001-2006; W/49mm Black Insert	
Mercedes-Benz; CL; 2000-2006; W/49mm Black Insert	
Mercedes-Benz; E320; 2001-2005; W/49mm Black Insert	
Mercedes-Benz; E430; 2001-2002; W/49mm Black Insert	
Mercedes-Benz; E500; 2003-2005; W/49mm Black Insert	
Mercedes-Benz; E55 AMG; 1999; W/49mm Black Insert; Jul. & Newer	
Mercedes-Benz; E55 AMG; 2000-2005; W/49mm Black Insert	
Mercedes-Benz; S Series; 2006; W/49mm Black Insert	
Mercedes-Benz; S430; 2000-2006; W/49mm Black Insert	
Mercedes-Benz; S500; 2000; W/49mm Black Insert	
Mercedes-Benz; S500; 2001; W/49mm Black Insert	

# Numerical Listing

<p style="text-align: center;"><b>Service Pack</b> <b>20040 (W/51mm Orange Insert)</b></p>	
 <p>Audi; A3, A4, A5 &amp; Quattro; 2002-2007; W/51mm Orange Insert  Audi; A3, A4, A5 &amp; Quattro; 2008; W/51mm Orange Insert  Audi; A6; 2002-2004; W/51mm Orange Insert  Audi; A6; 2006-2008; W/51mm Orange Insert  Audi; A6; 2009; W/51mm Orange Insert  Audi; A6; 2010; W/51mm Orange Insert  Audi; A6; 2011; W/51mm Orange Insert  Audi; A6 Quattro; 2006-2008; W/51mm Orange Insert  Audi; A6 Quattro; 2010; W/51mm Orange Insert  Audi; A6 Quattro; 2011; W/51mm Orange Insert  Audi; A8; 2000; W/51mm Orange Insert  Audi; A8 Quattro; 2000-2002; W/51mm Orange Insert  Audi; A8 Quattro; 2003; W/51mm Orange Insert  Audi; A8 Quattro; 2004-2011; W/51mm Orange Insert  Audi; Allroad Quattro; 2001-2005; W/51mm Orange Insert  Audi; Q7; 2007-2009; W/51mm Orange Insert  Audi; Q7; 2010; W/51mm Orange Insert  Audi; Q7; 2011; W/51mm Orange Insert  Audi; Q7; 2012; W/51mm Orange Insert  Audi; R8; 2008-2009; W/51mm Orange Insert  Audi; R8; 2010; W/51mm Orange Insert  Audi; R8; 2011; W/51mm Orange Insert  Audi; R8; 2012; W/51mm Orange Insert  Audi; R8; 2014-2015; W/51mm Orange Insert  Audi; RS4; 2007-2008; W/51mm Orange Insert  Audi; RS6; 2003; W/51mm Orange Insert  Audi; RS7; 2014-2016; W/51mm Orange Insert  Audi; S4; 2002; W/51mm Orange Insert  Audi; S4; 2004-2009; W/51mm Orange Insert  Audi; S6; 2007-2009; W/51mm Orange Insert  Audi; S6; 2010; W/51mm Orange Insert  Audi; S6; 2011; W/51mm Orange Insert  Audi; S8; 2003; W/51mm Orange Insert  Audi; S8; 2004-2006; W/51mm Orange Insert  Audi; S8; 2007-2008; W/51mm Orange Insert  Audi; S8; 2009; W/51mm Orange Insert  Audi; S8; 2015; W/51mm Orange Insert  Bentley; Azure; 2007-2009; W/51mm Orange Insert  Bentley; Continental; 2003-2005; W/51mm Orange Insert  Bentley; Continental; 2006-2010; W/51mm Orange Insert  Bentley; Continental; 2012-2014; W/51mm Orange Insert  Bentley; Continental; 2015; W/51mm Orange Insert  Bentley; Mulsanne; 2011-2015; W/51mm Orange Insert  BMW; 1 Series; 2008-2011; W/51mm Orange Insert  BMW; 1 Series; 2012-2013; W/51mm Orange Insert  BMW; 228i; 2014  BMW; 228i; 2015  BMW; 320i; 2001-2002; W/51mm Orange Insert  BMW; 320i; 2003-2005; W/51mm Orange Insert  BMW; 320i; 2014  BMW; 320i xDrive; 2014  BMW; 323Ci; 2000; W/51mm Orange Insert  BMW; 323i; 2000; W/51mm Orange Insert  BMW; 323i; 2006; W/51mm Orange Insert; Jun. &amp; Newer  BMW; 323i; 2007-2010; W/51mm Orange Insert  BMW; 325; 2001-2002; W/51mm Orange Insert  BMW; 325; 2003-2006; W/51mm Orange Insert  BMW; 328Ci; 2000; W/51mm Orange Insert  BMW; 328d; 2014  BMW; 328d xDrive; 2014</p>	<p>BMW; 328i; 2000; W/51mm Orange Insert  BMW; 328i; 2007-2009; W/51mm Orange Insert  BMW; 328i; 2010-2013; W/51mm Orange Insert  BMW; 328i; 2014; W/51mm Orange Insert  BMW; 328i; 2015; W/51mm Orange Insert  BMW; 328i GT xDrive; 2014  BMW; 328i GT xDrive; 2015; W/51mm Orange Insert  BMW; 328i xDrive; 2009; W/51mm Orange Insert  BMW; 328i xDrive; 2010-2013; W/51mm Orange Insert  BMW; 328i xDrive; 2014; W/51mm Orange Insert  BMW; 328i xDrive; 2015; W/51mm Orange Insert  BMW; 328xi; 2007-2008; W/51mm Orange Insert  BMW; 330; 2001-2002; W/51mm Orange Insert  BMW; 330; 2003-2006; W/51mm Orange Insert  BMW; 335d; 2009; W/51mm Orange Insert  BMW; 335d; 2010-2011; W/51mm Orange Insert  BMW; 335i; 2007-2009; W/51mm Orange Insert  BMW; 335i; 2010-2013; W/51mm Orange Insert  BMW; 335i; 2014; W/51mm Orange Insert  BMW; 335i GT xDrive; 2014; W/51mm Orange Insert  BMW; 335i GT xDrive; 2015; W/51mm Orange Insert  BMW; 335i xDrive; 2009; W/51mm Orange Insert  BMW; 335i xDrive; 2010-2013; W/51mm Orange Insert  BMW; 335i xDrive; 2014; W/51mm Orange Insert  BMW; 335i xDrive; 2015; W/51mm Orange Insert  BMW; 335is; 2012-2013; W/51mm Orange Insert  BMW; 335xi; 2007-2008; W/51mm Orange Insert  BMW; 428i; 2014; W/51mm Orange Insert  BMW; 428i xDrive; 2014; W/51mm Orange Insert  BMW; 428i xDrive; 2015; W/51mm Orange Insert  BMW; 435i; 2014; W/51mm Orange Insert  BMW; 435i; 2015; W/51mm Orange Insert  BMW; 435i; 2016; W/51mm Orange Insert  BMW; 435i xDrive; 2014; W/51mm Orange Insert  BMW; 435i xDrive; 2015; W/51mm Orange Insert  BMW; 525i; 2001; W/51mm Orange Insert  BMW; 525i; 2002; W/51mm Orange Insert  BMW; 525i; 2003-2005; W/51mm Orange Insert  BMW; 525i; 2006-2007; W/51mm Orange Insert  BMW; 525xi; 2006-2007; W/51mm Orange Insert  BMW; 528; 1997-1999; W/51mm Orange Insert  BMW; 528; 2000; W/51mm Orange Insert  BMW; 528; 2008-2011; W/51mm Orange Insert  BMW; 528; 2012-2014; W/51mm Orange Insert  BMW; 528; 2015-2016; W/51mm Orange Insert  BMW; 528xi; 2008; W/51mm Orange Insert  BMW; 530; 2001; W/51mm Orange Insert  BMW; 530; 2002; W/51mm Orange Insert  BMW; 530; 2003-2005; W/51mm Orange Insert  BMW; 530; 2006-2007; W/51mm Orange Insert  BMW; 535; 2008-2011; W/51mm Orange Insert  BMW; 535; 2012-2014; W/51mm Orange Insert  BMW; 535; 2015-2016; W/51mm Orange Insert  BMW; 535d; 2014; W/51mm Orange Insert  BMW; 535d; 2015-2016; W/51mm Orange Insert  BMW; 535d xDrive; 2014; W/51mm Orange Insert  BMW; 535d xDrive; 2015-2016; W/51mm Orange Insert  BMW; 535xi; 2008; W/51mm Orange Insert  BMW; 540i; 1997-1999; W/51mm Orange Insert  BMW; 540i; 2000; W/51mm Orange Insert  BMW; 540i; 2001; W/51mm Orange Insert  BMW; 540i; 2002; W/51mm Orange Insert  BMW; 540i; 2003; W/51mm Orange Insert  BMW; 545i; 2004-2005; W/51mm Orange Insert  BMW; 550; 2006-2011; W/51mm Orange Insert  BMW; 550; 2012-2014; W/51mm Orange Insert  BMW; 550; 2015-2016; W/51mm Orange Insert  BMW; 640; 2012-2015; W/51mm Orange Insert  BMW; 640; 2016  BMW; 645Ci; 2004-2005; W/51mm Orange Insert  BMW; 650; 2006-2010; W/51mm Orange Insert  BMW; 650; 2012-2015; W/51mm Orange Insert  BMW; 650; 2016  BMW; 650i Gran Coupe xDrive; 2016  BMW; 740i; 1997-1999; W/51mm Orange Insert</p>



# Numerical Listing

BMW; 740i; 2000-2001; W/51mm Orange Insert  
BMW; 740i; 2011; W/51mm Orange Insert  
BMW; 740i; 2012-2015; W/51mm Orange Insert  
BMW; 740iL; 1997-1999; W/51mm Orange Insert  
BMW; 740iL; 2000; W/51mm Orange Insert  
BMW; 740iL; 2001; W/51mm Orange Insert  
BMW; 740Li; 2011; W/51mm Orange Insert  
BMW; 740Li; 2012-2015; W/51mm Orange Insert  
BMW; 740Li xDrive; 2013-2015; W/51mm Orange Insert  
BMW; 745; 2002; W/51mm Orange Insert  
BMW; 745; 2003; W/51mm Orange Insert  
BMW; 745; 2004-2005; W/51mm Orange Insert  
BMW; 750; 2006-2011; W/51mm Orange Insert  
BMW; 750; 2012-2015; W/51mm Orange Insert  
BMW; 750iL; 1997-1999; W/51mm Orange Insert  
BMW; 750iL; 2000; W/51mm Orange Insert  
BMW; 750iL; 2001; W/51mm Orange Insert  
BMW; 760i; 2004-2005; W/51mm Orange Insert  
BMW; 760i; 2006; W/51mm Orange Insert  
BMW; 760Li; 2003; W/51mm Orange Insert  
BMW; 760Li; 2004-2008; W/51mm Orange Insert  
BMW; 760Li; 2010-2011; W/51mm Orange Insert  
BMW; 760Li; 2012-2015; W/51mm Orange Insert  
BMW; ActiveHybrid 3; 2013-2014; W/51mm Orange Insert  
BMW; ActiveHybrid 5; 2012-2014; W/51mm Orange Insert  
BMW; ActiveHybrid 5; 2015; W/51mm Orange Insert  
BMW; ActiveHybrid 7; 2013-2015; W/51mm Orange Insert  
BMW; Alpina B7; 2007-2008; W/51mm Orange Insert  
BMW; Alpina B7; 2011; W/51mm Orange Insert  
BMW; Alpina B7; 2012-2014; W/51mm Orange Insert  
BMW; Alpina B7 xDrive; 2011; W/51mm Orange Insert  
BMW; Alpina B7L; 2011; W/51mm Orange Insert  
BMW; Alpina B7L xDrive; 2011; W/51mm Orange Insert  
BMW; M; 2000-2001; W/51mm Orange Insert  
BMW; M; 2002; W/51mm Orange Insert  
BMW; M; 2003; W/51mm Orange Insert  
BMW; M; 2004-2010; W/51mm Orange Insert  
BMW; M; 2011-2013; W/51mm Orange Insert  
BMW; M; 2014; W/51mm Orange Insert  
BMW; M; 2015; W/51mm Orange Insert  
BMW; X; 2000-2003; W/51mm Orange Insert  
BMW; X; 2004; W/51mm Orange Insert  
BMW; X; 2005-2011; W/51mm Orange Insert  
BMW; X; 2012-2014; W/51mm Orange Insert  
BMW; X; 2015; W/51mm Orange Insert  
BMW; X; 2016; W/51mm Orange Insert  
BMW; Z3; 2000-2002; W/51mm Orange Insert  
BMW; Z4; 2003-2011; W/51mm Orange Insert  
BMW; Z4; 2012-2015; W/51mm Orange Insert  
BMW; Z4; 2016; W/51mm Orange Insert  
BMW; Z8; 2000-2002; W/51mm Orange Insert  
BMW; Z8; 2003; W/51mm Orange Insert  
Bugatti; Veyron 16.4; 2006; W/51mm Orange Insert  
Ferrari; 612 Scaglietti; 2005-2009; W/51mm Orange Insert  
Ferrari; Enzo; 2003-2004; W/51mm Orange Insert  
Ferrari; F430; 2006-2009; W/51mm Orange Insert  
Ferrari; Maranello; 2001-2005; W/51mm Orange Insert  
Land Rover; LR3; 2002-2005; W/51mm Orange Insert  
Land Rover; Range Rover; 2002; W/51mm Orange Insert  
Land Rover; Range Rover; 2003-2005; W/51mm Orange Insert  
Maserati; Coupe; 2004-2006; W/51mm Orange Insert  
Maserati; GranTurismo; 2014; W/51mm Orange Insert  
Maserati; Quattroporte; 2004-2008; W/51mm Orange Insert  
Maserati; Spyder; 2004-2006; W/51mm Orange Insert  
Mercedes-Benz; C Series; 2001-2006; W/51mm Orange Insert  
Mercedes-Benz; CL; 2000-2006; W/51mm Orange Insert  
Mercedes-Benz; E320; 2001-2005; W/51mm Orange Insert  
Mercedes-Benz; E430; 2001-2002; W/51mm Orange Insert  
Mercedes-Benz; E500; 2003-2005; W/51mm Orange Insert  
Mercedes-Benz; E55 AMG; 1999; W/51mm Orange Insert; Jul. & Newer  
Mercedes-Benz; E55 AMG; 2000-2005; W/51mm Orange Insert  
Mercedes-Benz; S Series; 2006; W/51mm Orange Insert  
Mercedes-Benz; S430; 2000-2006; W/51mm Orange Insert  
Mercedes-Benz; S500; 2000; W/51mm Orange Insert  
Mercedes-Benz; S500; 2001; W/51mm Orange Insert

Mercedes-Benz; S500; 2002-2006; W/51mm Orange Insert  
Mercedes-Benz; S55 AMG; 2001-2006; W/51mm Orange Insert  
Mercedes-Benz; S600; 2001-2006; W/51mm Orange Insert  
Mercedes-Benz; S65 AMG; 2006; W/51mm Orange Insert  
Mercedes-Benz; SL500; 2000-2005; W/51mm Orange Insert  
Mercedes-Benz; SL55 AMG; 2003; W/51mm Orange Insert  
Mercedes-Benz; SL55 AMG; 2004; W/51mm Orange Insert  
Mercedes-Benz; SL55 AMG; 2005; W/51mm Orange Insert  
Mercedes-Benz; SL600; 2001-2002; W/51mm Orange Insert  
Mercedes-Benz; SL600; 2004-2005; W/51mm Orange Insert  
Mercedes-Benz; SL65 AMG; 2005; W/51mm Orange Insert  
Mercedes-Benz; SLR McLaren; 2004; W/51mm Orange Insert  
Mercedes-Benz; SLR McLaren; 2005; W/51mm Orange Insert  
Mercedes-Benz; SLR McLaren; 2006; W/51mm Orange Insert  
Mercedes-Benz; SLR McLaren; 2007; W/51mm Orange Insert  
Mini; Cooper; 2008-2009; W/51mm Orange Insert  
Mini; Cooper; 2010-2013; W/51mm Orange Insert  
Mini; Cooper; 2014; W/51mm Orange Insert  
Mini; Cooper; 2015; W/51mm Orange Insert  
Porsche; 911; 2005-2006; W/51mm Orange Insert  
Porsche; 911; 2007-2009; W/51mm Orange Insert  
Porsche; 911; 2010; W/51mm Orange Insert  
Porsche; 911; 2011; W/51mm Orange Insert  
Porsche; 911; 2012; W/51mm Orange Insert  
Porsche; 911; 2013-2014; W/51mm Orange Insert  
Porsche; 911; 2015; W/51mm Orange Insert  
Porsche; Boxster; 2005-2007; W/51mm Orange Insert  
Porsche; Boxster; 2008-2010; W/51mm Orange Insert  
Porsche; Boxster; 2011; W/51mm Orange Insert  
Porsche; Boxster; 2012-2013; W/51mm Orange Insert  
Porsche; Boxster; 2014-2016; W/51mm Orange Insert  
Porsche; Carrera GT; 2004-2005; W/51mm Orange Insert  
Porsche; Cayenne; 2003-2006; W/51mm Orange Insert  
Porsche; Cayenne; 2008-2010; W/51mm Orange Insert  
Porsche; Cayenne; 2011-2013; W/51mm Orange Insert  
Porsche; Cayenne; 2014; W/51mm Orange Insert  
Porsche; Cayman; 2006-2007; W/51mm Orange Insert  
Porsche; Cayman; 2008-2010; W/51mm Orange Insert  
Porsche; Cayman; 2011; W/51mm Orange Insert  
Porsche; Cayman; 2012-2016; W/51mm Orange Insert  
Porsche; Panamera; 2010; W/51mm Orange Insert  
Porsche; Panamera; 2011; W/51mm Orange Insert  
Rolls Royce; Phantom; 2007-2010; W/51mm Orange Insert  
Volkswagen; Phaeton; 2004-2006; W/51mm Orange Insert; W/315 MHz Sensor  
Volkswagen; Touareg; 2004-2006; W/51mm Orange Insert  
Volkswagen; Touareg; 2007; W/51mm Orange Insert  
Volkswagen; Touareg; 2008-2009; W/51mm Orange Insert  
Volkswagen; Touareg; 2010; W/51mm Orange Insert  
Volkswagen; Touareg; 2011-2013; W/51mm Orange Insert; W/315 MHz Sensor  
Volkswagen; Touareg; 2014; W/51mm Orange Insert; W/315 MHz Sensor




20043



Chrysler; 200; 2015  
Dodge; Dart; 2013-2015



# Numerical Listing

Service Pack 20046	Service Pack 20049
 <p>Hyundai; Sonata; 2015-2016; Rubber Valve Hyundai; Tucson; 2015-2016; Rubber Valve Kia; Sedona; 2015-2016; Rubber Valve Kia; Soul; 2014 Kia; Soul; 2015; Rubber Valve Kia; Soul; 2016; Rubber Valve</p>	 <p>Mercedes-Benz; B200; 2014 Mercedes-Benz; B200; 2015-2016 Mercedes-Benz; B250; 2015 Mercedes-Benz; B250; 2016 Mercedes-Benz; C Series; 2014-2015 Mercedes-Benz; C Series; 2016 Mercedes-Benz; C250; 2014-2016 Mercedes-Benz; CLA250; 2014-2016 Mercedes-Benz; CLA45 AMG; 2014-2016 Mercedes-Benz; CLS550; 2014-2016 Mercedes-Benz; CLS63 AMG S; 2014-2016 Mercedes-Benz; E250; 2014-2016 Mercedes-Benz; E350; 2014-2016 Mercedes-Benz; E400; 2014-2016 Mercedes-Benz; E550; 2014-2016 Mercedes-Benz; E63 AMG; 2014-2016 Mercedes-Benz; E63 AMG S; 2014-2016 Mercedes-Benz; G550; 2014-2016 Mercedes-Benz; G63 AMG; 2014-2016 Mercedes-Benz; GL; 2014-2016 Mercedes-Benz; GL350; 2014-2015 Mercedes-Benz; GL350; 2016 Mercedes-Benz; GL63 AMG; 2014-2016 Mercedes-Benz; GLK250; 2014-2016 Mercedes-Benz; GLK350; 2014-2016 Mercedes-Benz; ML350; 2015 Mercedes-Benz; ML350; 2016 Mercedes-Benz; ML550; 2015-2016 Mercedes-Benz; ML63 AMG; 2014-2016 Mercedes-Benz; S Series; 2013 Mercedes-Benz; S Series; 2014-2016 Mercedes-Benz; S550; 2014-2016 Mercedes-Benz; S600; 2014-2016 Mercedes-Benz; S63 AMG; 2014-2016 Mercedes-Benz; SL550; 2014-2016 Mercedes-Benz; SL63 AMG; 2014-2015 Mercedes-Benz; SL63 AMG; 2016 Mercedes-Benz; SL65 AMG; 2014-2016 Mercedes-Benz; SLK250; 2014-2016 Mercedes-Benz; SLK350; 2014-2016 Mercedes-Benz; SLK55 AMG; 2014 Mercedes-Benz; SLK55 AMG; 2015-2016 Mercedes-Benz; SLS AMG; 2014-2015 Smart; Fortwo; 2014 Smart; Fortwo; 2015</p>
<p style="text-align: center;"><b>20047</b></p>  <p>Chevrolet; Caprice; 2014 Chevrolet; Caprice; 2015 Chevrolet; Corvette; 2014-2015 Chevrolet; Corvette; 2016 Maserati; Ghibli; 2014-2015 Maserati; Quattroporte; 2014-2015</p>	

# Numerical Listing

## Service Pack

20398



Chrysler; 300; 2010  
 Chrysler; 300; 2011  
 Chrysler; 300; 2012; W/Rubber Stem Snap-in Sensor  
 Chrysler; 300; 2013-2015  
 Chrysler; 300; 2016  
 Chrysler; Town & Country; 2011-2014  
 Chrysler; Town & Country; 2015  
 Chrysler; Town & Country; 2016  
 Dodge; Challenger; 2010-2012; W/Rubber Stem Snap-in Sensor  
 Dodge; Challenger; 2013-2015; W/Rubber Stem Snap-in Sensor  
 Dodge; Challenger; 2016; W/Rubber Stem Snap-in Sensor  
 Dodge; Charger; 2010; W/Rubber Stem Snap-in Sensor  
 Dodge; Charger; 2011; W/Rubber Stem Snap-in Sensor  
 Dodge; Charger; 2012-2015  
 Dodge; Charger; 2016  
 Dodge; Durango; 2011-2015  
 Dodge; Grand Caravan; 2011-2015  
 Dodge; Grand Caravan; 2016  
 Dodge; Journey; 2010; OEM No. 56029398AA; Rubber Valve  
 Dodge; Journey; 2011-2015  
 Dodge; Journey; 2016  
 Dodge; Ram 4500; 2010; W/Rubber Stem Snap-in Sensor  
 Dodge; Ram 5500; 2010; W/Rubber Stem Snap-in Sensor  
 Dodge; Ram Series; 2010; W/Rubber Stem Snap-in Sensor  
 Fiat; 500; 2012-2015  
 Fiat; 500; 2016  
 Jeep; Grand Cherokee; 2011-2015  
 Jeep; Wrangler; 2013-2015  
 Jeep; Wrangler; 2016  
 Ram; 4500; 2012  
 Ram; 5500; 2012  
 Ram; C/V; 2012; Rubber Valve  
 Ram; C/V; 2013-2015  
 Ram; ProMaster; 2014-2015  
 Ram; ProMaster; 2016  
 Ram; Ram Series; 2011; W/Rubber Stem Snap-in Sensor  
 Ram; Ram Series; 2012-2013  
 Volkswagen; Routan; 2011-2012  
 Volkswagen; Routan; 2014

20635



Jeep; Cherokee; 2014  
 Jeep; Cherokee; 2015; Rubber Valve  
 Ram; Ram Series; 2014-2015

## Service Pack

INDIRECT

Audi; A3, A4,A5 & Quattro; 2013-2016  
 Audi; A4 allroad; 2013-2016  
 Audi; A6; 2013-2016  
 Audi; A7 Quattro; 2013-2014  
 Audi; A8; 2013-2016  
 Audi; Q5; 2013-2016  
 Audi; Q7; 2013-2016  
 Audi; RS5; 2013-2015  
 Audi; S4; 2013-2014  
 Audi; S5; 2013-2015  
 Audi; S6; 2013-2015  
 Audi; S7; 2013-2015  
 Audi; S8; 2013-2014  
 Audi; S8; 2015  
 Audi; SQ5; 2013-2014  
 Audi; TT; 2013-2015  
 Buick; Allure; 2006  
 Buick; Century; 1999-2005  
 Buick; LeSabre; 2000-2005  
 Buick; Park Avenue; 1998-2005  
 Buick; Regal; 1999-2004  
 Buick; Rendezvous; 2003-2007  
 Chevrolet; Impala; 2000-2005  
 Chevrolet; Monte Carlo; 2000-2005  
 Honda; Accord; 2013-2016  
 Honda; CR-V; 2014-2015  
 Honda; Fit; 2015-2016  
 Lexus; LS430; 2004-2006  
 Lexus; RX330; 2004-2005  
 Mazda; 3; 2014-2015  
 Mazda; 6; 2014-2016  
 Mazda; CX-5; 2013-2016  
 Mazda; MX-5 Miata; 2016  
 Oldsmobile; Alero; 1999-2000  
 Oldsmobile; Aurora; 2001-2003  
 Pontiac; Aztek; 2003-2005  
 Pontiac; Bonneville; 2000-2005  
 Pontiac; Grand Am; 1999-2002  
 Pontiac; Grand Prix; 2004-2006  
 Pontiac; Vibe; 2005-2007  
 Toyota; Sienna; 2005  
 Toyota; Yaris; 2015  
 Volkswagen; Beetle; 2013-2014  
 Volkswagen; Eos; 2015  
 Volkswagen; Golf; 2013-2015  
 Volkswagen; GTI; 2013-2015  
 Volkswagen; Jetta; 2013-2015  
 Volkswagen; Passat; 2013-2015  
 Volkswagen; Routan; 2015  
 Volkswagen; Tiguan; 2014  
 Volkswagen; Tiguan; 2015  
 Volvo; XC60; 2015